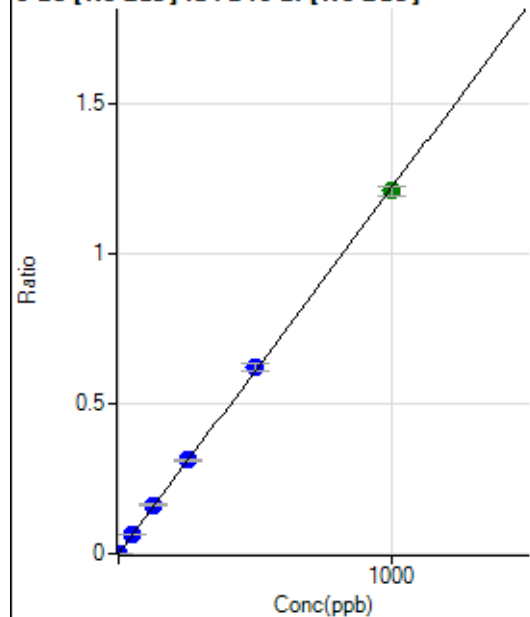


Calibration for 005CALS.d

Batch Folder: D:\Agilent\ICPMH\1\DATA\P7102724MS3.b\
 Analysis File: P7102724MS3.batch.bin
 DA Date-Time: 2024-10-28 11:20:57
 Calibration Title:
 Calibration Method: External Calibration
 VIS Interpolation Fit:

Level	Standard Data File	Sample Name	Acq. Date-Time
1	004CALB.d	S00	2024-10-27 15:55:16
2	005CALS.d	S02	2024-10-27 15:58:34
3	006CALS.d	S03	2024-10-27 16:01:54
4	007CALS.d	S04	2024-10-27 16:05:02
5	008CALS.d	S05	2024-10-27 16:08:01
6	009CALS.d	S06	2024-10-27 16:10:52
7	011CALS.d	S07	2024-10-27 16:16:58
8	012CALS.d	S08	2024-10-27 16:19:46

9 Be [No Gas] ISTD:6 Li [No Gas]

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	32.24	0.0000	P	34.9
2	☐	1.000	0.987	1121.86	0.0012	P	2.7
3	☐	50.000	52.961	58840.57	0.0645	P	4.8
4	☐	125.000	133.928	152639.31	0.1631	P	1.9
5	☐	250.000	255.454	300444.82	0.3111	P	2.0
6	☐	500.000	509.657	591926.74	0.6207	P	3.9
7	☐	1000.000	992.544	1129333.95	1.2088	A	2.9
8	☐			179.97	0.0002	P	22.7

$$y = 0.0012 * x + 3.7135E-005$$

$$R = 0.9999$$

$$DL = 0.03189$$

$$BEC = 0.03049$$

Weight: <None>


Min Conc: 0

12 C [No Gas] No available calibration points

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐						
2	☐						
3	☐						
4	☐						
5	☐						
6	☐						
7	☐						
8	☐						

12 C [He] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐						
2	☐						
3	☐						
4	☐						
5	☐						
6	☐						
7	☐						
8	☐						

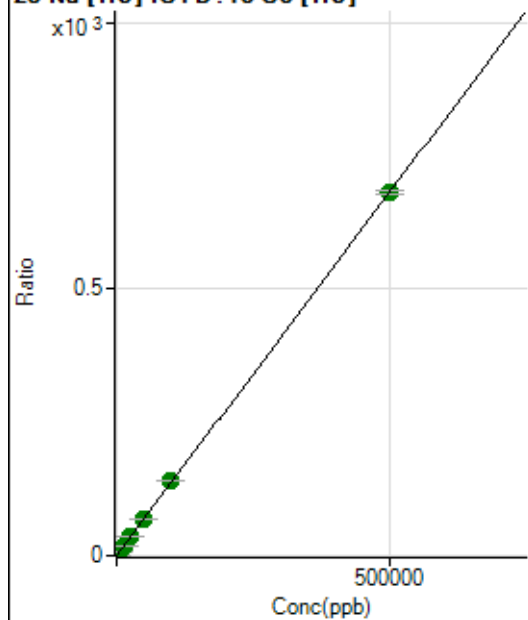23 Na [He] ISTD:45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	57271.70	0.1784	P	0.5
2	☐	500.000	511.311	283066.89	0.8752	P	0.9
3	☐	5000.000	5210.170	2409228.32	7.2787	A	0.2
4	☐	12500.000	13230.490	5998447.27	18.2085	A	0.6
5	☐	25000.000	26134.250	11690944.55	35.7933	A	0.4
6	☐	50000.000	50833.485	22494820.50	69.4527	A	1.8
7	☐	100000.00	102458.77	45311904.32	139.8059	A	0.4
8	☐	500000.00	499347.80	230733363.2	680.6733	A	1.2

$$y = 0.0014 * x + 0.1784$$


$$R = 1.0000$$

$$DL = 2.145$$

$$BEC = 130.9$$

Weight: <None>

Min Conc: 0

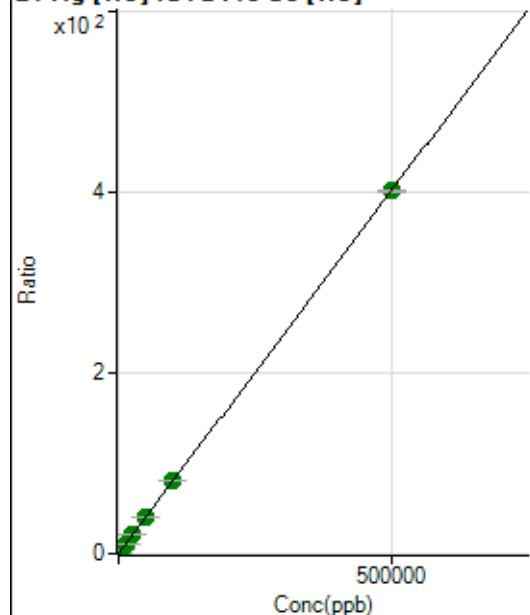24 Mg [He] ISTD:45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	266.67	0.0008	P	9.3
2	☐	500.000	538.996	140287.32	0.4338	P	1.9
3	☐	5000.000	5193.380	1381103.99	4.1725	A	0.7
4	☐	12500.000	12997.532	3439470.33	10.4412	A	1.4
5	☐	25000.000	25716.707	6747301.22	20.6580	A	0.2
6	☐	50000.000	50181.297	13056449.95	40.3094	A	1.2
7	☐	100000.00	101251.03	26361399.88	81.3316	A	0.4
8	☐	500000.00	499681.41	136059305.7	401.3740	A	0.3

$$y = 8.0326\text{E-}004 * x + 8.3067\text{E-}004$$


$$R = 1.0000$$

$$DL = 0.2898$$

$$BEC = 1.034$$

Weight: <None>

Min Conc: 0

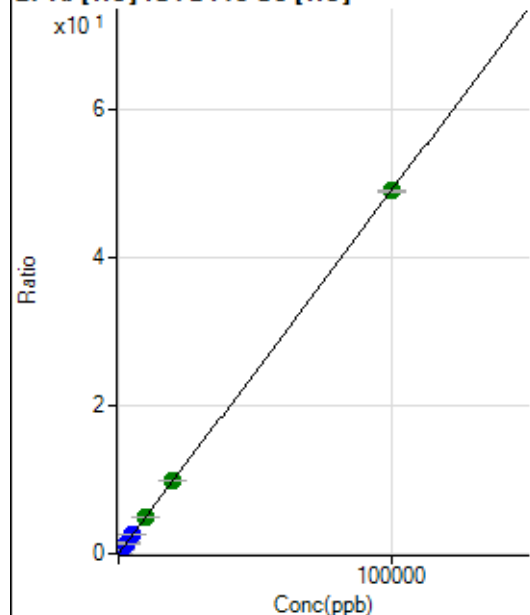27 Al [He] ISTD:45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	281.12	0.0009	P	5.4
2	☐	20.000	19.562	3388.19	0.0105	P	3.1
3	☐	1000.000	1242.551	202118.07	0.6107	P	1.3
4	☐	2500.000	2902.754	469571.95	1.4254	P	0.8
5	☐	5000.000	5289.550	848140.23	2.5968	P	0.6
6	☐	10000.000	10137.181	1611500.58	4.9758	A	2.8
7	☐	20000.000	20244.626	3220321.06	9.9362	A	0.7
8	☐	100000.00	99910.385	16621227.25	49.0332	A	0.6

$$y = 4.9076\text{E-}004 * x + 8.7589\text{E-}004$$

$$R = 1.0000$$


$$DL = 0.2905$$

$$BEC = 1.785$$

Weight: <None>

Min Conc: 0

28 Si [No Gas] ISTD :45 Sc [No Gas]

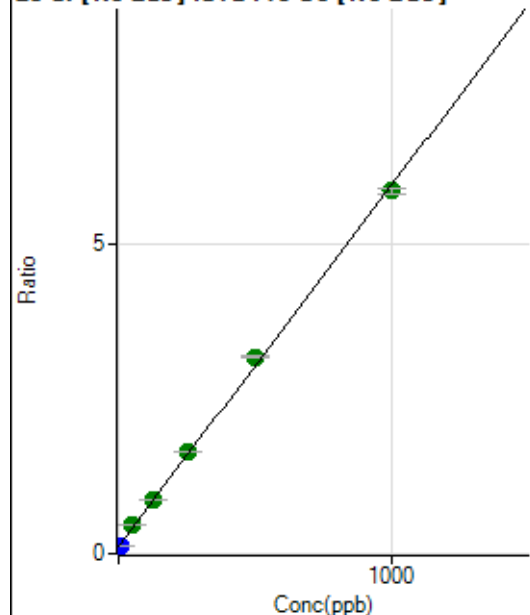

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	405670.48	0.1180	P	5.0
2	☐	10.000	0.117	418412.54	0.1187	P	0.8
3	☐	50.000	59.561	1686366.80	0.4642	A	1.5
4	☐	125.000	127.866	3139326.00	0.8613	A	1.4
5	☐	250.000	260.413	5991169.56	1.6319	A	0.5
6	☐	500.000	524.064	11654269.97	3.1646	A	1.0
7	☐	1000.000	984.627	21622770.51	5.8420	A	1.9
8	☐			425113.23	0.1147	P	0.6

$$y = 0.0058 * x + 0.1180$$

$$R = 0.9994$$


$$DL = 3.058$$

$$BEC = 20.29$$

Weight: <None>

Min Conc: 0

31 P [He] ISTD :45 Sc [He]

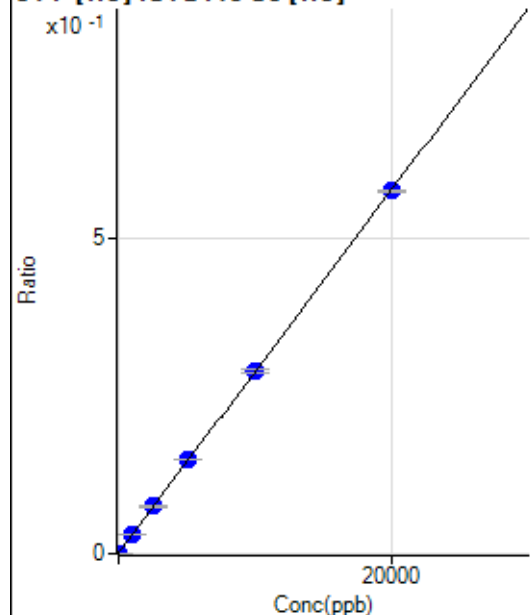

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	-12.959	171.11	0.0005	P	8.7
2	☐	0.000	12.959	413.34	0.0013	P	6.7
3	☐	1000.000	1013.080	9932.19	0.0300	P	0.3
4	☐	2500.000	2576.433	24678.85	0.0749	P	1.6
5	☐	5000.000	5120.511	48338.37	0.1480	P	0.4
6	☐	10000.000	10022.191	93536.92	0.2888	P	2.1
7	☐	20000.000	19948.569	186023.17	0.5740	P	0.5
8	☐			305.56	0.0009	P	5.9

$$y = 2.8726E-005 * x + 9.0537E-004$$

$$R = 1.0000$$


$$DL = 6.894$$

$$BEC = 31.52$$

Weight: <None>

Min Conc: 0

34 S [No Gas] ISTD:45 Sc [No Gas]

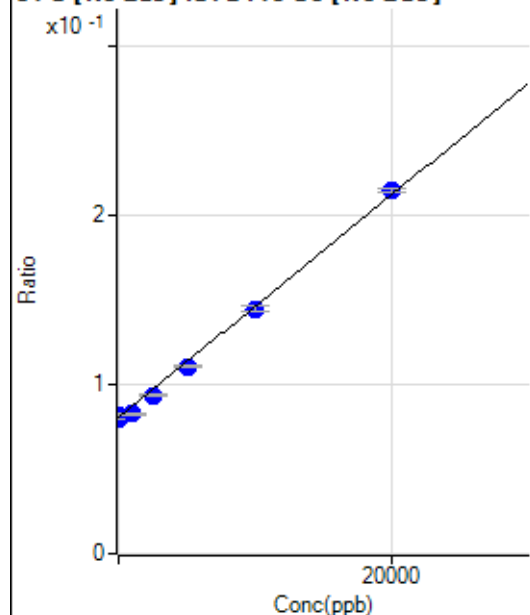

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	167.052	280373.86	0.0816	P	6.0
2	☐	0.000	-167.052	279890.48	0.0794	P	0.3
3	☐	1000.000	273.001	298828.65	0.0823	P	0.6
4	☐	2500.000	1984.788	340815.93	0.0935	P	1.4
5	☐	5000.000	4567.883	405602.00	0.1105	P	0.9
6	☐	10000.000	9745.167	532032.02	0.1445	P	2.4
7	☐	20000.000	20336.197	792367.84	0.2141	P	1.2
8	☐			235888.48	0.0637	P	1.1

$$y = 6.5693\text{E-}006 * x + 0.0805$$

$$R = 0.9991$$

$$DL = 1169$$

$$BEC = 1.225\text{E}+04$$

Weight: <None>

Min Conc: 0


35 Cl [No Gas] No available calibration points



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐						
2	☐						
3	☐						
4	☐						
5	☐						
6	☐						
7	☐						
8	☐						

35 Cl [He] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐						
2	☐						
3	☐						
4	☐						
5	☐						
6	☐						
7	☐						
8	☐						

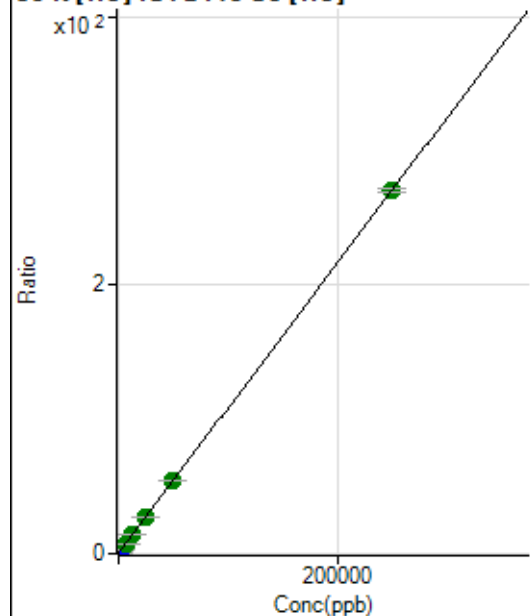39 K [He] ISTD : 45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	87828.06	0.2736	P	0.5
2	☐	500.000	512.460	267454.84	0.8270	P	1.1
3	☐	2500.000	2761.539	1077513.56	3.2554	P	0.3
4	☐	6250.000	6431.263	2377730.45	7.2178	A	0.5
5	☐	12500.000	12713.053	4572779.03	14.0006	A	0.4
6	☐	25000.000	24913.372	8802617.30	27.1739	A	0.3
7	☐	50000.000	49635.736	17459219.60	53.8679	A	0.2
8	☐	250000.00	250063.69	91617339.74	270.2801	A	0.9

$$y = 0.0011 * x + 0.2736$$


$$R = 1.0000$$

$$DL = 3.621$$

$$BEC = 253.4$$

Weight: <None>

Min Conc: 0

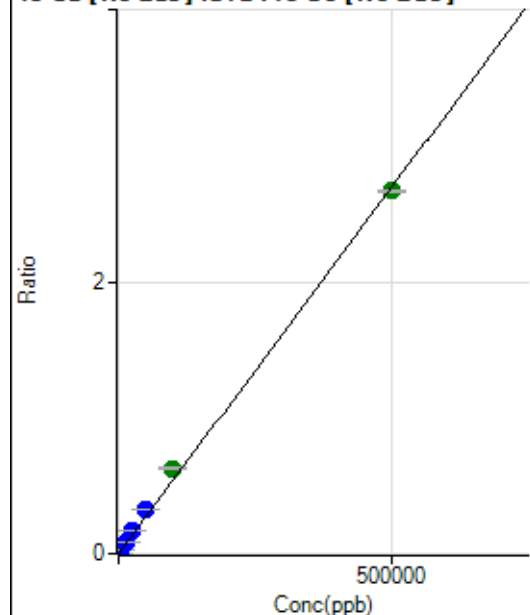43 Ca [No Gas] ISTD:45 Sc [No Gas]

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	386.68	0.0001	P	7.6
2	☐	500.000	508.992	10060.07	0.0029	P	1.6
3	☐	5000.000	6098.606	119681.91	0.0329	P	2.1
4	☐	12500.000	15543.519	305443.73	0.0838	P	1.2
5	☐	25000.000	30472.304	602754.43	0.1642	P	0.7
6	☐	50000.000	59811.857	1186369.89	0.3221	P	0.9
7	☐	100000.00	115954.97	2310993.63	0.6244	A	2.4
8	☐	500000.00	495467.12	9886315.96	2.6677	A	0.8

$$y = 5.3840\text{E-}006 * x + 1.1241\text{E-}004$$


$$R = 0.9993$$

$$DL = 4.776$$

$$BEC = 20.88$$

Weight: <None>

Min Conc: 0

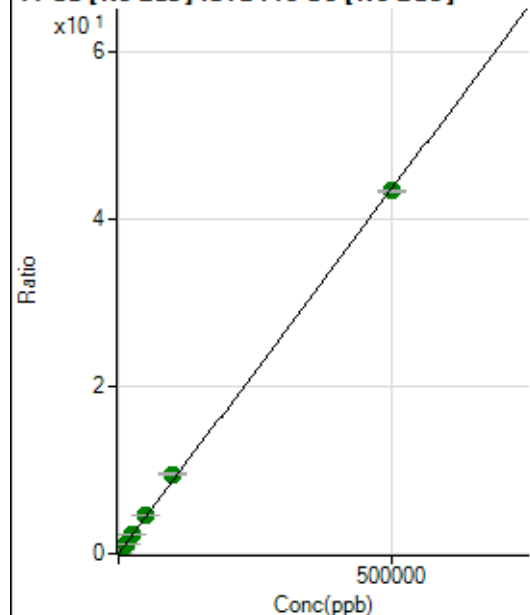44 Ca [No Gas] ISTD:45 Sc [No Gas]

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	20957.06	0.0061	P	5.4
2	☐	500.000	520.245	181081.74	0.0514	P	0.8
3	☐	5000.000	5560.308	1779185.86	0.4898	A	1.2
4	☐	12500.000	13955.743	4447513.41	1.2201	A	0.6
5	☐	25000.000	27397.568	8772775.01	2.3895	A	0.4
6	☐	50000.000	53664.700	17217084.88	4.6745	A	0.4
7	☐	100000.00	108746.78	35035948.09	9.4662	A	2.1
8	☐	500000.00	497722.27	160479898.7	43.3040	A	0.7

$$y = 8.6992\text{E-}005 * x + 0.0061$$

$$R = 0.9998$$


$$DL = 11.4$$

$$BEC = 70.07$$

Weight: <None>

Min Conc: 0

47 Ti [No Gas] ISTD :45 Sc [No Gas]

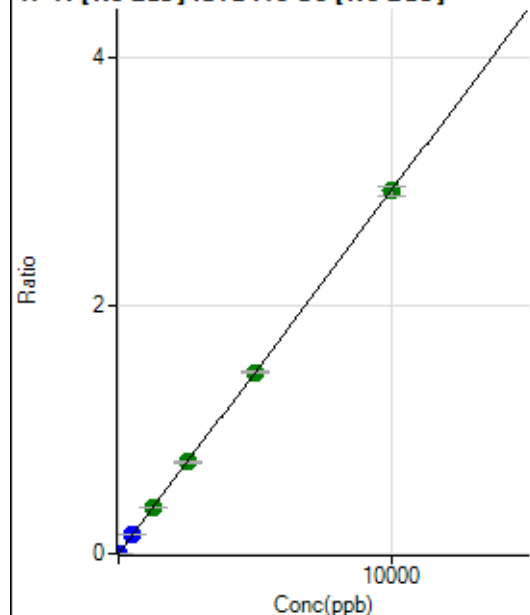

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	215.56	0.0001	P	13.6
2	☐	5.000	4.482	4847.48	0.0014	P	1.6
3	☐	500.000	517.013	550224.54	0.1515	P	1.5
4	☐	1250.000	1278.253	1364788.70	0.3744	A	1.8
5	☐	2500.000	2536.314	2727354.13	0.7428	A	1.8
6	☐	5000.000	4995.863	5387788.08	1.4631	A	1.6
7	☐	10000.000	9988.608	10826151.09	2.9252	A	2.7
8	☐			1657.88	0.0004	P	6.2

$$y = 2.9285\text{E-}004 * x + 6.2287\text{E-}005$$

$$R = 1.0000$$


$$DL = 0.08666$$

$$BEC = 0.2127$$

Weight: <None>

Min Conc: 0

51 V [He] ISTD :45 Sc [He]

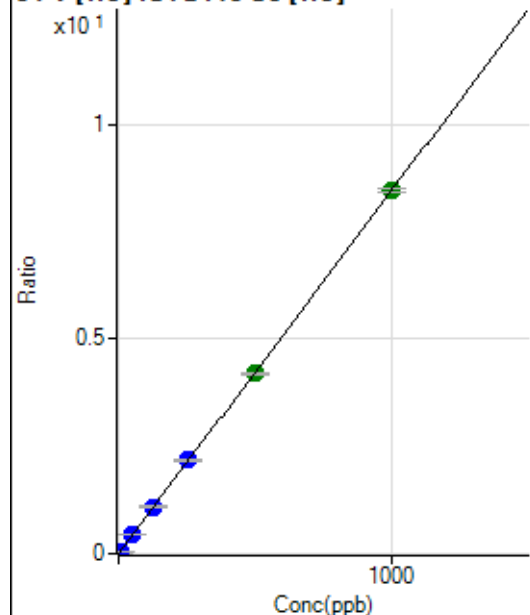

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	17.78	0.0001	P	60.4
2	☐	5.000	4.863	13303.73	0.0411	P	1.5
3	☐	50.000	51.306	143466.84	0.4335	P	1.1
4	☐	125.000	129.548	360518.42	1.0944	P	0.9
5	☐	250.000	257.236	709754.84	2.1731	P	0.3
6	☐	500.000	495.902	1356865.89	4.1892	A	1.3
7	☐	1000.000	999.607	2736895.83	8.4442	A	1.0
8	☐			658.91	0.0019	P	0.8

$$y = 0.0084 * x + 5.5418\text{E-}005$$


$$R = 1.0000$$

$$DL = 0.01188$$

$$BEC = 0.00656$$

Weight: <None>

Min Conc: 0

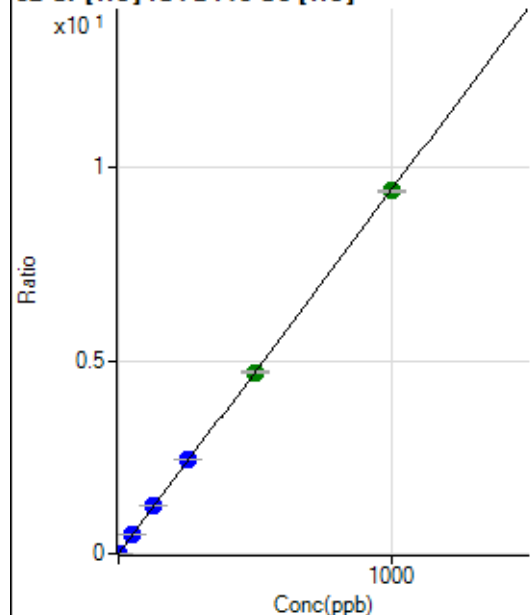52 Cr [He] ISTD:45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	896.70	0.0028	P	5.3
2	☐	2.000	1.917	6739.34	0.0208	P	2.7
3	☐	50.000	52.048	163087.84	0.4927	P	0.3
4	☐	125.000	131.474	408587.39	1.2403	P	1.1
5	☐	250.000	259.190	797752.71	2.4425	P	0.7
6	☐	500.000	498.846	1521820.34	4.6984	A	1.4
7	☐	1000.000	997.368	3043819.30	9.3909	A	0.5
8	☐			10761.10	0.0318	P	5.0

$$y = 0.0094 * x + 0.0028$$


$$R = 0.9999$$

$$DL = 0.04703$$

$$BEC = 0.2968$$

Weight: <None>

Min Conc: 0

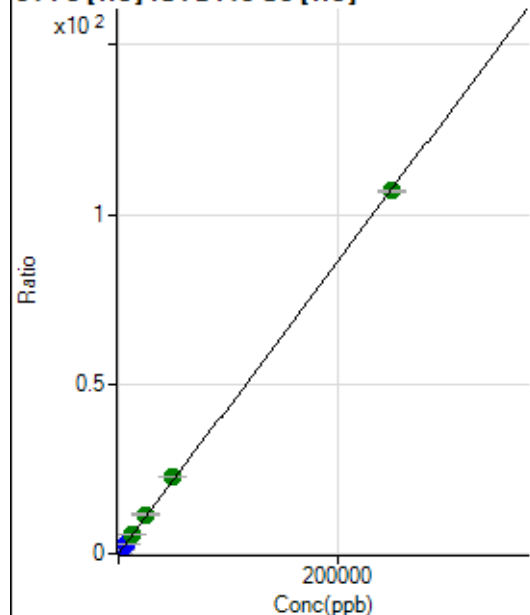54 Fe [He] ISTD:45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	1773.46	0.0055	P	1.9
2	☐	50.000	55.197	9447.48	0.0292	P	1.3
3	☐	2500.000	2873.635	409980.29	1.2387	P	0.5
4	☐	6250.000	7219.286	1022368.78	3.1035	P	0.1
5	☐	12500.000	13595.831	1907366.87	5.8398	A	0.2
6	☐	25000.000	26837.115	3731662.65	11.5219	A	2.2
7	☐	50000.000	53095.124	7385972.18	22.7897	A	1.0
8	☐	250000.00	249114.50	36238519.18	106.9054	A	0.3

$$y = 4.2912E-004 * x + 0.0055$$


$$R = 0.9999$$

$$DL = 0.7473$$

$$BEC = 12.88$$

Weight: <None>

Min Conc: 0

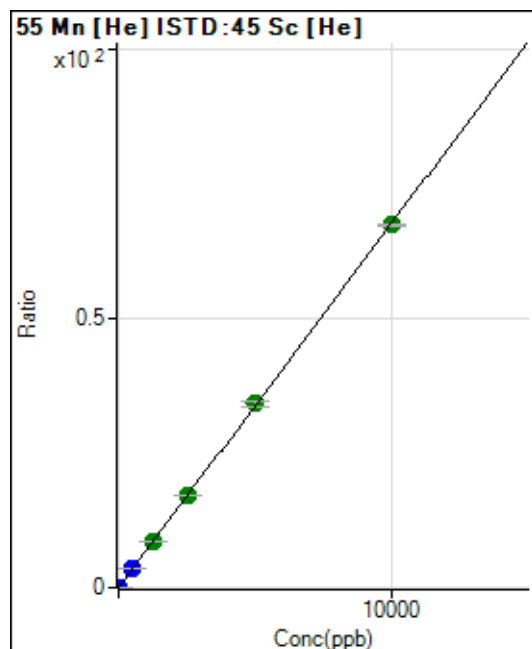

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	397.79	0.0012	P	5.7
2	☐	1.000	0.994	2572.46	0.0080	P	4.6
3	☐	500.000	521.133	1165549.23	3.5214	P	0.2
4	☐	1250.000	1284.873	2859540.76	8.6803	A	0.6
5	☐	2500.000	2538.757	5601513.18	17.1500	A	0.6
6	☐	5000.000	5047.774	11043200.39	34.0979	A	2.5
7	☐	10000.000	9961.008	21807758.29	67.2858	A	0.7
8	☐			12150.78	0.0359	P	4.9

$$y = 0.0068 * x + 0.0012$$


$$R = 1.0000$$

$$DL = 0.03158$$

$$BEC = 0.1835$$

Weight: <None>

Min Conc: 0

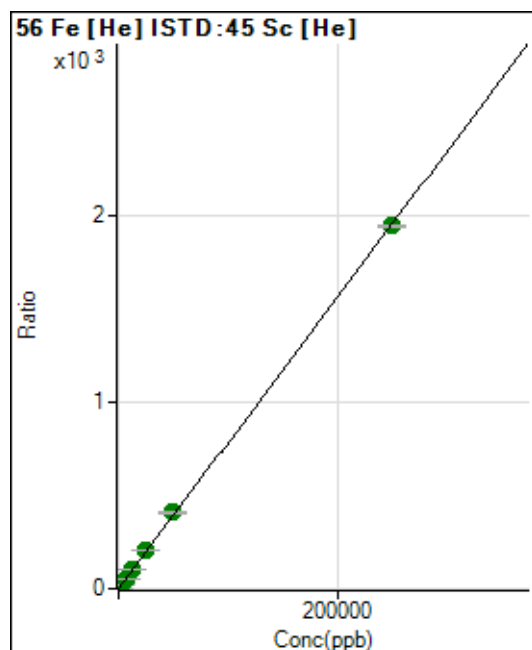

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	12215.06	0.0381	P	1.4
2	☐	50.000	52.940	145528.61	0.4500	P	1.2
3	☐	2500.000	2653.798	6846697.19	20.6864	A	1.4
4	☐	6250.000	6687.701	17153951.27	52.0728	A	0.7
5	☐	12500.000	13241.932	33664370.05	103.0691	A	0.7
6	☐	25000.000	26427.191	66604237.34	205.6592	A	2.8
7	☐	50000.000	52265.831	131806102.4	406.7011	A	1.3
8	☐	250000.00	249354.53	657672874.6	1.940182	A	0.6

$$y = 0.0078 * x + 0.0381$$

$$R = 0.9999$$


$$DL = 0.2113$$

$$BEC = 4.892$$

Weight: <None>

Min Conc: 0

57 Fe [He] ISTD:45 Sc [He]

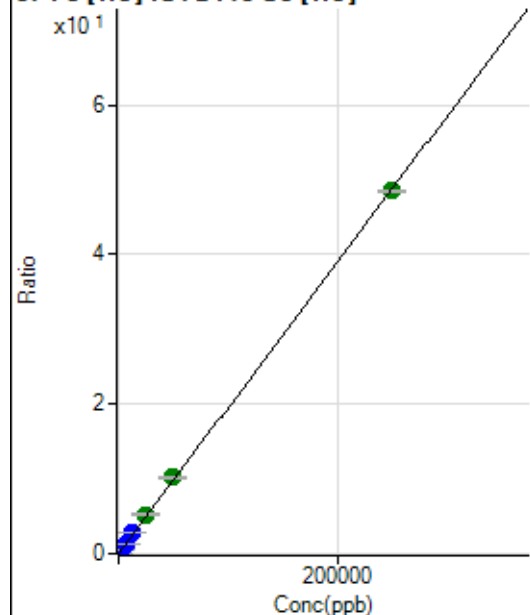

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	3164.81	0.0099	P	5.0
2	☐	50.000	53.485	6554.82	0.0203	P	4.5
3	☐	2500.000	2791.910	183048.59	0.5530	P	0.2
4	☐	6250.000	7025.118	453487.24	1.3766	P	1.0
5	☐	12500.000	13911.378	887201.30	2.7163	P	0.2
6	☐	25000.000	26619.763	1680313.19	5.1888	A	3.5
7	☐	50000.000	52404.793	3307492.56	10.2053	A	1.3
8	☐	250000.00	249264.19	16442203.51	48.5046	A	0.6

$$y = 1.9455\text{E-}004 * x + 0.0099$$

$$R = 0.9999$$


$$DL = 7.679$$

$$BEC = 50.69$$

Weight: <None>

Min Conc: 0

59 Co [He] ISTD:45 Sc [He]

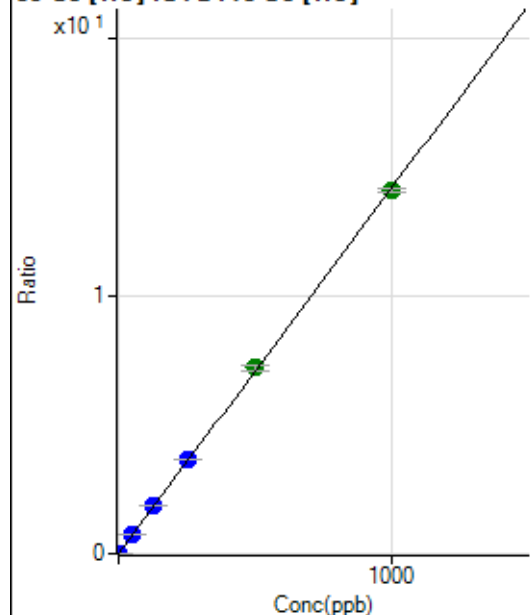

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	125.56	0.0004	P	12.4
2	☐	1.000	1.022	4814.14	0.0149	P	0.9
3	☐	50.000	51.582	242328.32	0.7321	P	0.7
4	☐	125.000	130.907	611887.11	1.8574	P	0.3
5	☐	250.000	256.053	1186501.59	3.6328	P	0.6
6	☐	500.000	509.765	2342089.18	7.2319	A	2.9
7	☐	1000.000	992.787	4564587.12	14.0841	A	1.0
8	☐			12745.50	0.0376	P	0.7

$$y = 0.0142 * x + 3.9134\text{E-}004$$


$$R = 0.9999$$

$$DL = 0.01024$$

$$BEC = 0.02759$$

Weight: <None>

Min Conc: 0

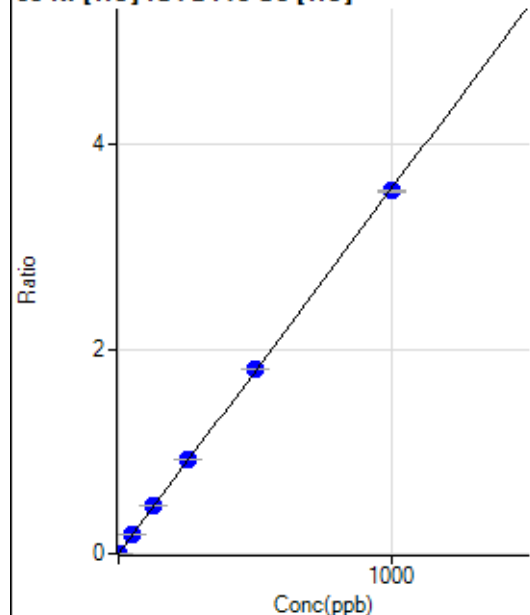60 Ni [He] ISTD:45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	140.00	0.0004	P	14.7
2	☐	1.000	0.994	1290.07	0.0040	P	6.3
3	☐	50.000	52.964	62754.99	0.1896	P	1.1
4	☐	125.000	132.125	155597.22	0.4723	P	0.6
5	☐	250.000	259.184	302495.31	0.9261	P	0.2
6	☐	500.000	505.248	584678.55	1.8050	P	0.5
7	☐	1000.000	994.041	1150817.41	3.5507	P	0.4
8	☐			5777.84	0.0170	P	2.3

$$y = 0.0036 * x + 4.3615E-004$$


$$R = 0.9999$$

$$DL = 0.05384$$

$$BEC = 0.1221$$

Weight: <None>

Min Conc: 0

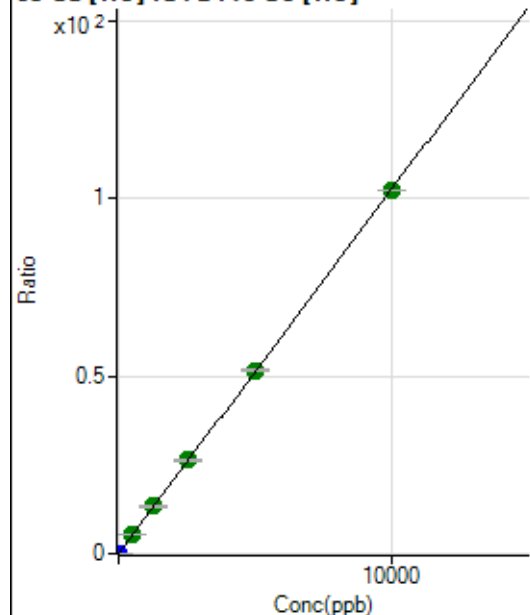63 Cu [He] ISTD:45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	757.81	0.0024	P	3.8
2	☐	2.000	1.851	6907.22	0.0214	P	1.0
3	☐	500.000	520.292	1767858.00	5.3411	A	0.1
4	☐	1250.000	1298.441	4389721.18	13.3257	A	0.8
5	☐	2500.000	2566.050	8600486.26	26.3326	A	0.8
6	☐	5000.000	5031.179	16723461.83	51.6274	A	0.5
7	☐	10000.000	9960.828	33127752.01	102.2105	A	0.1
8	☐			9639.85	0.0284	P	1.5

$$y = 0.0103 * x + 0.0024$$


$$R = 1.0000$$

$$DL = 0.02628$$

$$BEC = 0.2301$$

Weight: <None>

Min Conc: 0

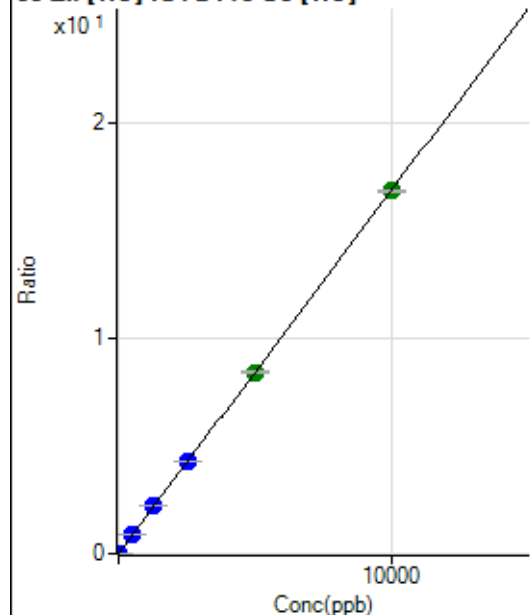66 Zn [He] ISTD:45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	404.45	0.0013	P	4.3
2	☐	2.000	4.495	2854.74	0.0088	P	3.5
3	☐	500.000	516.157	288074.73	0.8703	P	0.6
4	☐	1250.000	1303.893	723637.99	2.1967	P	0.8
5	☐	2500.000	2550.435	1403007.44	4.2956	P	0.5
6	☐	5000.000	4996.365	2725211.09	8.4140	A	1.7
7	☐	10000.000	9981.663	5447554.78	16.8081	A	0.8
8	☐			7779.88	0.0230	P	0.4

$$y = 0.0017 * x + 0.0013$$


$$R = 1.0000$$

$$DL = 0.09555$$

$$BEC = 0.7484$$

Weight: <None>

Min Conc: 0

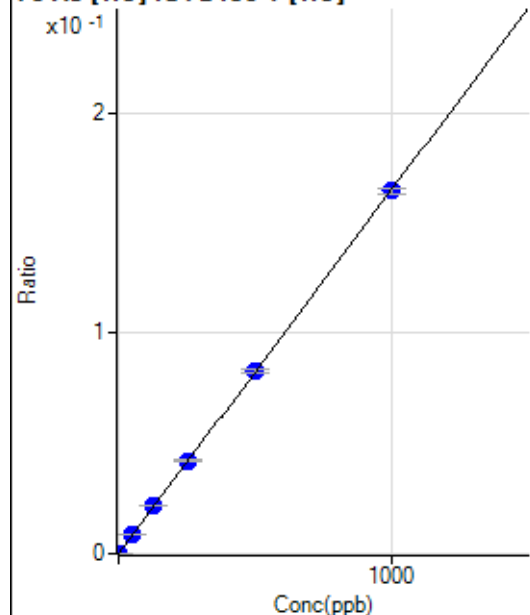75 As [He] ISTD:89 Y [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	5.56	0.0000	P	34.5
2	☐	1.000	0.951	390.01	0.0002	P	5.9
3	☐	50.000	51.605	21457.81	0.0085	P	0.5
4	☐	125.000	130.689	54414.83	0.0216	P	1.5
5	☐	250.000	254.393	107009.92	0.0420	P	1.6
6	☐	500.000	501.610	209261.97	0.0829	P	2.3
7	☐	1000.000	997.306	419290.34	0.1647	P	1.4
8	☐			246.67	0.0001	P	16.2

$$y = 1.6517E-004 * x + 2.2330E-006$$

$$R = 1.0000$$


$$DL = 0.01398$$

$$BEC = 0.01352$$

Weight: <None>

Min Conc: 0

77 Se [He] ISTD:89 Y [He]

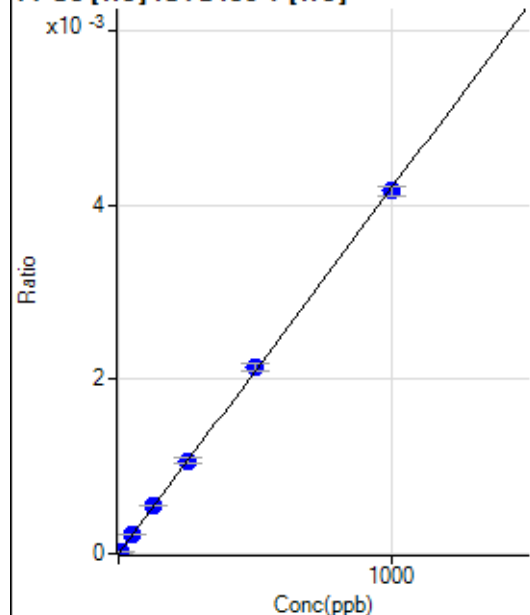

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	1.11	0.0000	P	173.
2	☐	5.000	5.186	54.44	0.0000	P	31.2
3	☐	50.000	50.880	538.91	0.0002	P	3.8
4	☐	125.000	131.399	1392.30	0.0006	P	2.0
5	☐	250.000	254.807	2725.83	0.0011	P	4.7
6	☐	500.000	510.682	5416.60	0.0021	P	4.4
7	☐	1000.000	992.612	10609.43	0.0042	P	2.6
8	☐			4.44	0.0000	P	44.7

$$y = 4.1993\text{E-}006 * x + 4.4820\text{E-}007$$

$$R = 0.9999$$


$$DL = 0.5546$$

$$BEC = 0.1067$$

Weight: <None>

Min Conc: 0

78 Se [He] ISTD:89 Y [He]

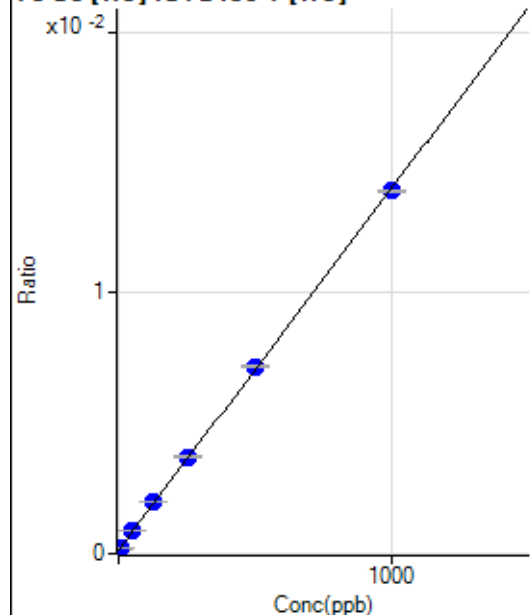

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	332.23	0.0001	P	10.4
2	☐	5.000	4.966	495.57	0.0002	P	7.6
3	☐	50.000	53.299	2199.07	0.0009	P	2.2
4	☐	125.000	133.819	5022.01	0.0020	P	3.2
5	☐	250.000	258.499	9480.89	0.0037	P	1.4
6	☐	500.000	507.037	18122.31	0.0072	P	1.0
7	☐	1000.000	993.090	35440.14	0.0139	P	0.8
8	☐			347.78	0.0001	P	4.5

$$y = 1.3885\text{E-}005 * x + 1.3358\text{E-}004$$

$$R = 0.9999$$

$$DL = 3.004$$

$$BEC = 9.62$$

Weight: <None>


Min Conc: 0

81 Br [No Gas] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			4810.83		P	1.2
2	☐			4589.64		P	2.4
3	☐			4527.41		P	2.6
4	☐			4694.12		P	2.3
5	☐			4886.41		P	0.1
6	☐			4965.32		P	2.3
7	☐			4775.27		P	2.2
8	☐			5324.34		P	1.6

81 Br [He] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			93.33		P	9.5
2	☐			97.78		P	7.1
3	☐			78.89		P	28.1
4	☐			52.22		P	35.2
5	☐			56.67		P	5.9
6	☐			74.45		P	9.3
7	☐			66.67		P	5.0
8	☐			72.22		P	23.7

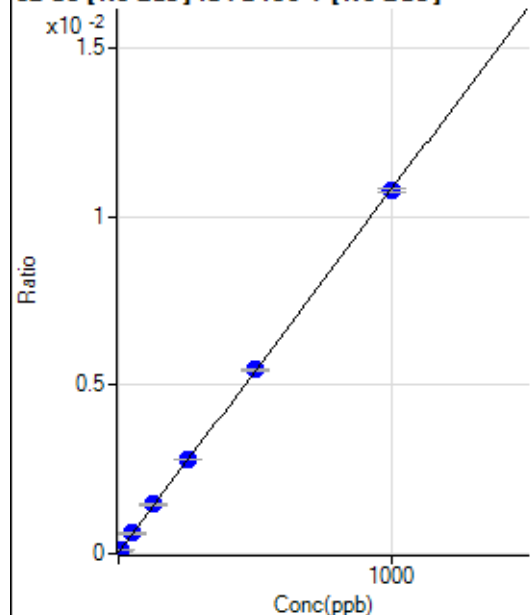82 Se [No Gas] ISTD:89 Y [No Gas]

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	311.08	0.0000	P	4.8
2	☐	5.000	5.540	852.06	0.0001	P	4.9
3	☐	50.000	53.320	5618.86	0.0006	P	4.6
4	☐	125.000	131.770	13671.72	0.0015	P	2.1
5	☐	250.000	256.735	26576.93	0.0028	P	1.0
6	☐	500.000	503.323	52678.70	0.0055	P	0.8
7	☐	1000.000	995.640	104648.23	0.0108	P	1.2
8	☐			427.42	0.0000	P	9.5

$$y = 1.0786E-005 * x + 3.5857E-005$$

R = 1.0000

DL = 0.4819

BEC = 3.324


Weight: <None>

Min Conc: 0

83 Kr [No Gas] No available calibration points

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐			247.78		P	12.5
2	☐			220.00		P	12.1
3	☐			233.34		P	22.3
4	☐			231.11		P	13.0
5	☐			241.12		P	7.1
6	☐			218.89		P	7.2
7	☐			247.78		P	6.2
8	☐			268.90		P	1.9

86 Sr [No Gas] ISTD:89 Y [No Gas]

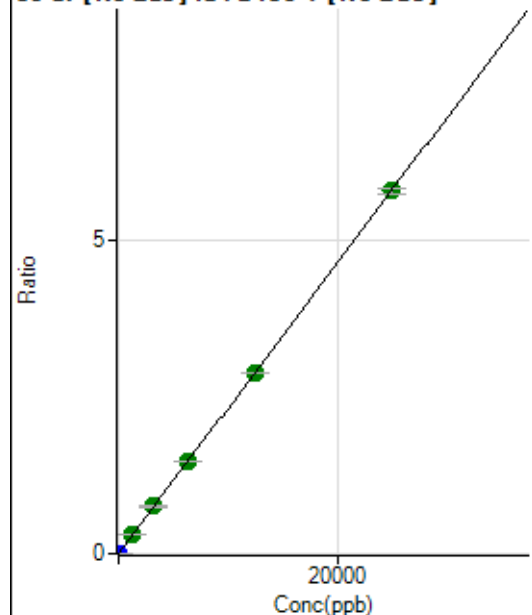

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	382.23	0.0000	P	8.1
2	☐	1.000	0.957	2364.66	0.0003	P	3.6
3	☐	1250.000	1308.745	2782379.73	0.3026	A	4.7
4	☐	3125.000	3246.722	7042676.15	0.7506	A	1.2
5	☐	6250.000	6359.437	13931408.13	1.4702	A	0.8
6	☐	12500.000	12423.288	27686902.92	2.8721	A	0.5
7	☐	25000.000	24992.844	56119200.27	5.7779	A	1.5
8	☐			10215.85	0.0011	P	6.7

$$y = 2.3118\text{E-}004 * x + 4.3952\text{E-}005$$

$$R = 1.0000$$


$$DL = 0.0464$$

$$BEC = 0.1901$$

Weight: <None>

Min Conc: 0

88 Sr [No Gas] ISTD:89 Y [No Gas]

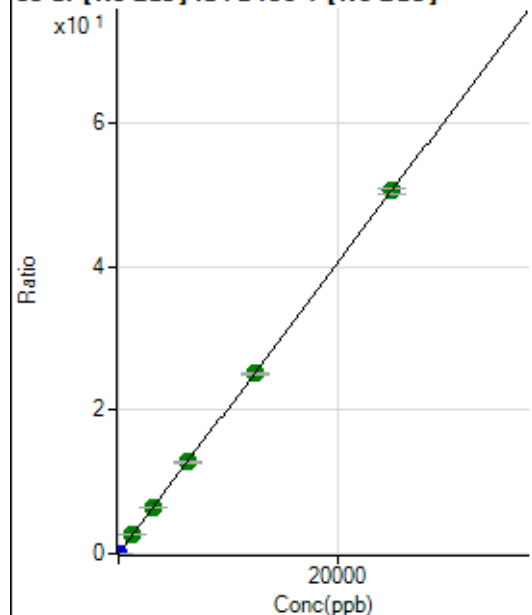

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	324.45	0.0000	P	9.2
2	☐	1.000	0.983	18037.83	0.0020	P	1.7
3	☐	1250.000	1286.040	23892352.70	2.5975	A	2.1
4	☐	3125.000	3223.285	61088877.42	6.5103	A	0.9
5	☐	6250.000	6318.311	120915731.5	12.7615	A	1.1
6	☐	12500.000	12408.602	241606911.9	25.0625	A	0.9
7	☐	25000.000	25014.534	490717454.9	50.5235	A	1.7
8	☐			86314.70	0.0091	P	6.9

$$y = 0.0020 * x + 3.7510\text{E-}005$$

$$R = 1.0000$$


$$DL = 0.005133$$

$$BEC = 0.01857$$

Weight: <None>

Min Conc: 0

90 Zr [No Gas] ISTD: 89 Y [No Gas]

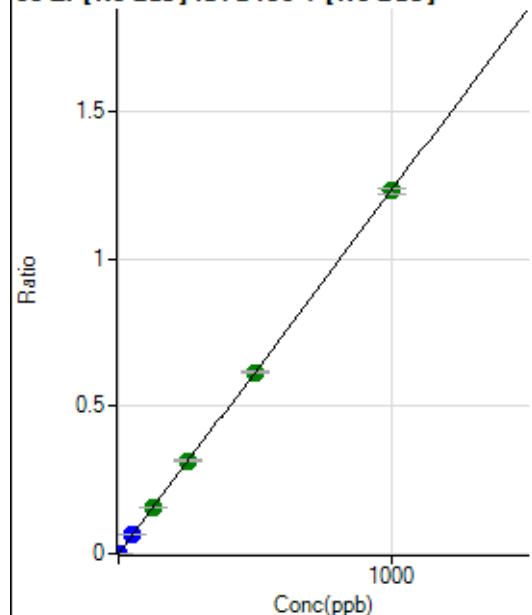

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	374.45	0.0000	P	9.2
2	☐	1.000	0.968	11026.46	0.0012	P	2.2
3	☐	50.000	51.954	589440.52	0.0641	P	3.8
4	☐	125.000	128.312	1484645.92	0.1582	A	0.3
5	☐	250.000	255.842	2988846.94	0.3154	A	1.7
6	☐	500.000	499.473	5936364.84	0.6158	A	1.5
7	☐	1000.000	998.291	11953523.85	1.2307	A	1.6
8	☐			7066.21	0.0007	P	2.8

$$y = 0.0012 * x + 4.3300E-005$$

$$R = 1.0000$$


$$DL = 0.00968$$

$$BEC = 0.03512$$

Weight: <None>

Min Conc: 0

91 Zr [No Gas] ISTD: 89 Y [No Gas]

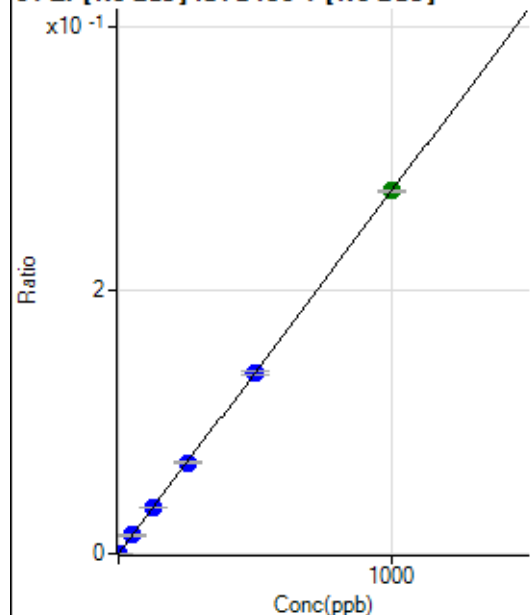

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	73.33	0.0000	P	35.9
2	☐	1.000	0.971	2453.56	0.0003	P	7.6
3	☐	50.000	50.826	128667.58	0.0140	P	4.5
4	☐	125.000	126.662	327069.62	0.0349	P	1.1
5	☐	250.000	251.262	655126.07	0.0691	P	2.1
6	☐	500.000	498.114	1321321.48	0.1371	P	1.7
7	☐	1000.000	1000.378	2673432.24	0.2753	A	0.2
8	☐			1543.43	0.0002	P	6.0

$$y = 2.7514E-004 * x + 8.3480E-006$$

$$R = 1.0000$$


$$DL = 0.03269$$

$$BEC = 0.03034$$

Weight: <None>

Min Conc: 0

94 Mo [No Gas] ISTD:89 Y [No Gas]

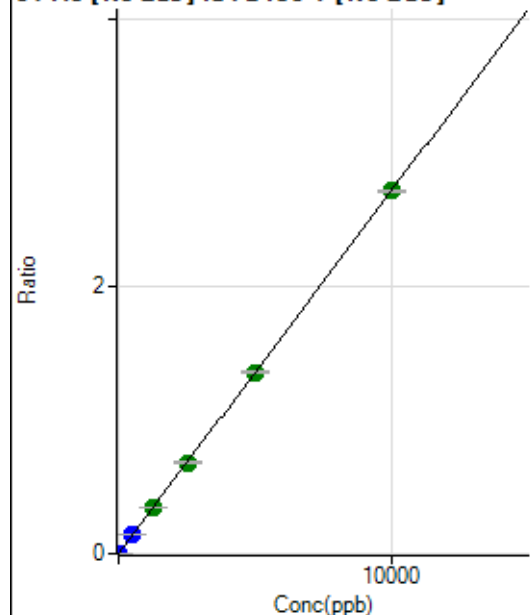

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	220.00	0.0000	P	3.6
2	☐	5.000	5.293	13022.58	0.0015	P	1.7
3	☐	500.000	511.252	1275596.77	0.1387	P	2.6
4	☐	1250.000	1277.321	3251250.99	0.3465	A	1.4
5	☐	2500.000	2515.683	6465305.11	0.6823	A	1.4
6	☐	5000.000	4992.888	13054960.92	1.3542	A	1.2
7	☐	10000.000	9995.657	26331520.44	2.7111	A	0.8
8	☐			6544.86	0.0007	P	4.6

$$y = 2.7122\text{E-}004 * x + 2.5394\text{E-}005$$

$$R = 1.0000$$


$$DL = 0.01023$$

$$BEC = 0.09363$$

Weight: <None>

Min Conc: 0

95 Mo [No Gas] ISTD:89 Y [No Gas]

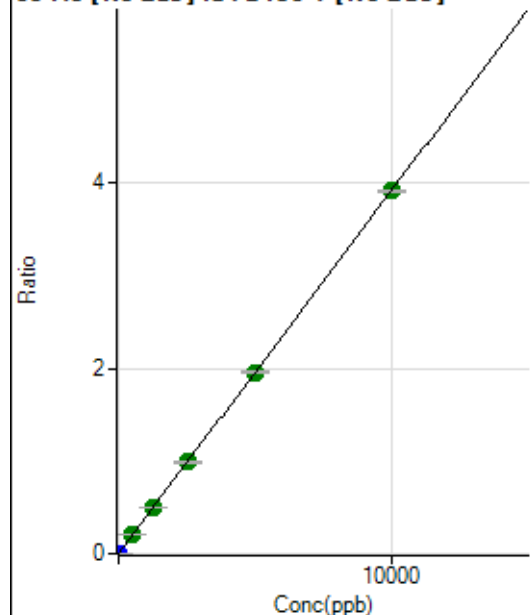

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	106.67	0.0000	P	11.6
2	☐	5.000	4.416	15540.57	0.0017	P	1.0
3	☐	500.000	516.752	1863697.78	0.2026	A	2.2
4	☐	1250.000	1288.738	4741118.82	0.5053	A	0.5
5	☐	2500.000	2526.320	9385350.97	0.9905	A	1.4
6	☐	5000.000	4989.196	18856793.05	1.9561	A	1.2
7	☐	10000.000	9993.143	38052422.77	3.9179	A	0.6
8	☐			6252.52	0.0007	P	11.3

$$y = 3.9206\text{E-}004 * x + 1.2292\text{E-}005$$

$$R = 1.0000$$


$$DL = 0.01093$$

$$BEC = 0.03135$$

Weight: <None>

Min Conc: 0

96 Mo [No Gas] ISTD:89 Y [No Gas]

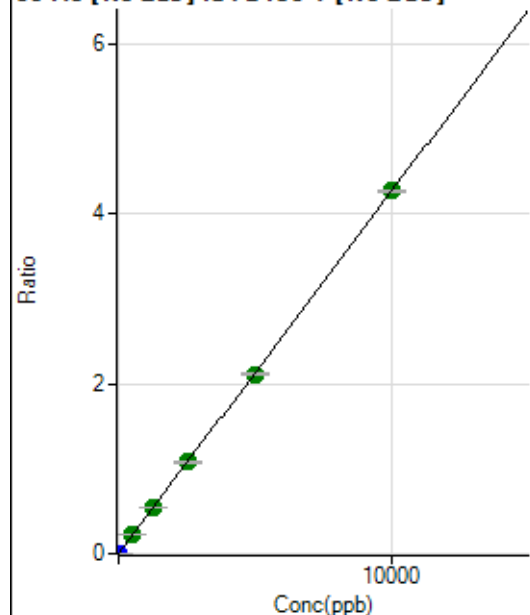

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	118.89	0.0000	P	10.2
2	☐	5.000	4.512	17262.52	0.0019	P	2.1
3	☐	500.000	512.248	2007965.23	0.2183	A	3.0
4	☐	1250.000	1286.240	5143323.78	0.5482	A	0.4
5	☐	2500.000	2523.663	10190992.90	1.0755	A	0.9
6	☐	5000.000	4952.638	20346443.17	2.1107	A	0.5
7	☐	10000.000	10012.623	41443822.72	4.2670	A	0.5
8	☐			11028.72	0.0012	P	4.6

$$y = 4.2617\text{E-}004 * x + 1.3749\text{E-}005$$

$$R = 1.0000$$


$$DL = 0.00989$$

$$BEC = 0.03226$$

Weight: <None>

Min Conc: 0

97 Mo [No Gas] ISTD:89 Y [No Gas]

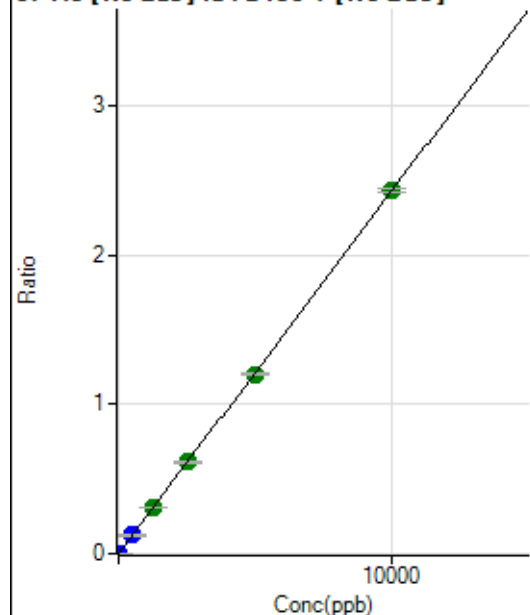

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	51.11	0.0000	P	22.2
2	☐	5.000	4.406	9590.99	0.0011	P	0.6
3	☐	500.000	507.994	1134481.33	0.1234	P	4.4
4	☐	1250.000	1292.083	2944175.96	0.3138	A	0.8
5	☐	2500.000	2520.937	5800865.06	0.6122	A	0.2
6	☐	5000.000	4952.299	11593069.97	1.2026	A	0.8
7	☐	10000.000	10012.957	23616457.70	2.4315	A	1.2
8	☐			3952.80	0.0004	P	6.2

$$y = 2.4284\text{E-}004 * x + 5.9402\text{E-}006$$

$$R = 1.0000$$


$$DL = 0.01627$$

$$BEC = 0.02446$$

Weight: <None>

Min Conc: 0

98 Mo [No Gas] ISTD:89 Y [No Gas]

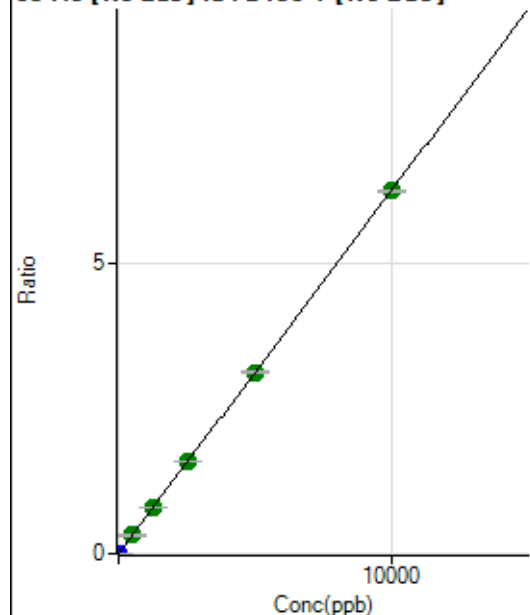

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	105.56	0.0000	P	8.4
2	☐	5.000	4.391	24614.17	0.0028	P	2.1
3	☐	500.000	504.460	2904035.68	0.3158	A	3.7
4	☐	1250.000	1281.161	7525369.61	0.8020	A	1.7
5	☐	2500.000	2534.775	15035559.64	1.5867	A	0.9
6	☐	5000.000	4992.333	30125898.16	3.1251	A	0.9
7	☐	10000.000	9991.022	60744212.98	6.2542	A	0.6
8	☐			9848.97	0.0010	P	9.7

$$y = 6.2598\text{E-}004 * x + 1.2178\text{E-}005$$

$$R = 1.0000$$


$$DL = 0.004883$$

$$BEC = 0.01945$$

Weight: <None>

Min Conc: 0

106 Cd [No Gas] ISTD:159 Tb [No Gas]

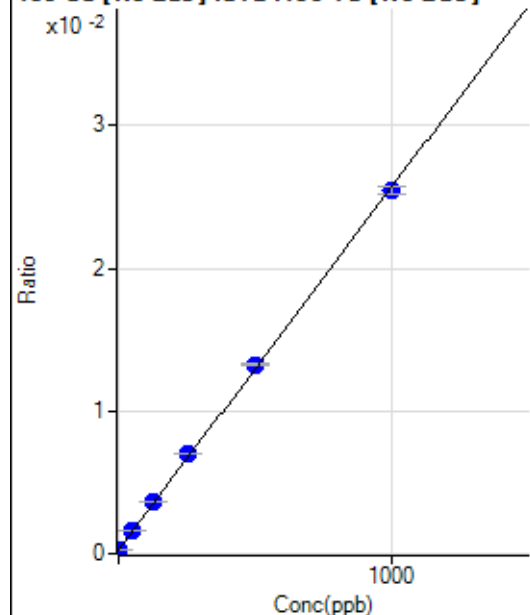

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	1483.42	0.0003	P	7.4
2	☐	1.000	1.339	1716.79	0.0003	P	7.6
3	☐	50.000	54.577	9696.64	0.0017	P	2.3
4	☐	125.000	132.195	21875.42	0.0036	P	0.8
5	☐	250.000	264.399	42802.94	0.0070	P	1.3
6	☐	500.000	510.470	83512.91	0.0132	P	1.1
7	☐	1000.000	990.037	164098.05	0.0254	P	2.2
8	☐			1616.77	0.0003	P	4.1

$$y = 2.5415\text{E-}005 * x + 2.6703\text{E-}004$$

$$R = 0.9998$$


$$DL = 2.342$$

$$BEC = 10.51$$

Weight: <None>

Min Conc: 0

107 Ag [No Gas] ISTD :159 Tb [No Gas]

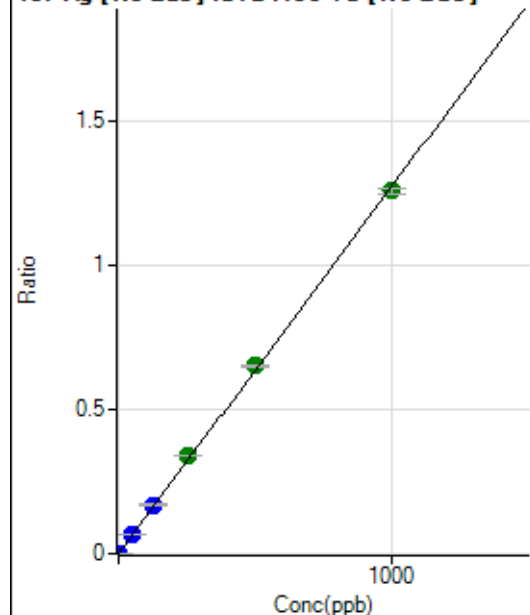

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	58.89	0.0000	P	33.3
2	☐	1.000	0.953	6970.62	0.0012	P	0.6
3	☐	50.000	53.995	402251.63	0.0686	P	2.1
4	☐	125.000	133.531	1023816.37	0.1697	P	0.6
5	☐	250.000	266.770	2077434.17	0.3391	A	1.1
6	☐	500.000	511.252	4098327.96	0.6498	A	1.3
7	☐	1000.000	988.915	8111354.32	1.2569	A	1.5
8	☐			1162.28	0.0002	P	4.2

$$y = 0.0013 * x + 1.0515E-005$$

$$R = 0.9997$$


$$DL = 0.008275$$

$$BEC = 0.008273$$

Weight: <None>

Min Conc: 0

108 Cd [No Gas] ISTD :159 Tb [No Gas]

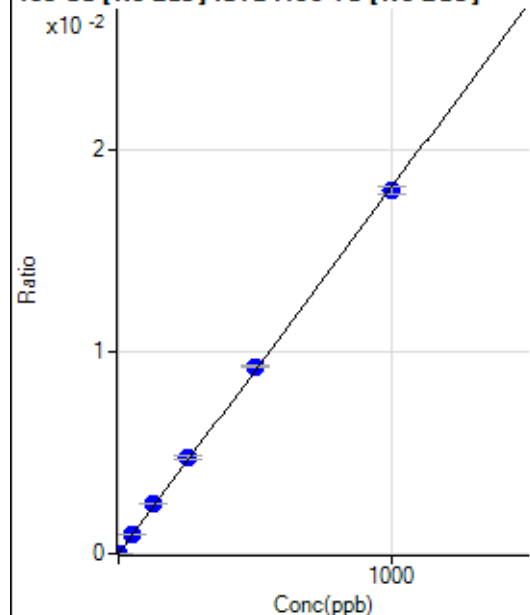

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	12.22	0.0000	P	42.6
2	☐	1.000	1.199	136.67	0.0000	P	16.4
3	☐	50.000	53.736	5728.96	0.0010	P	2.9
4	☐	125.000	136.037	14901.08	0.0025	P	1.0
5	☐	250.000	260.980	29025.80	0.0047	P	3.9
6	☐	500.000	510.809	58464.01	0.0093	P	0.9
7	☐	1000.000	990.284	115950.18	0.0180	P	2.2
8	☐			58.89	0.0000	P	16.6

$$y = 1.8142E-005 * x + 2.2213E-006$$

$$R = 0.9998$$


$$DL = 0.1563$$

$$BEC = 0.1224$$

Weight: <None>

Min Conc: 0

109 Ag [No Gas] ISTD :159 Tb [No Gas]

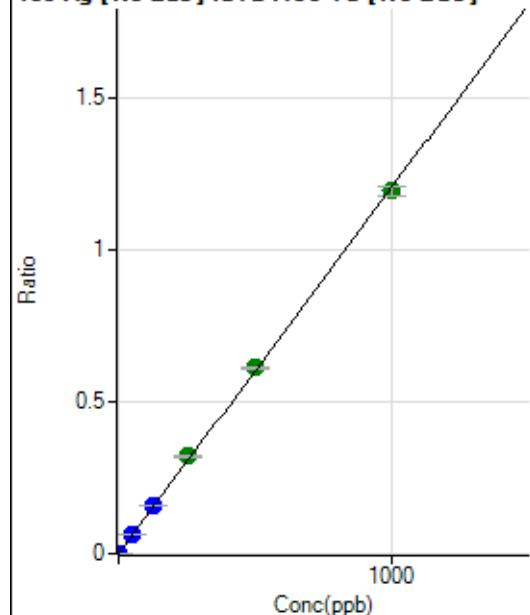

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	25.56	0.0000	P	58.6
2	☐	1.000	0.909	6270.29	0.0011	P	0.4
3	☐	50.000	53.795	379768.31	0.0648	P	1.4
4	☐	125.000	132.396	961727.96	0.1594	P	0.2
5	☐	250.000	265.781	1960917.82	0.3201	A	0.8
6	☐	500.000	507.451	3854133.28	0.6111	A	1.3
7	☐	1000.000	991.215	7702784.19	1.1936	A	2.4
8	☐			1087.83	0.0002	P	10.4

$$y = 0.0012 * x + 4.5877E-006$$

$$R = 0.9998$$


$$DL = 0.006692$$

$$BEC = 0.00381$$

Weight: <None>

Min Conc: 0

111 Cd [No Gas] ISTD :159 Tb [No Gas]

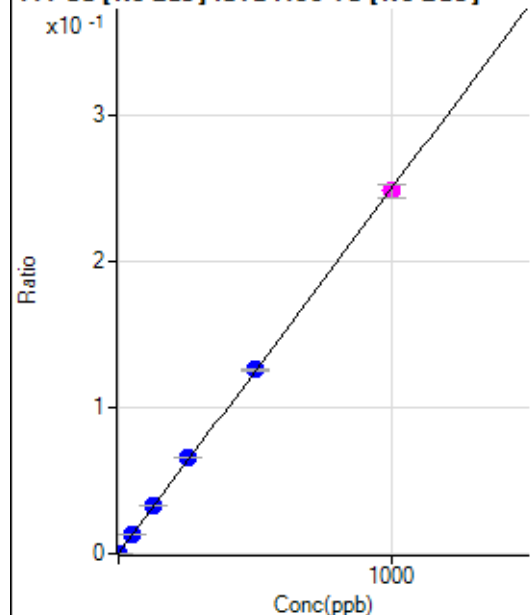

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	1035.40	0.0002	P	6.9
2	☐	1.000	1.097	2621.74	0.0005	P	5.9
3	☐	50.000	54.231	80305.82	0.0137	P	1.2
4	☐	125.000	133.000	201054.36	0.0333	P	0.1
5	☐	250.000	261.902	400986.45	0.0655	P	1.0
6	☐	500.000	503.484	792547.04	0.1257	P	1.5
7	☐	1000.000	994.071	1599704.74	0.2479	M	3.7
8	☐			1407.19	0.0002	P	4.4

$$y = 2.4921E-004 * x + 1.8639E-004$$

$$R = 0.9999$$


$$DL = 0.1538$$

$$BEC = 0.7479$$

Weight: <None>

Min Conc: 0

118 Sn [No Gas] ISTD : 159 Tb [No Gas]

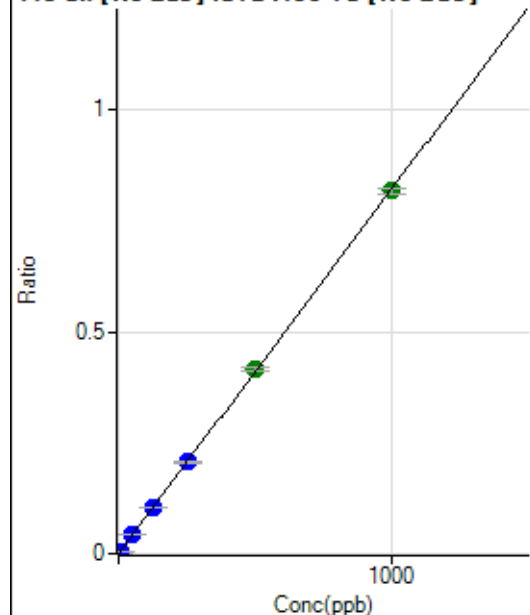

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	1197.84	0.0002	P	14.5
2	☐	5.000	4.723	23336.79	0.0041	P	2.1
3	☐	50.000	51.565	249277.71	0.0425	P	1.3
4	☐	125.000	127.925	634353.60	0.1052	P	0.8
5	☐	250.000	250.714	1261487.80	0.2059	P	1.6
6	☐	500.000	507.146	2625400.78	0.4163	A	2.1
7	☐	1000.000	995.806	5273524.51	0.8172	A	1.4
8	☐			3816.10	0.0006	P	1.9

$$y = 8.2038\text{E-}004 * x + 2.1708\text{E-}004$$

$$R = 1.0000$$


$$DL = 0.1153$$

$$BEC = 0.2646$$

Weight: <None>

Min Conc: 0

121 Sb [No Gas] ISTD : 159 Tb [No Gas]

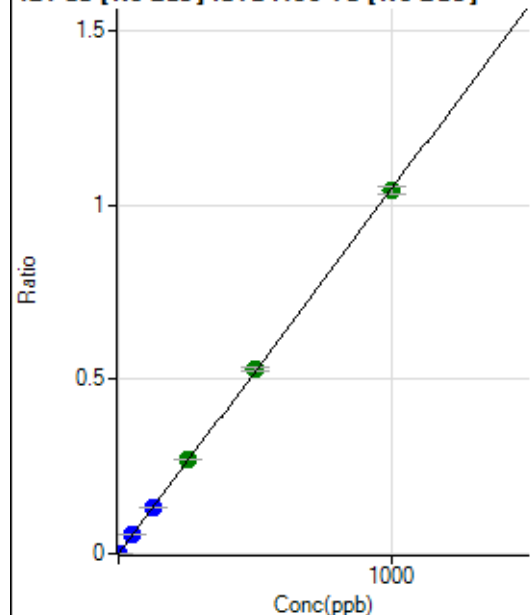

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	40.00	0.0000	P	49.7
2	☐	2.000	1.965	11760.44	0.0021	P	1.9
3	☐	50.000	51.386	314917.26	0.0537	P	2.1
4	☐	125.000	127.779	806006.36	0.1336	P	0.7
5	☐	250.000	256.878	1645627.70	0.2686	A	0.7
6	☐	500.000	506.050	3337244.01	0.5291	A	1.5
7	☐	1000.000	994.839	6712772.05	1.0402	A	2.2
8	☐			5661.17	0.0009	P	2.1

$$y = 0.0010 * x + 7.2546\text{E-}006$$


$$R = 0.9999$$

$$DL = 0.01035$$

$$BEC = 0.006938$$

Weight: <None>

Min Conc: 0

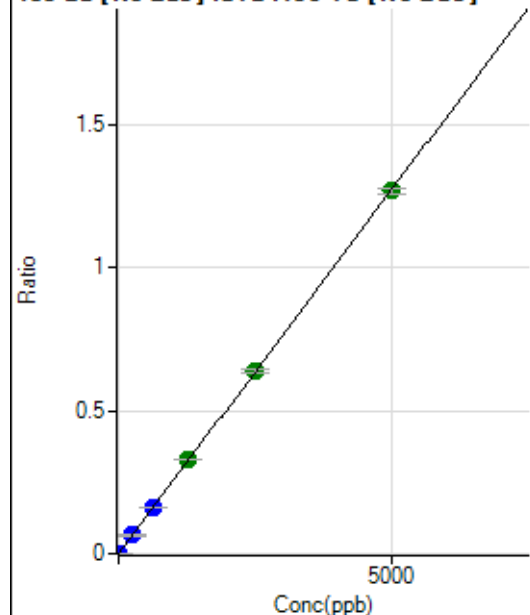135 Ba [No Gas] ISTD :159 Tb [No Gas]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	54.45	0.0000	P	14.0
2	☐	10.000	9.325	13566.56	0.0024	P	1.5
3	☐	250.000	251.303	374276.76	0.0639	P	2.6
4	☐	625.000	625.261	958245.62	0.1589	P	0.6
5	☐	1250.000	1296.400	2017679.85	0.3294	A	0.8
6	☐	2500.000	2504.175	4012467.47	0.6362	A	1.6
7	☐	5000.000	4986.216	8174638.07	1.2667	A	1.7
8	☐			3489.35	0.0006	P	3.5

$$y = 2.5404\text{E-}004 * x + 9.8393\text{E-}006$$


$$R = 0.9999$$

$$DL = 0.01621$$

$$BEC = 0.03873$$

Weight: <None>

Min Conc: 0

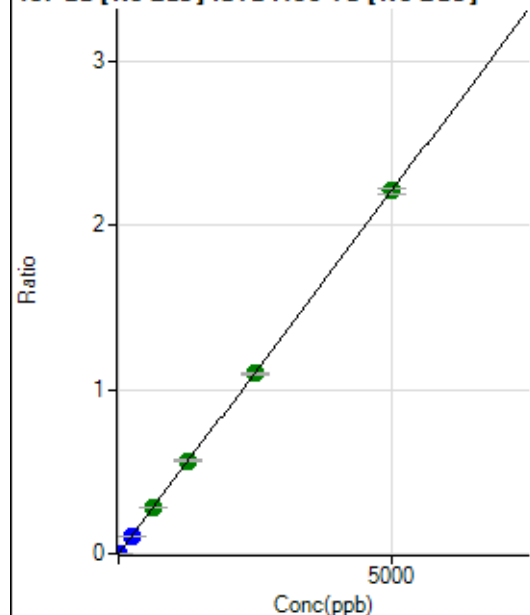137 Ba [No Gas] ISTD :159 Tb [No Gas]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	72.22	0.0000	P	44.8
2	☐	10.000	9.197	23261.29	0.0041	P	0.6
3	☐	250.000	249.461	646587.75	0.1103	P	1.7
4	☐	625.000	640.571	1708140.18	0.2832	A	0.1
5	☐	1250.000	1283.104	3474721.55	0.5672	A	1.9
6	☐	2500.000	2478.883	6911776.29	1.0958	A	1.4
7	☐	5000.000	5000.364	14264776.18	2.2105	A	1.8
8	☐			5904.62	0.0009	P	3.2

$$y = 4.4206\text{E-}004 * x + 1.3166\text{E-}005$$

$$R = 1.0000$$

$$DL = 0.04007$$


$$BEC = 0.02978$$

Weight: <None>

Min Conc: 0

150 Nd [No Gas] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			10.00		P	66.7
2	☐			10.00		P	66.7
3	☐			22.22		P	34.7
4	☐			46.67		P	44.6
5	☐			81.11		P	19.0
6	☐			150.00		P	5.9
7	☐			294.45		P	17.0
8	☐			115.56		P	10.9

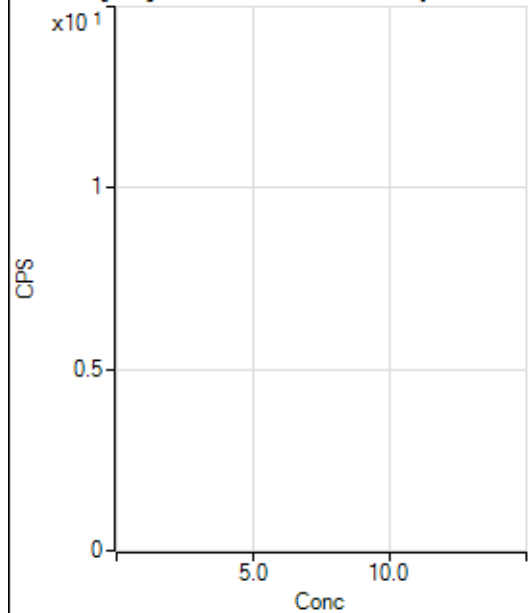150 Nd [He] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			1.11		P	173.
2	☐			5.55		P	69.3
3	☐			10.00		P	33.3
4	☐			11.11		P	17.3
5	☐			18.89		P	71.3
6	☐			54.44		P	27.6
7	☐			76.66		P	15.1
8	☐			68.89		P	5.6

156 Dy [No Gas] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			296.67		P	15.7
2	☐			273.34		P	14.1
3	☐			265.56		P	12.6
4	☐			548.90		P	2.9
5	☐			386.68		P	13.7
6	☐			378.90		P	1.0
7	☐			501.13		P	8.9
8	☐			577.79		P	5.0

156 Dy [He] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			70.00		P	21.8
2	☐			77.78		P	19.8
3	☐			83.33		P	24.3
4	☐			353.34		P	4.1
5	☐			185.56		P	12.2
6	☐			264.45		P	3.9
7	☐			505.57		P	3.3
8	☐			270.00		P	3.3

160 Gd [No Gas] Noavailable calibration poin...

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			26.66		P	43.3
2	☐			26.67		P	12.5
3	☐			27.78		P	18.3
4	☐			42.22		P	16.4
5	☐			37.78		P	28.4
6	☐			55.56		P	36.2
7	☐			92.22		P	11.0
8	☐			235.56		P	7.0

160 Gd [He] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			174.45		P	4.0
2	☐			186.67		P	13.5
3	☐			203.33		P	7.5
4	☐			197.78		P	2.6
5	☐			208.89		P	3.7
6	☐			225.56		P	11.2
7	☐			230.00		P	14.7
8	☐			380.01		P	12.9


164 Er [No Gas] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			34.44		P	14.8
2	☐			47.78		P	10.7
3	☐			50.00		P	23.1
4	☐			63.33		P	10.5
5	☐			53.33		P	41.0
6	☐			83.33		P	32.7
7	☐			107.78		P	9.4
8	☐			253.34		P	9.1

164 Er [He] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			25.56		P	32.8
2	☐			25.55		P	27.1
3	☐			31.11		P	48.3
4	☐			38.89		P	17.8
5	☐			40.00		P	14.4
6	☐			64.45		P	39.5
7	☐			60.00		P	20.0
8	☐			184.45		P	5.2

203 Tl [No Gas] ISTD :209 Bi [No Gas]

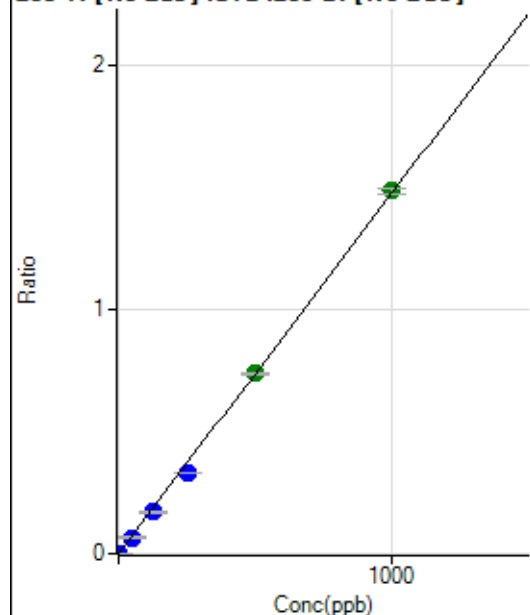

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	88.89	0.0000	P	34.9
2	☐	1.000	0.832	4112.89	0.0013	P	1.2
3	☐	50.000	44.841	224222.57	0.0661	P	3.7
4	☐	125.000	115.026	585618.98	0.1696	P	0.4
5	☐	250.000	225.307	1174202.75	0.3321	P	1.2
6	☐	500.000	499.665	2659531.21	0.7365	A	1.5
7	☐	1000.000	1007.845	5442174.36	1.4856	A	1.5
8	☐			793.37	0.0002	P	10.0

$$y = 0.0015 * x + 2.8163E-005$$

$$R = 0.9997$$


$$DL = 0.02003$$

$$BEC = 0.01911$$

Weight: <None>

Min Conc: 0

205 Tl [No Gas] ISTD :209 Bi [No Gas]

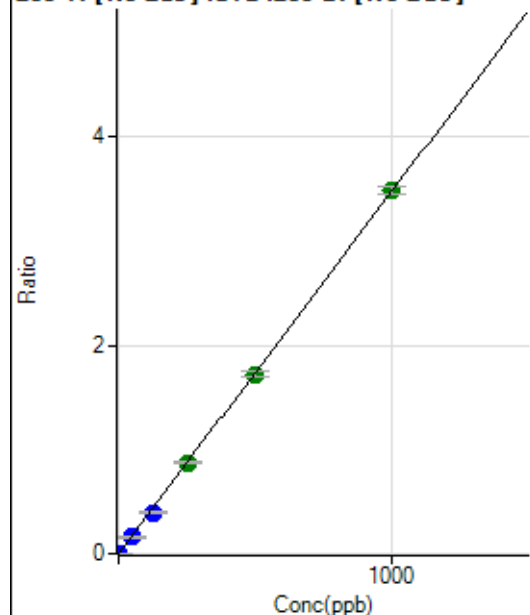

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	181.11	0.0001	P	15.6
2	☐	1.000	0.852	9888.14	0.0030	P	0.9
3	☐	50.000	45.290	533700.43	0.1574	P	2.9
4	☐	125.000	114.151	1369699.04	0.3966	P	1.2
5	☐	250.000	251.409	3087817.00	0.8734	A	1.3
6	☐	500.000	496.937	6233518.66	1.7263	A	2.6
7	☐	1000.000	1002.771	12761056.89	3.4835	A	2.1
8	☐			1872.37	0.0006	P	10.4

$$y = 0.0035 * x + 5.7076E-005$$

$$R = 0.9999$$


$$DL = 0.007714$$

$$BEC = 0.01643$$

Weight: <None>

Min Conc: 0

206 [Pb] [No Gas] ISTD :209 Bi [No Gas]

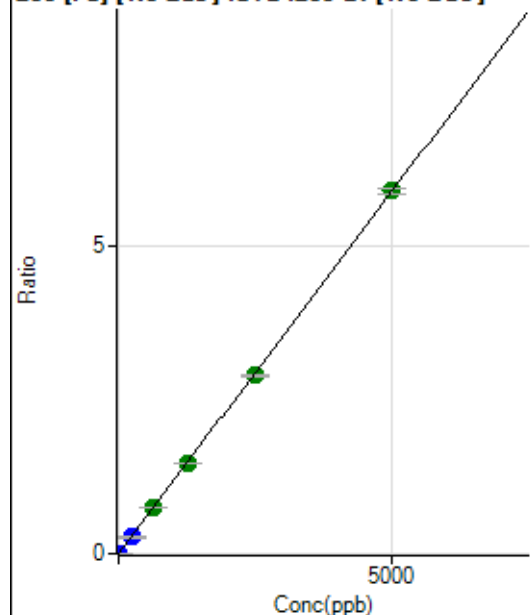

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	330.01	0.0001	P	16.5
2	☐	1.000	0.859	3660.52	0.0011	P	2.4
3	☐	250.000	227.152	907652.96	0.2679	P	7.2
4	☐	625.000	632.781	2576686.19	0.7461	A	1.1
5	☐	1250.000	1247.750	5201548.84	1.4712	A	1.5
6	☐	2500.000	2469.838	10514484.84	2.9119	A	0.9
7	☐	5000.000	5015.813	21663125.23	5.9135	A	1.3
8	☐			4948.74	0.0015	P	1.3

$$y = 0.0012 * x + 1.0380E-004$$

$$R = 1.0000$$


$$DL = 0.04352$$

$$BEC = 0.08804$$

Weight: <None>

Min Conc: 0

207 [Pb] [No Gas] ISTD :209 Bi [No Gas]

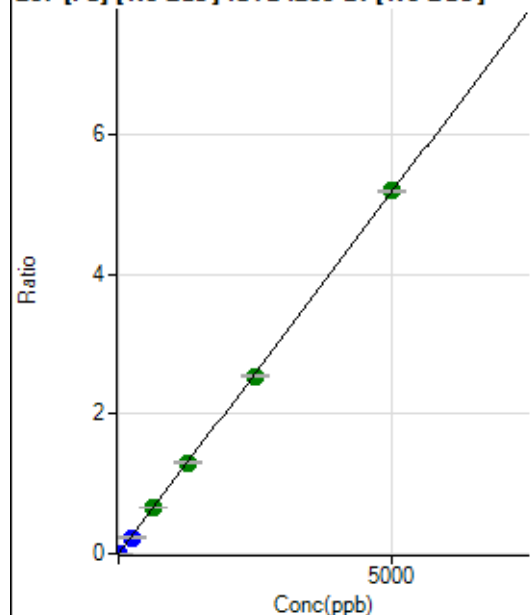

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	258.89	0.0001	P	16.7
2	☐	1.000	0.865	3203.74	0.0010	P	2.2
3	☐	250.000	225.624	792833.43	0.2338	P	4.4
4	☐	625.000	639.397	2287864.97	0.6625	A	0.5
5	☐	1250.000	1259.640	4614267.71	1.3050	A	1.8
6	☐	2500.000	2453.122	9176485.21	2.5415	A	1.0
7	☐	5000.000	5020.448	19053416.80	5.2012	A	0.7
8	☐			4419.65	0.0013	P	1.2

$$y = 0.0010 * x + 8.1093E-005$$

$$R = 0.9999$$


$$DL = 0.03921$$

$$BEC = 0.07828$$

Weight: <None>

Min Conc: 0

208 Pb [No Gas] ISTD :209 Bi [No Gas]

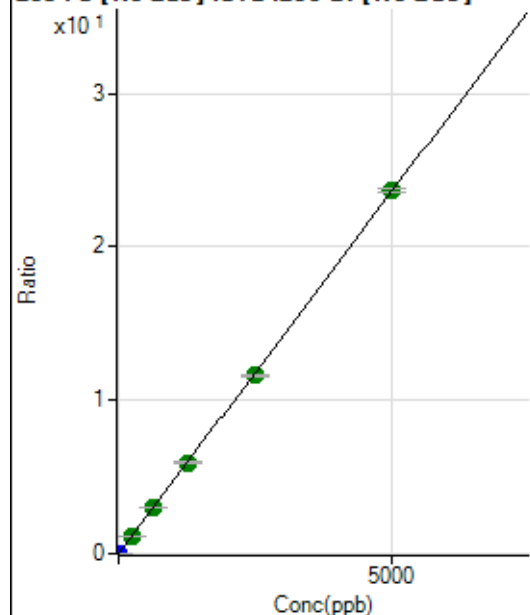

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	1270.03	0.0004	P	3.6
2	☐	1.000	0.845	14361.95	0.0044	P	1.5
3	☐	250.000	239.920	3836823.17	1.1317	A	4.5
4	☐	625.000	634.045	10326028.86	2.9901	A	0.4
5	☐	1250.000	1252.828	20887996.11	5.9078	A	1.6
6	☐	2500.000	2467.871	42018483.89	11.6370	A	1.0
7	☐	5000.000	5014.731	86622708.58	23.6461	A	1.1
8	☐			19908.13	0.0059	P	1.0

$$y = 0.0047 * x + 3.9885E-004$$

$$R = 1.0000$$


$$DL = 0.009162$$

$$BEC = 0.08459$$

Weight: <None>

Min Conc: 0

238 U [No Gas] ISTD :209 Bi [No Gas]

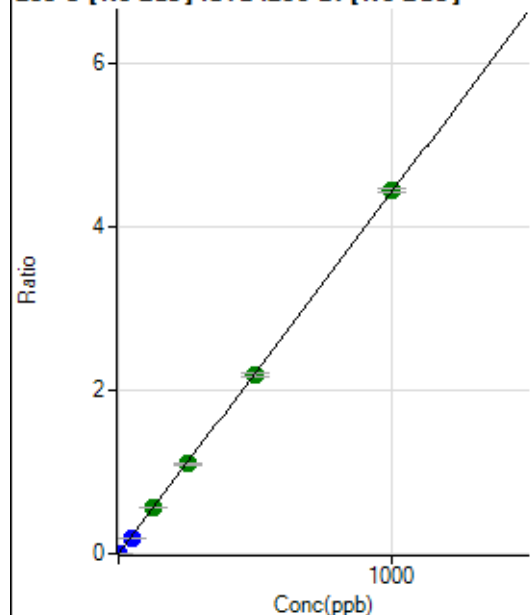

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	18.89	0.0000	P	55.6
2	☐	1.000	0.813	11809.76	0.0036	P	3.0
3	☐	50.000	43.561	653203.10	0.1927	P	4.6
4	☐	125.000	126.072	1925746.99	0.5577	A	1.6
5	☐	250.000	249.441	3900617.86	1.1033	A	2.4
6	☐	500.000	493.206	7877105.37	2.1816	A	1.9
7	☐	1000.000	1003.725	16263936.70	4.4397	A	0.9
8	☐			1078.95	0.0003	P	18.0

$$y = 0.0044 * x + 6.0182E-006$$


$$R = 0.9999$$

$$DL = 0.002269$$


$$BEC = 0.001361$$

Weight: <None>


Min Conc: 0

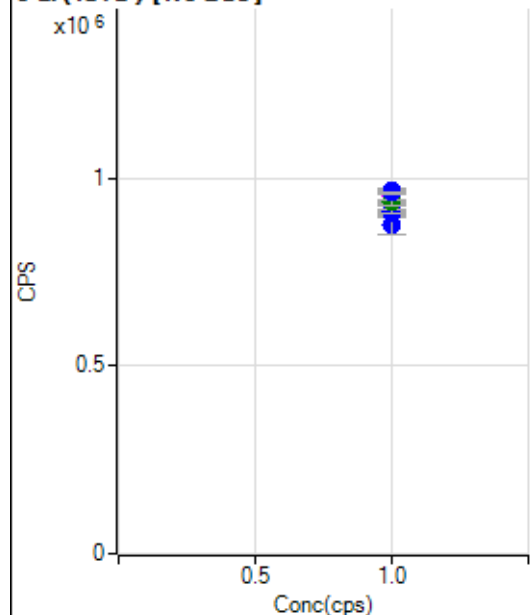6 Li (ISTD) [No Gas]


	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		873828.15		P	5.1
2	☐	1.000		905885.39		P	1.6
3	☐	1.000		912107.84		P	1.4
4	☐	1.000		935670.17		P	0.7
5	☐	1.000		965663.68		P	0.7
6	☐	1.000		954481.02		M	3.6
7	☐	1.000		934549.72		A	1.6
8	☐	1.000		961004.45		P	0.4

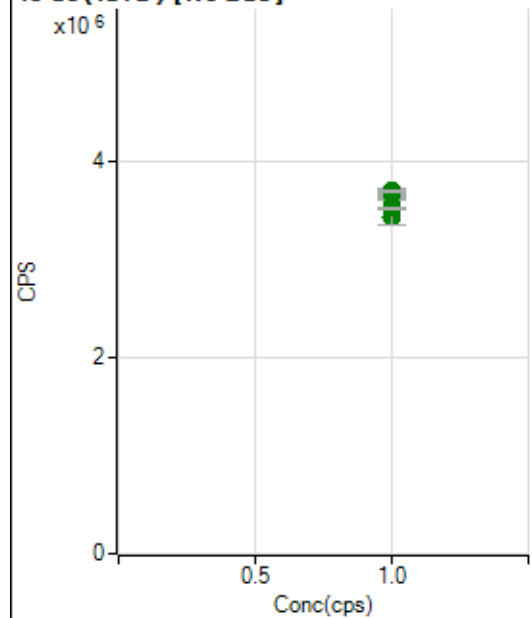45 Sc (ISTD) [No Gas]


	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		3444407.55		A	5.2
2	☐	1.000		3526193.31		A	0.5
3	☐	1.000		3632512.90		A	0.2
4	☐	1.000		3645074.08		A	1.2
5	☐	1.000		3671383.00		A	0.5
6	☐	1.000		3683131.37		A	1.8
7	☐	1.000		3701938.21		A	1.5
8	☐	1.000		3705885.50		A	0.3

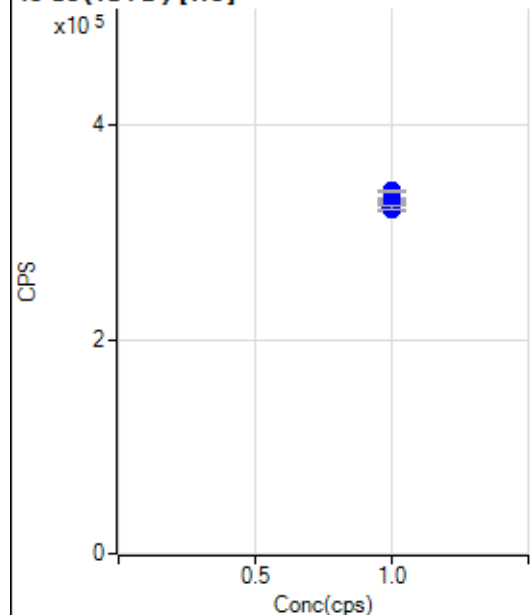45 Sc (ISTD) [He]


	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		320950.42		P	0.4
2	☐	1.000		323431.91		P	0.9
3	☐	1.000		330994.42		P	0.7
4	☐	1.000		329429.58		P	0.7
5	☐	1.000		326618.50		P	0.6
6	☐	1.000		323933.74		P	1.3
7	☐	1.000		324115.21		P	1.1
8	☐	1.000		338981.23		P	0.5

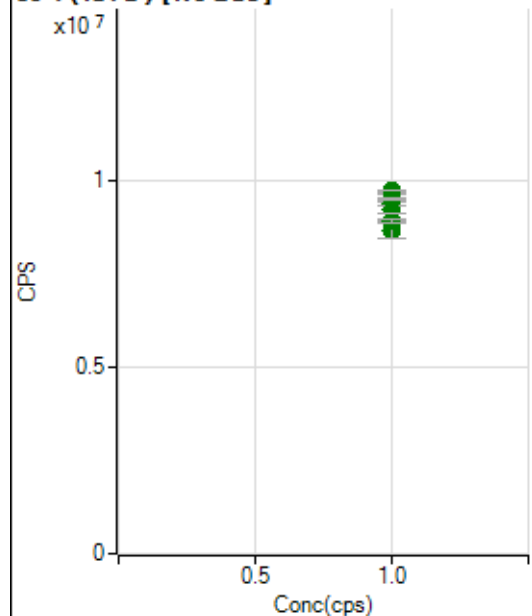89 Y (ISTD) [No Gas]


	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		8673815.85		A	5.5
2	☐	1.000		8914547.51		A	1.5
3	☐	1.000		9200848.61		A	2.1
4	☐	1.000		9382963.75		A	1.6
5	☐	1.000		9475575.34		A	1.0
6	☐	1.000		9639932.22		A	0.4
7	☐	1.000		9712541.24		A	0.1
8	☐	1.000		9477026.32		A	0.5

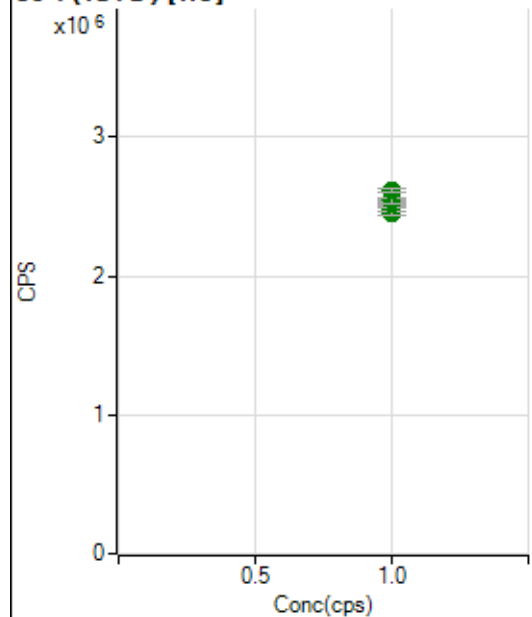89 Y(ISTD) [He]


	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		2486620.12		A	1.1
2	☐	1.000		2447930.03		A	1.3
3	☐	1.000		2516822.25		A	0.9
4	☐	1.000		2520838.02		A	1.2
5	☐	1.000		2546932.06		A	1.4
6	☐	1.000		2526364.39		A	2.2
7	☐	1.000		2545687.69		A	1.7
8	☐	1.000		2614308.21		A	1.2

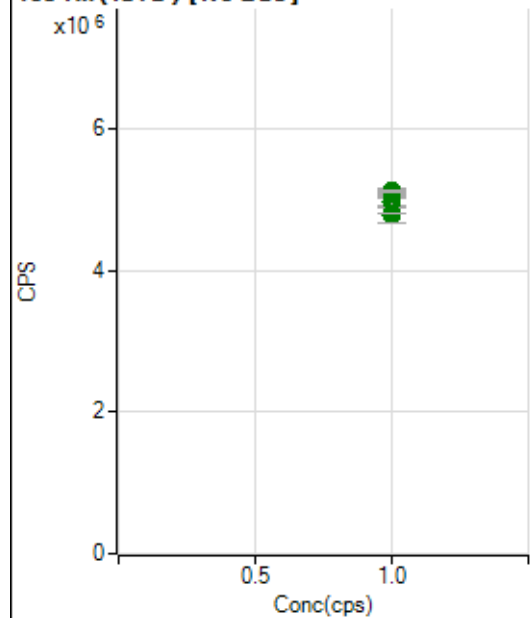103 Rh(ISTD) [No Gas]


	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		4801271.07		A	4.9
2	☐	1.000		4907938.78		A	0.5
3	☐	1.000		4971802.60		A	2.8
4	☐	1.000		5093763.78		A	1.2
5	☐	1.000		5133579.23		A	0.7
6	☐	1.000		5123865.13		A	1.3
7	☐	1.000		5120356.14		A	0.6
8	☐	1.000		4813184.09		A	0.4

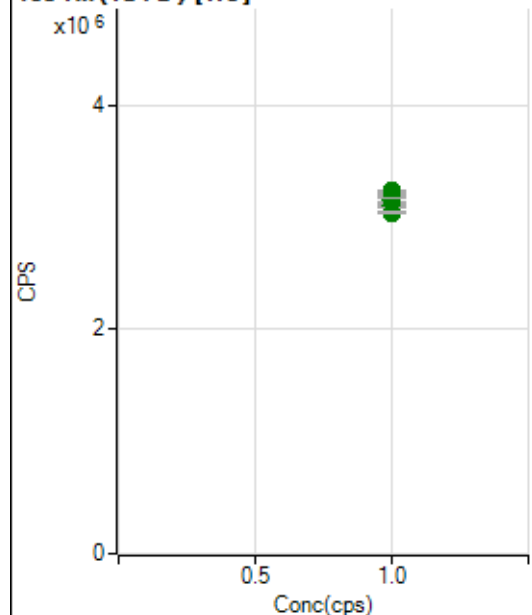103 Rh (ISTD) [He]


	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		3110763.57		A	0.4
2	☐	1.000		3110120.30		A	1.1
3	☐	1.000		3236526.13		A	0.7
4	☐	1.000		3214015.85		A	0.5
5	☐	1.000		3205652.76		A	0.4
6	☐	1.000		3161141.06		A	1.7
7	☐	1.000		3173194.50		A	0.4
8	☐	1.000		3043308.88		A	0.3

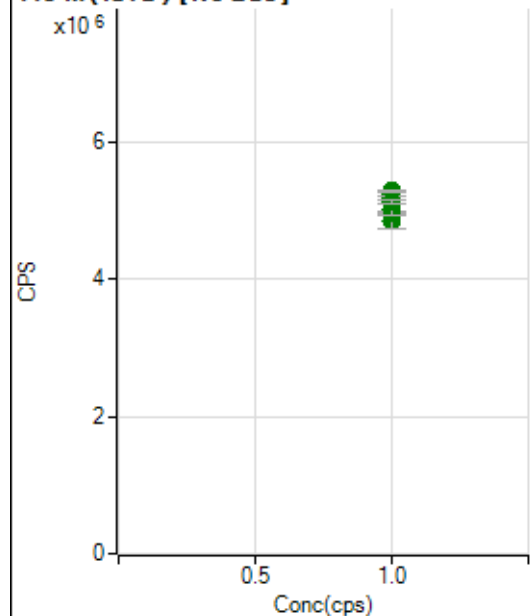115 In (ISTD) [No Gas]


	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		4858510.35		A	4.5
2	☐	1.000		4970680.76		A	0.5
3	☐	1.000		5023086.90		A	3.3
4	☐	1.000		5186240.27		A	1.5
5	☐	1.000		5195670.14		A	1.2
6	☐	1.000		5252048.44		A	1.3
7	☐	1.000		5291557.88		A	0.7
8	☐	1.000		5130760.96		A	1.3

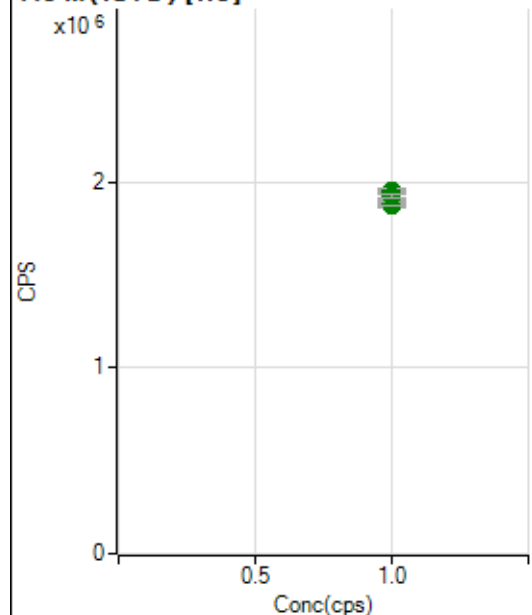115 In (ISTD) [He]


	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		1876041.11		A	1.2
2	☐	1.000		1880788.41		A	1.4
3	☐	1.000		1946333.25		A	0.6
4	☐	1.000		1951876.93		A	1.6
5	☐	1.000		1949563.80		A	1.2
6	☐	1.000		1892210.79		A	1.6
7	☐	1.000		1879317.64		A	1.2
8	☐	1.000		1924710.33		A	1.5

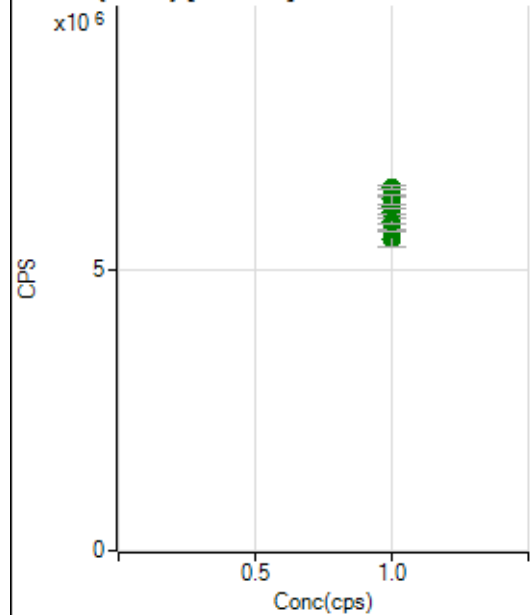159 Tb (ISTD) [No Gas]


	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		5545336.24		A	5.2
2	☐	1.000		5702875.26		A	0.5
3	☐	1.000		5861810.05		A	1.8
4	☐	1.000		6031998.52		A	1.6
5	☐	1.000		6126453.10		A	1.0
6	☐	1.000		6307381.85		A	0.9
7	☐	1.000		6454092.96		A	1.0
8	☐	1.000		6252071.09		A	2.9

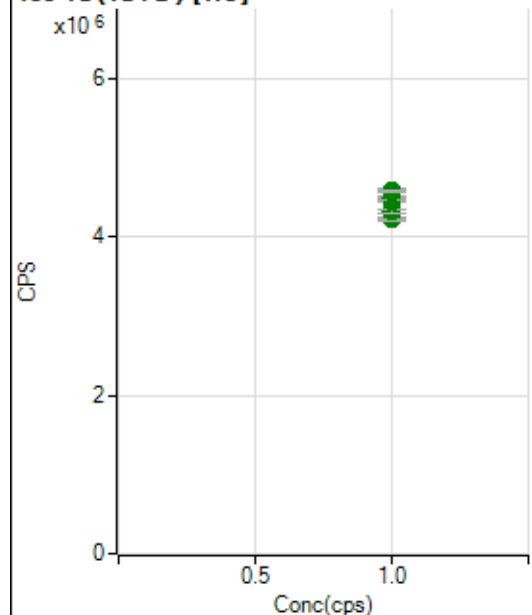159 Tb (ISTD) [He]


	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		4216193.72		A	1.2
2	☐	1.000		4213640.08		A	0.8
3	☐	1.000		4329969.87		A	1.0
4	☐	1.000		4478076.60		A	0.1
5	☐	1.000		4438019.00		A	0.2
6	☐	1.000		4491364.38		A	0.8
7	☐	1.000		4580999.58		A	1.0
8	☐	1.000		4570240.35		A	0.7

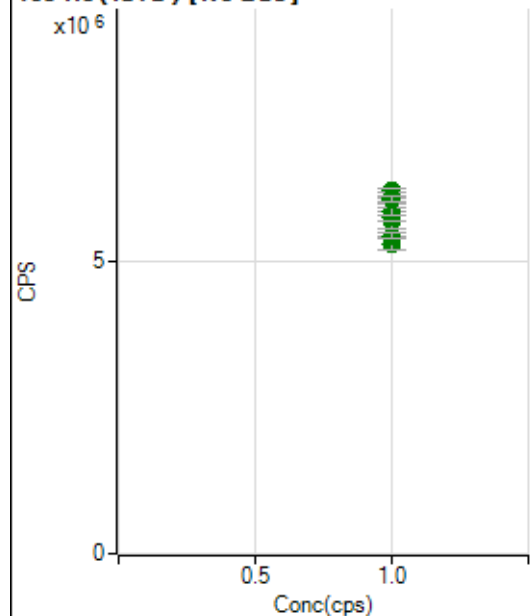165 Ho (ISTD) [No Gas]


	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		5317013.70		A	4.6
2	☐	1.000		5447506.31		A	1.9
3	☐	1.000		5686117.83		A	3.6
4	☐	1.000		5781458.25		A	2.6
5	☐	1.000		5858574.50		A	2.3
6	☐	1.000		6055844.91		A	1.6
7	☐	1.000		6217041.51		A	1.0
8	☐	1.000		6084528.17		A	1.7

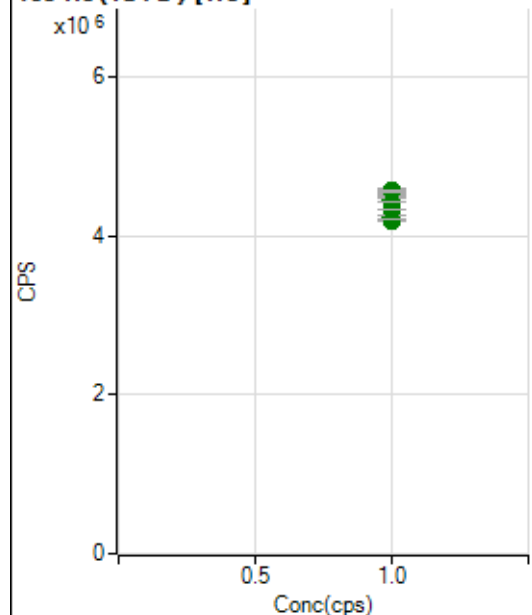165 Ho (ISTD) [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		4199566.19		A	0.6
2	☐	1.000		4241943.20		A	0.8
3	☐	1.000		4335065.91		A	0.4
4	☐	1.000		4456230.38		A	1.4
5	☐	1.000		4462368.65		A	1.0
6	☐	1.000		4543558.02		A	1.4
7	☐	1.000		4567526.53		A	1.5
8	☐	1.000		4567628.23		A	0.5

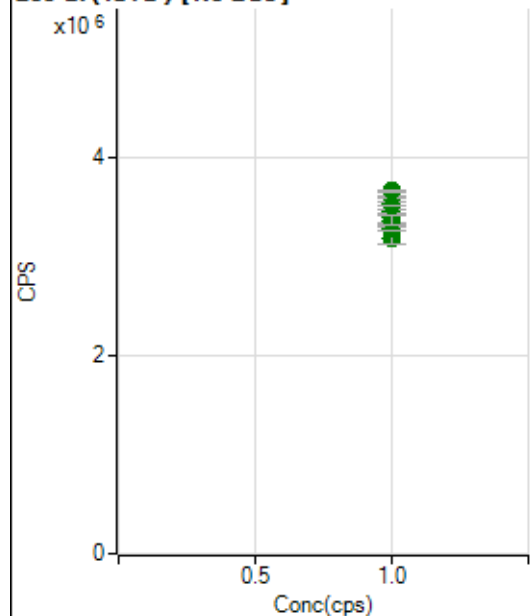209 Bi (ISTD) [No Gas]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		3186934.57		A	4.4
2	☐	1.000		3277501.48		A	0.9
3	☐	1.000		3392959.54		A	3.1
4	☐	1.000		3453307.34		A	1.3
5	☐	1.000		3535417.62		A	0.9
6	☐	1.000		3610798.70		A	0.5
7	☐	1.000		3663265.75		A	0.2
8	☐	1.000		3367555.02		A	2.6

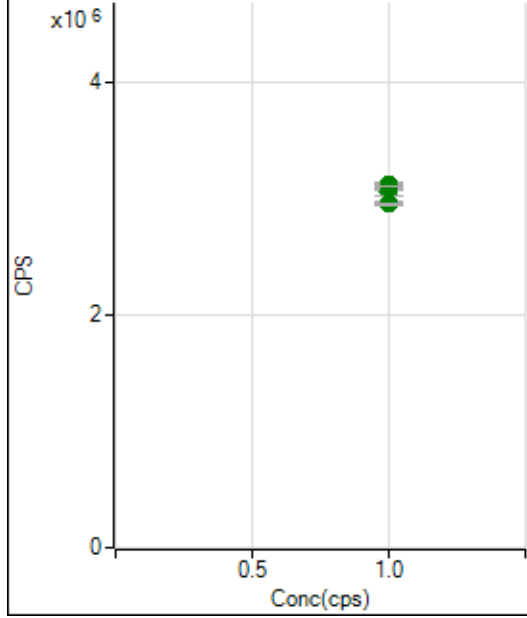209 Bi (ISTD) [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		2967749.57		A	1.1
2	☐	1.000		2970781.10		A	0.2
3	☐	1.000		3056144.99		A	1.3
4	☐	1.000		3116756.55		A	1.7
5	☐	1.000		3122854.40		A	0.9
6	☐	1.000		3110429.68		A	1.0
7	☐	1.000		3105622.14		A	0.0
8	☐	1.000		2956289.02		A	0.2