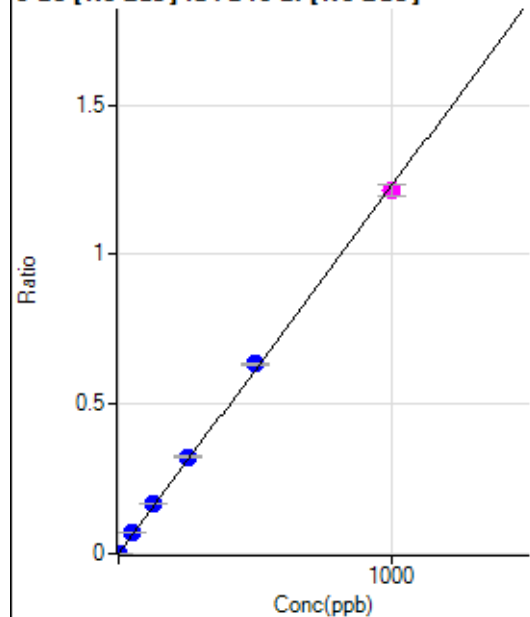


Batch Folder: D:\Agilent\ICPMH\1\DATA\P7102824MS1.b\
Analysis File: P7102824MS1.batch.bin
DA Date-Time: 2024-10-28 17:50:56
Calibration Title:
Calibration Method: External Calibration
VIS Interpolation Fit:

Level	Standard Data File	Sample Name	Acq. Date-Time
1	004CALB.d	S00	2024-10-28 13:22:42
2	005CALS.d	S02	2024-10-28 13:26:03
3	006CALS.d	S03	2024-10-28 13:29:25
4	007CALS.d	S04	2024-10-28 13:32:34
5	008CALS.d	S05	2024-10-28 13:35:35
6	009CALS.d	S06	2024-10-28 13:38:27
7	010CALS.d	S07	2024-10-28 13:41:15
8	011CALS.d	S08	2024-10-28 13:44:01

9 Be [No Gas] ISTD:6 Li [No Gas]

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	24.45	0.0000	P	14.2
2	☐	1.000	1.021	934.48	0.0013	P	1.7
3	☐	50.000	56.973	49761.69	0.0701	P	3.6
4	☐	125.000	135.651	126498.91	0.1668	P	1.2
5	☐	250.000	263.293	260756.78	0.3237	P	1.8
6	☐	500.000	515.898	531507.38	0.6341	P	1.0
7	☐	1000.000	987.048	1040384.73	1.2132	M	3.2
8	☐			210.00	0.0003	P	8.9

$$y = 0.0012 * x + 3.2936E-005$$

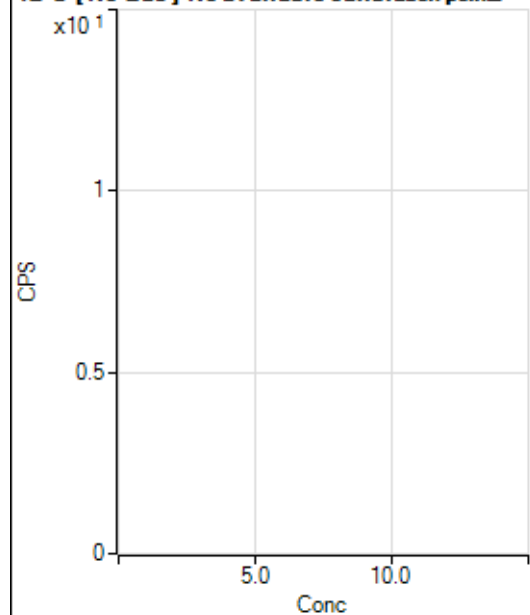
$$R = 0.9997$$

$$DL = 0.01141$$

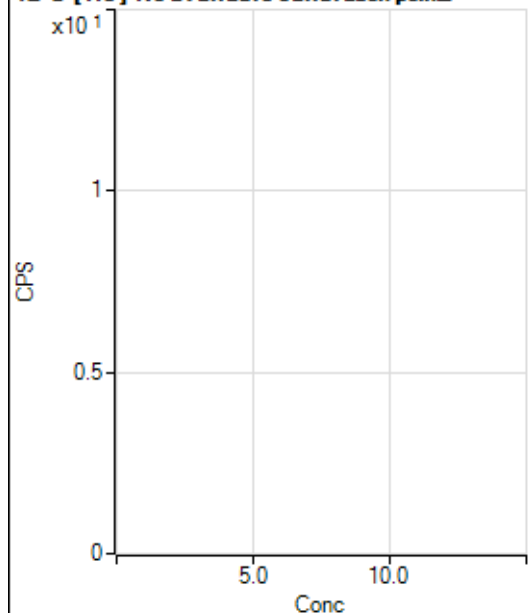
$$BEC = 0.0268$$

Weight: <None>

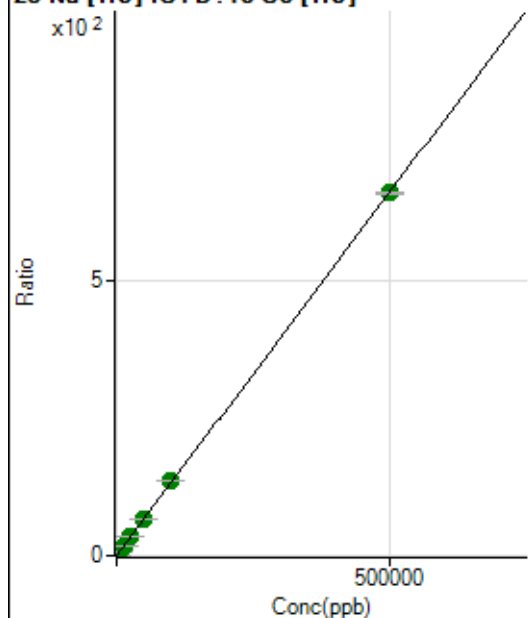
Min Conc: 0

12 C [No Gas] No available calibration points

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐						
2	☐						
3	☐						
4	☐						
5	☐						
6	☐						
7	☐						
8	☐						

12 C [He] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐						
2	☐						
3	☐						
4	☐						
5	☐						
6	☐						
7	☐						
8	☐						

23 Na [He] ISTD:45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	44242.26	0.1376	P	0.8
2	☐	500.000	496.632	255754.64	0.7947	P	0.6
3	☐	5000.000	5156.377	2217445.82	6.9601	A	0.5
4	☐	12500.000	12773.316	5469115.23	17.0383	A	0.4
5	☐	25000.000	25762.220	10910640.11	34.2242	A	0.7
6	☐	50000.000	50807.262	21593824.26	67.3618	A	2.0
7	☐	100000.00	102990.83	42747753.25	136.4070	A	0.7
8	☐	500000.00	499274.60	210254265.7	660.7384	A	0.3

$$y = 0.0013 * x + 0.1376$$

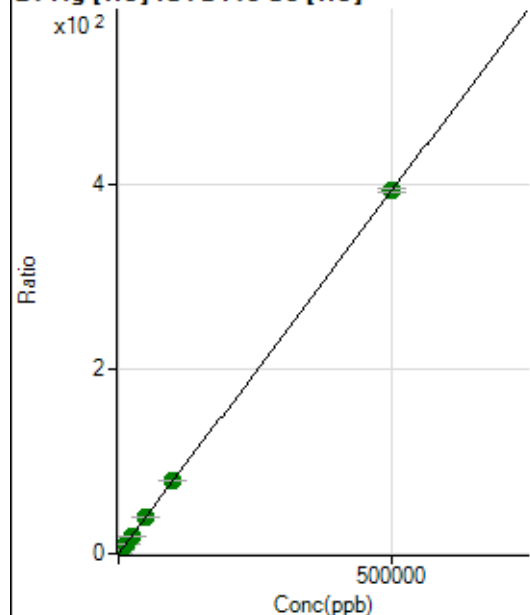
$$R = 1.0000$$

$$DL = 2.457$$

$$BEC = 104$$

Weight: <None>

Min Conc: 0

24 Mg [He] ISTD:45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	707.80	0.0022	P	8.4
2	☐	500.000	515.817	131236.33	0.4078	P	1.0
3	☐	5000.000	5084.501	1274410.13	4.0002	A	0.1
4	☐	12500.000	12491.995	3153665.78	9.8247	A	0.8
5	☐	25000.000	25059.739	6282524.42	19.7068	A	0.5
6	☐	50000.000	49485.688	12474005.51	38.9130	A	1.3
7	☐	100000.00	99577.246	24538393.25	78.3002	A	0.3
8	☐	500000.00	500132.33	125136772.5	393.2584	A	1.1

$$y = 7.8630E-004 * x + 0.0022$$

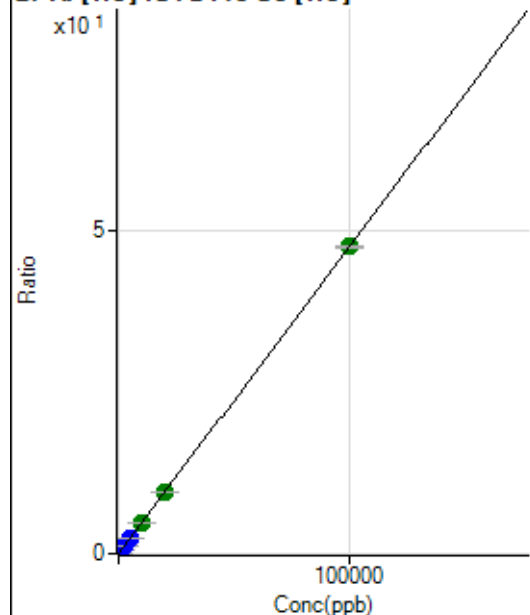
$$R = 1.0000$$

$$DL = 0.7089$$

$$BEC = 2.799$$

Weight: <None>

Min Conc: 0

27 Al [He] ISTD:45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	283.34	0.0009	P	9.6
2	☐	20.000	19.386	3241.50	0.0101	P	0.2
3	☐	1000.000	1218.309	184299.24	0.5785	P	0.8
4	☐	2500.000	2705.088	411943.67	1.2833	P	0.8
5	☐	5000.000	5185.004	783949.67	2.4591	P	0.4
6	☐	10000.000	9915.382	1507245.58	4.7017	A	0.9
7	☐	20000.000	20203.527	3002069.92	9.5793	A	0.8
8	☐	100000.00	99951.196	15079456.30	47.3872	A	0.5

$$y = 4.7409E-004 * x + 8.8150E-004$$

$$R = 1.0000$$

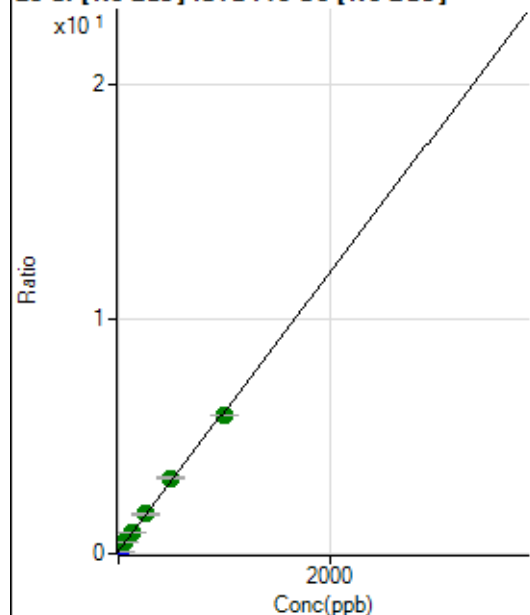
$$DL = 0.5364$$

$$BEC = 1.859$$

Weight: <None>

Min Conc: 0

28 Si [No Gas] ISTD:45 Sc [No Gas]



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	387509.57	0.1066	P	1.7
2	☐	10.000	1.127	406013.31	0.1133	P	0.6
3	☐	50.000	59.173	1616688.53	0.4572	A	2.3
4	☐	125.000	130.265	3157853.01	0.8785	A	0.6
5	☐	250.000	265.900	6090213.10	1.6822	A	1.7
6	☐	500.000	526.350	11775888.71	3.2255	A	2.5
7	☐	1000.000	981.822	21427722.46	5.9245	A	0.6
8	☐			418767.81	0.1162	P	1.8

$$y = 0.0059 * x + 0.1066$$

$$R = 0.9992$$

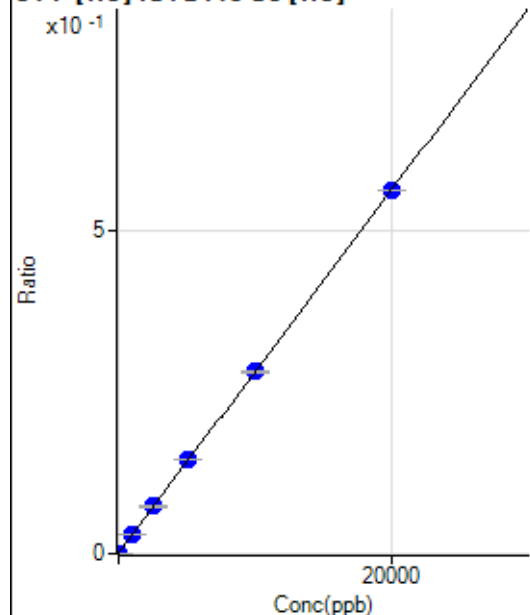
$$DL = 0.9008$$

$$BEC = 17.99$$

Weight: <None>

Min Conc: 0

31 P [He] ISTD:45 Sc [He]



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	-14.521	131.11	0.0004	P	7.9
2	☐	0.000	14.521	394.45	0.0012	P	11.6
3	☐	1000.000	1028.905	9486.36	0.0298	P	1.4
4	☐	2500.000	2577.100	23544.88	0.0734	P	1.0
5	☐	5000.000	5161.149	46570.61	0.1461	P	0.5
6	☐	10000.000	9990.262	90393.78	0.2820	P	1.6
7	☐	20000.000	19953.499	176256.62	0.5624	P	0.1
8	☐			214.45	0.0007	P	8.3

$$y = 2.8145E-005 * x + 8.1656E-004$$

$$R = 1.0000$$

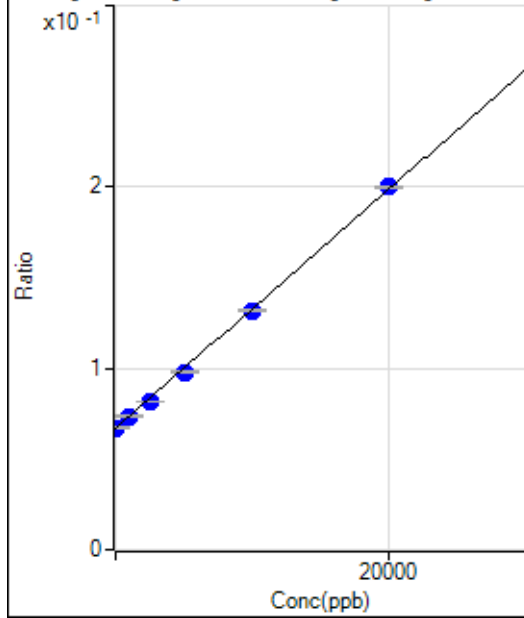
$$DL = 9.326$$

$$BEC = 29.01$$

Weight: <None>

Min Conc: 0

34 S [No Gas] ISTD:45 Sc [No Gas].abno_



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	-30.519	243280.54	0.0669	P	1.3
2	☐	0.000	30.519	241277.30	0.0673	P	1.5
3	☐	1000.000	994.865	260441.90	0.0737	P	2.4
4	☐	2500.000	2143.577	291944.43	0.0812	P	0.2
5	☐	5000.000	4691.890	354738.03	0.0980	P	0.8
6	☐	10000.000	9841.452	481469.24	0.1319	P	1.0
7	☐	20000.000	20201.111	723386.21	0.2000	P	0.2
8	☐			213653.07	0.0593	P	1.9

$$y = 6.5785E-006 * x + 0.0671$$

$$R = 0.9997$$

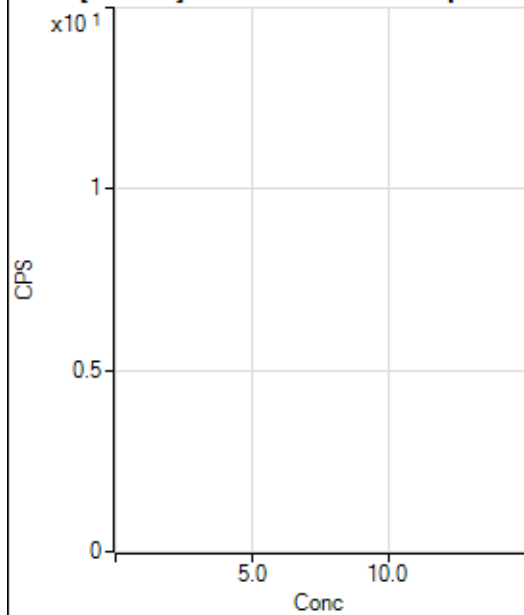
$$DL = 427.9$$

$$BEC = 1.02E+04$$

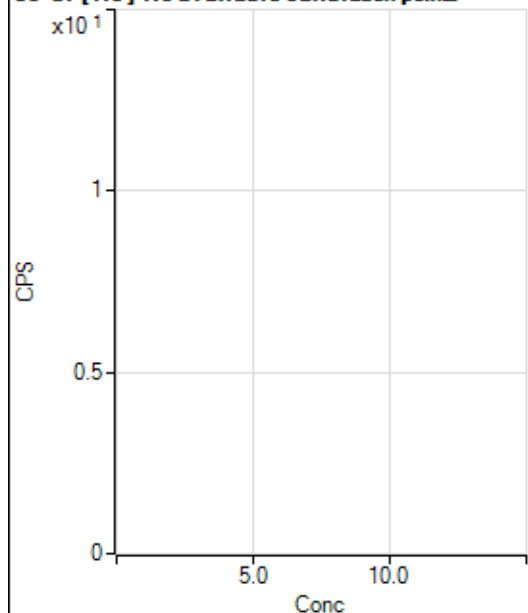
Weight: <None>

Min Conc: 0

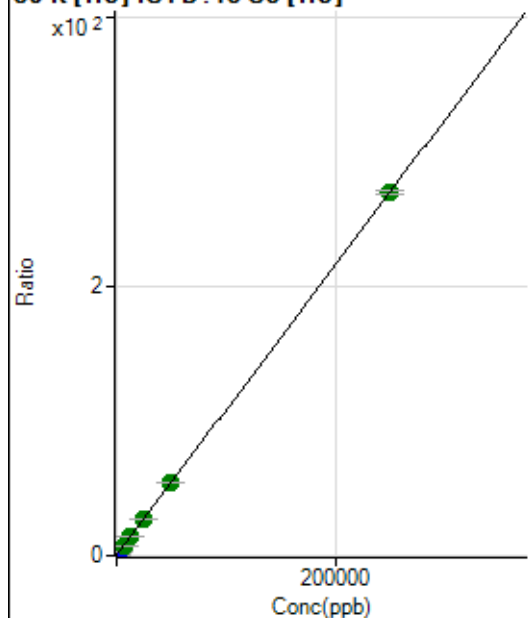
35 Cl [No Gas] No available calibration points



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐						
2	☐						
3	☐						
4	☐						
5	☐						
6	☐						
7	☐						
8	☐						

35 Cl [He] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐						
2	☐						
3	☐						
4	☐						
5	☐						
6	☐						
7	☐						
8	☐						

39 K [He] ISTD:45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	91065.62	0.2833	P	1.8
2	☐	500.000	501.364	265127.13	0.8238	P	0.7
3	☐	2500.000	2754.693	1036459.69	3.2534	P	1.0
4	☐	6250.000	6420.192	2312922.40	7.2055	A	1.7
5	☐	12500.000	12880.036	4517549.34	14.1704	A	0.3
6	☐	25000.000	25151.611	8783878.83	27.4015	A	1.3
7	☐	50000.000	49899.299	16949968.91	54.0843	A	0.5
8	☐	250000.00	249979.17	85854147.61	269.8088	A	1.1

$$y = 0.0011 * x + 0.2833$$

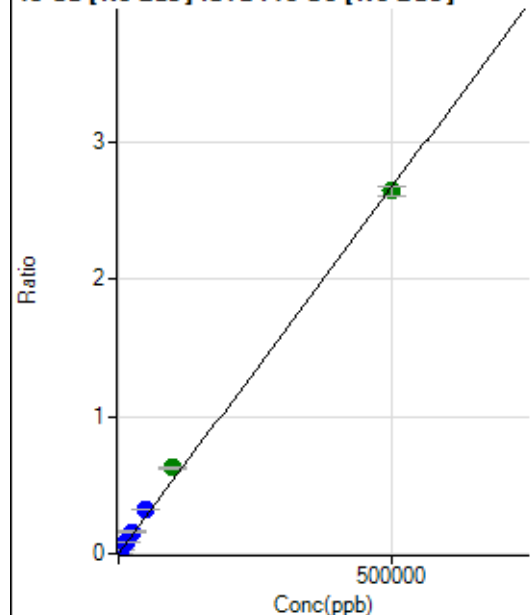
$$R = 1.0000$$

$$DL = 14.43$$

$$BEC = 262.7$$

Weight: <None>

Min Conc: 0

43 Ca [No Gas] ISTD:45 Sc [No Gas]

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	343.34	0.0001	P	5.7
2	☐	500.000	502.004	9947.81	0.0028	P	1.6
3	☐	5000.000	6197.743	117414.70	0.0332	P	1.0
4	☐	12500.000	15114.852	290513.93	0.0808	P	0.6
5	☐	25000.000	30160.056	583478.46	0.1612	P	1.4
6	☐	50000.000	59980.573	1169813.12	0.3204	P	2.3
7	☐	100000.00	116925.59	2258681.61	0.6245	A	1.2
8	☐	500000.00	495281.47	9534072.29	2.6451	A	2.6

$$y = 5.3405\text{E-}006 * x + 9.4380\text{E-}005$$

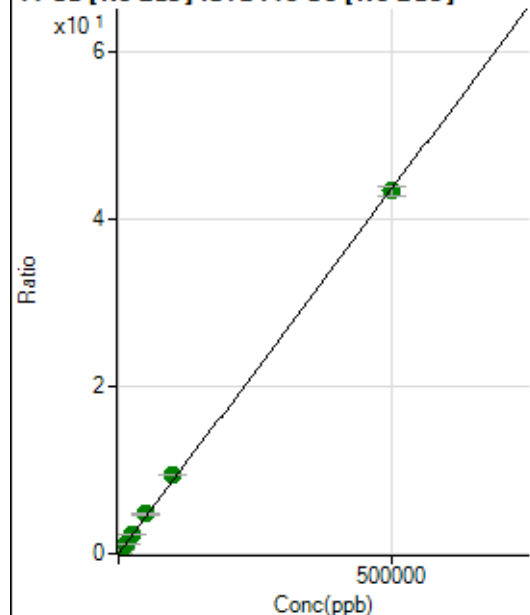
$$R = 0.9993$$

$$DL = 2.997$$

$$BEC = 17.67$$

Weight: <None>

Min Conc: 0

44 Ca [No Gas] ISTD:45 Sc [No Gas]

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	18665.24	0.0051	P	1.2
2	☐	500.000	509.978	177368.79	0.0495	P	1.0
3	☐	5000.000	5566.110	1729919.45	0.4892	A	1.3
4	☐	12500.000	13755.454	4318597.65	1.2013	A	1.6
5	☐	25000.000	27509.711	8679898.48	2.3974	A	0.6
6	☐	50000.000	54260.446	17248158.08	4.7236	A	1.6
7	☐	100000.00	108117.80	34026846.72	9.4071	A	1.4
8	☐	500000.00	497787.85	156049683.2	43.2930	A	2.3

$$y = 8.6960\text{E-}005 * x + 0.0051$$

$$R = 0.9998$$

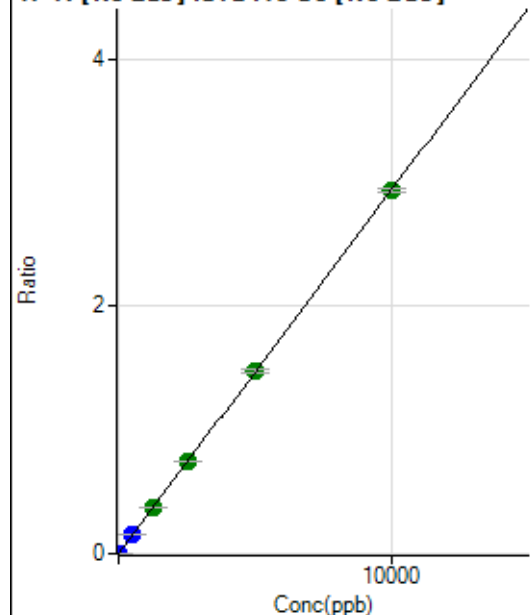
$$DL = 2.131$$

$$BEC = 59.04$$

Weight: <None>

Min Conc: 0

47 Ti [No Gas] ISTD:45 Sc [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	151.12	0.0000	P	10.2
2	☐	5.000	4.372	4760.79	0.0013	P	3.4
3	☐	500.000	510.894	531827.54	0.1504	P	2.5
4	☐	1250.000	1257.344	1330440.15	0.3701	A	0.4
5	☐	2500.000	2551.167	2718787.16	0.7509	A	0.7
6	☐	5000.000	5021.639	5396047.98	1.4780	A	2.6
7	☐	10000.000	9974.926	10619411.78	2.9359	A	0.9
8	☐			1795.68	0.0005	P	6.4

$$y = 2.9433\text{E-}004 * x + 4.1536\text{E-}005$$

$$R = 1.0000$$

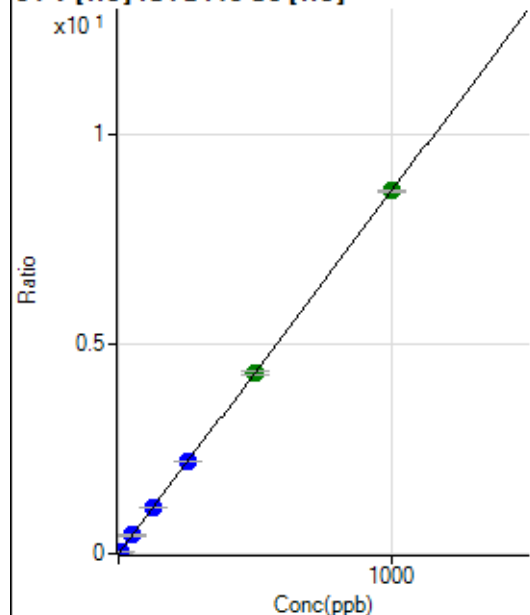
$$DL = 0.04331$$

$$BEC = 0.1411$$

Weight: <None>

Min Conc: 0

51 V [He] ISTD:45 Sc [He]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	8.89	0.0000	P	57.6
2	☐	5.000	4.815	13443.85	0.0418	P	1.4
3	☐	50.000	50.559	139653.68	0.4384	P	0.9
4	☐	125.000	127.154	353864.96	1.1024	P	0.7
5	☐	250.000	253.743	701332.10	2.1999	P	0.7
6	☐	500.000	497.147	1381550.99	4.3102	A	2.3
7	☐	1000.000	1000.195	2717457.55	8.6714	A	0.9
8	☐			617.80	0.0019	P	12.4

$$y = 0.0087 * x + 2.7655\text{E-}005$$

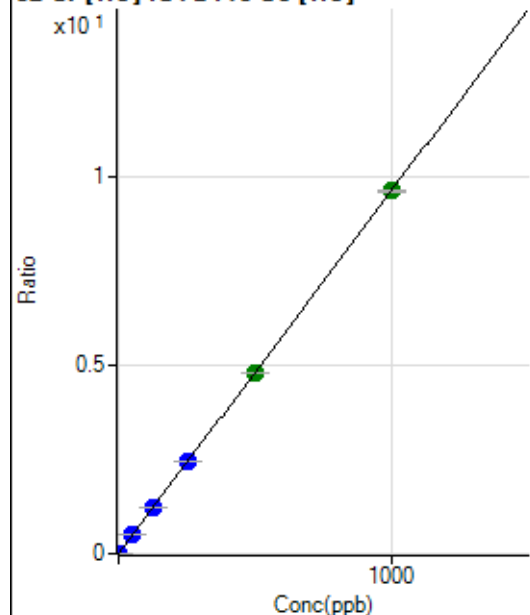
$$R = 1.0000$$

$$DL = 0.00551$$

$$BEC = 0.00319$$

Weight: <None>

Min Conc: 0

52 Cr [He] ISTD:45 Sc [He]

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	712.25	0.0022	P	2.1
2	☐	2.000	1.990	6868.29	0.0213	P	1.8
3	☐	50.000	51.438	158230.92	0.4967	P	1.8
4	☐	125.000	127.851	395223.38	1.2313	P	1.1
5	☐	250.000	254.230	779846.02	2.4462	P	0.4
6	☐	500.000	497.813	1534860.53	4.7878	A	0.6
7	☐	1000.000	999.608	3012119.50	9.6116	A	0.6
8	☐			10328.13	0.0325	P	5.5

$$y = 0.0096 * x + 0.0022$$

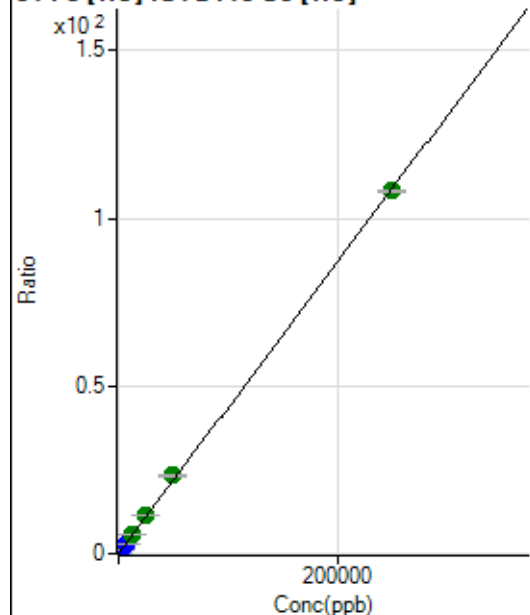
$$R = 1.0000$$

$$DL = 0.01482$$

$$BEC = 0.2304$$

Weight: <None>

Min Conc: 0

54 Fe [He] ISTD:45 Sc [He]

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	1635.66	0.0051	P	7.5
2	☐	50.000	51.966	8898.26	0.0277	P	1.1
3	☐	2500.000	2842.970	394838.41	1.2394	P	0.5
4	☐	6250.000	7030.536	981384.54	3.0574	P	0.6
5	☐	12500.000	13381.833	1853734.94	5.8147	A	1.0
6	☐	25000.000	26483.205	3687362.34	11.5026	A	1.0
7	☐	50000.000	53503.940	7281068.43	23.2335	A	0.4
8	☐	250000.00	249083.85	34412480.32	108.1436	A	0.3

$$y = 4.3414E-004 * x + 0.0051$$

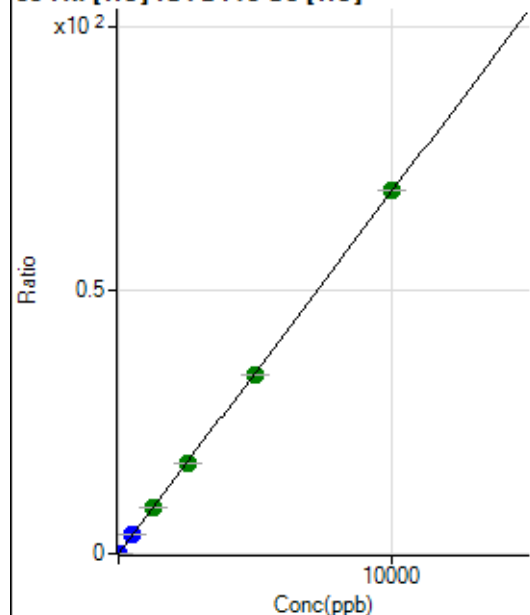
$$R = 0.9999$$

$$DL = 2.653$$

$$BEC = 11.72$$

Weight: <None>

Min Conc: 0

55 Mn [He] ISTD:45 Sc [He]

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	381.12	0.0012	P	6.5
2	☐	1.000	0.984	2554.69	0.0079	P	2.2
3	☐	500.000	514.454	1125042.38	3.5314	P	0.7
4	☐	1250.000	1267.765	2792840.10	8.7007	A	0.5
5	☐	2500.000	2500.590	5470747.90	17.1604	A	0.5
6	☐	5000.000	4940.488	10868753.86	33.9032	A	0.5
7	☐	10000.000	10026.665	21562875.79	68.8049	A	0.1
8	☐			11700.17	0.0368	P	1.6

$$y = 0.0069 * x + 0.0012$$

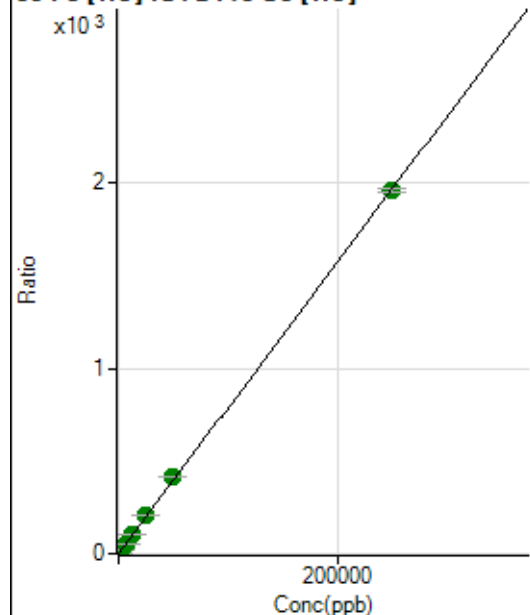
$$R = 1.0000$$

$$DL = 0.03383$$

$$BEC = 0.1728$$

Weight: <None>

Min Conc: 0

56 Fe [He] ISTD:45 Sc [He]

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	12442.99	0.0387	P	1.3
2	☐	50.000	52.114	144051.81	0.4476	P	1.1
3	☐	2500.000	2676.478	6702792.88	21.0393	A	0.4
4	☐	6250.000	6636.955	16728192.67	52.1146	A	0.7
5	☐	12500.000	13241.244	33134028.40	103.9341	A	1.1
6	☐	25000.000	26094.100	65644534.58	204.7821	A	1.2
7	☐	50000.000	52643.515	129460710.2	413.0981	A	0.4
8	☐	250000.00	249313.38	622484746.2	1.956238	A	0.9

$$y = 0.0078 * x + 0.0387$$

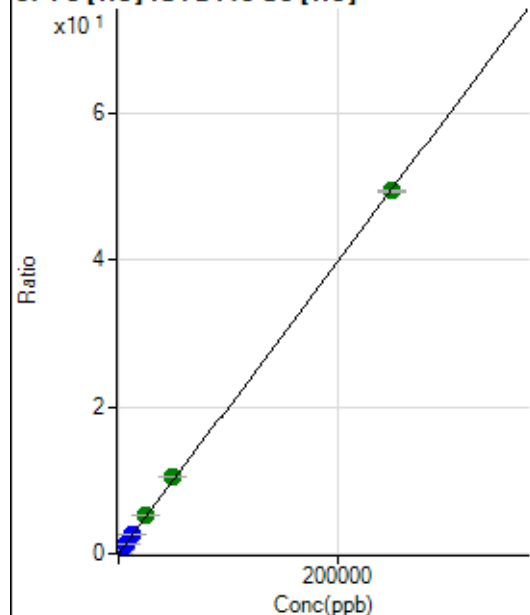
$$R = 0.9999$$

$$DL = 0.1938$$

$$BEC = 4.932$$

Weight: <None>

Min Conc: 0

57 Fe [He] ISTD:45 Sc [He]

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	3130.36	0.0097	P	2.9
2	☐	50.000	52.366	6470.33	0.0201	P	0.4
3	☐	2500.000	2754.652	176868.58	0.5552	P	1.3
4	☐	6250.000	6873.962	440033.03	1.3709	P	0.4
5	☐	12500.000	13677.145	866488.61	2.7180	P	0.6
6	☐	25000.000	25974.543	1651911.82	5.1530	A	1.1
7	☐	50000.000	52540.805	3263407.38	10.4134	A	0.7
8	☐	250000.00	249317.38	15712458.24	49.3775	A	0.3

$$y = 1.9801\text{E-}004 * x + 0.0097$$

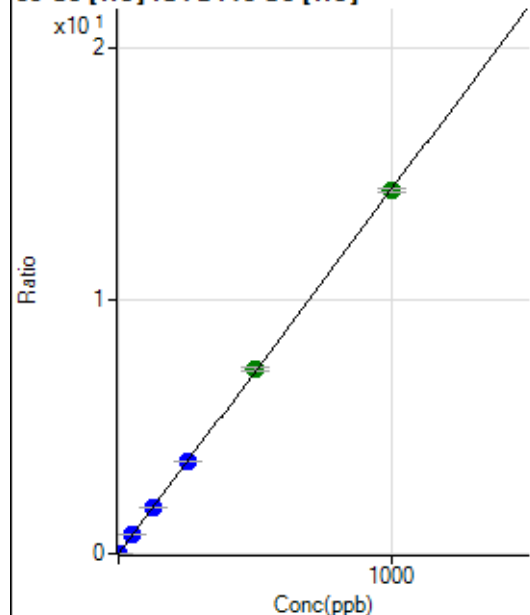
R = 0.9999

DL = 4.211

BEC = 49.17

Weight: <None>

Min Conc: 0

59 Co [He] ISTD:45 Sc [He]

	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	61.11	0.0002	P	9.0
2	☐	1.000	1.020	4789.70	0.0149	P	4.2
3	☐	50.000	51.456	236171.02	0.7413	P	1.3
4	☐	125.000	127.631	590146.39	1.8385	P	0.3
5	☐	250.000	253.281	1163077.19	3.6483	P	0.6
6	☐	500.000	505.975	2335934.63	7.2879	A	2.4
7	☐	1000.000	995.791	4494775.31	14.3429	A	1.2
8	☐			12038.23	0.0378	P	3.4

$$y = 0.0144 * x + 1.9017\text{E-}004$$

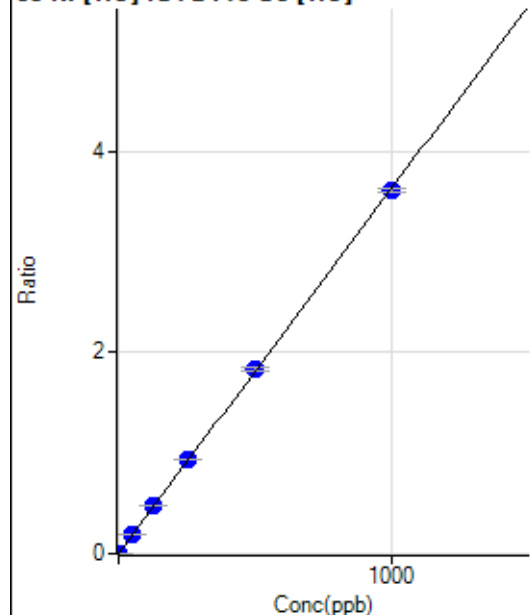
R = 1.0000

DL = 0.003577

BEC = 0.0132

Weight: <None>

Min Conc: 0

60 Ni [He] ISTD:45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	97.78	0.0003	P	4.5
2	☐	1.000	1.022	1291.18	0.0040	P	2.0
3	☐	50.000	53.020	61409.61	0.1928	P	0.7
4	☐	125.000	130.309	151928.20	0.4733	P	0.6
5	☐	250.000	258.560	299303.70	0.9388	P	0.7
6	☐	500.000	507.011	590027.43	1.8407	P	1.8
7	☐	1000.000	993.540	1130271.82	3.6067	P	1.0
8	☐			5289.87	0.0166	P	3.4

$$y = 0.0036 * x + 3.0406E-004$$

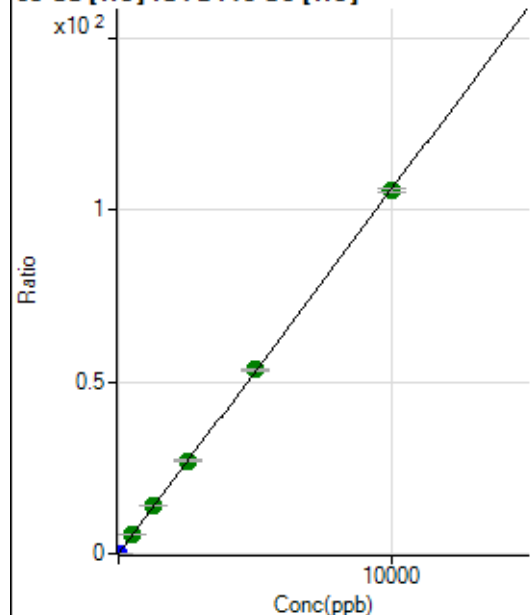
$$R = 0.9999$$

$$DL = 0.01119$$

$$BEC = 0.08377$$

Weight: <None>

Min Conc: 0

63 Cu [He] ISTD:45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	473.35	0.0015	P	6.4
2	☐	2.000	1.772	6510.36	0.0202	P	1.6
3	☐	500.000	515.289	1738490.83	5.4572	A	1.7
4	☐	1250.000	1297.583	4410397.71	13.7400	A	0.4
5	☐	2500.000	2557.104	8631657.86	27.0755	A	0.7
6	☐	5000.000	5041.943	17113068.63	53.3844	A	1.0
7	☐	10000.000	9958.040	33041253.12	105.4349	A	1.0
8	☐			8296.81	0.0261	P	0.2

$$y = 0.0106 * x + 0.0015$$

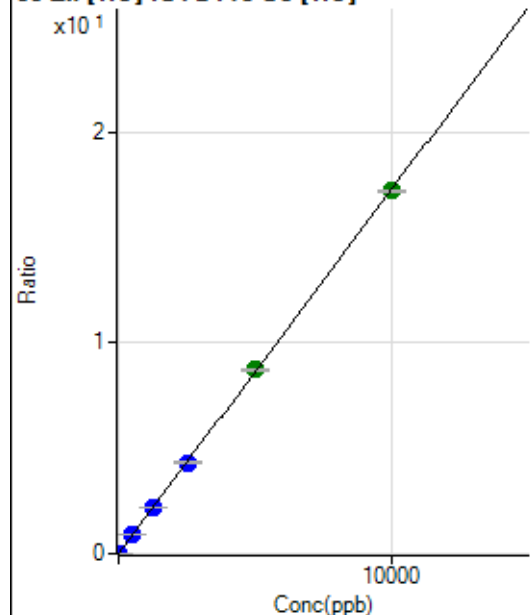
$$R = 1.0000$$

$$DL = 0.0269$$

$$BEC = 0.1391$$

Weight: <None>

Min Conc: 0

66 Zn [He] ISTD:45 Sc [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	640.02	0.0020	P	7.4
2	☐	2.000	4.695	3250.39	0.0101	P	1.9
3	☐	500.000	508.254	280323.42	0.8799	P	0.3
4	☐	1250.000	1263.245	701040.38	2.1840	P	0.2
5	☐	2500.000	2505.793	1380485.95	4.3302	P	0.4
6	☐	5000.000	5065.774	2805960.86	8.7521	A	0.9
7	☐	10000.000	9963.596	5394078.95	17.2121	A	0.3
8	☐			6084.63	0.0191	P	1.3

$$y = 0.0017 * x + 0.0020$$

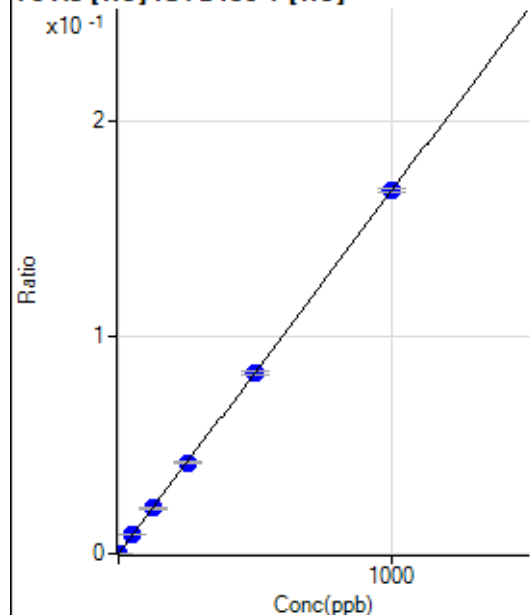
$$R = 1.0000$$

$$DL = 0.2571$$

$$BEC = 1.152$$

Weight: <None>

Min Conc: 0

75 As [He] ISTD:89 Y [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	7.78	0.0000	P	88.9
2	☐	1.000	0.980	420.01	0.0002	P	2.2
3	☐	50.000	50.552	21158.51	0.0085	P	0.5
4	☐	125.000	125.385	53017.61	0.0210	P	2.4
5	☐	250.000	251.484	106347.39	0.0421	P	1.0
6	☐	500.000	499.032	211038.04	0.0836	P	2.7
7	☐	1000.000	1000.038	414343.80	0.1676	P	1.1
8	☐			218.89	0.0001	P	2.8

$$y = 1.6756E-004 * x + 3.1175E-006$$

$$R = 1.0000$$

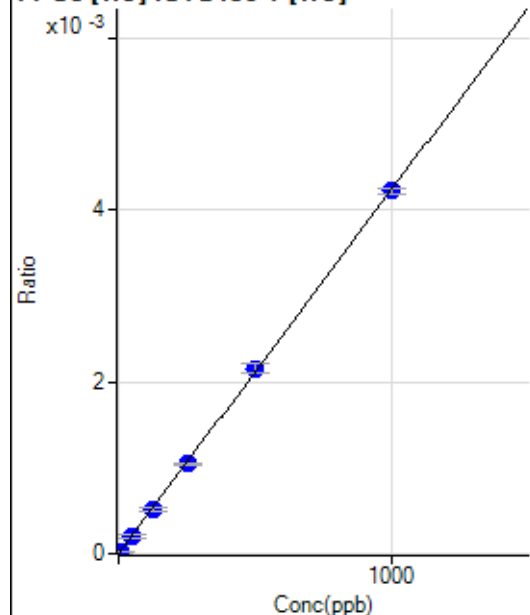
$$DL = 0.04963$$

$$BEC = 0.01861$$

Weight: <None>

Min Conc: 0

77 Se [He] ISTD:89 Y [He]



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	1.11	0.0000	P	173.
2	☐	5.000	4.396	47.78	0.0000	P	18.3
3	☐	50.000	47.980	508.90	0.0002	P	16.3
4	☐	125.000	122.646	1312.29	0.0005	P	6.7
5	☐	250.000	246.478	2634.71	0.0010	P	2.4
6	☐	500.000	509.058	5442.15	0.0022	P	4.9
7	☐	1000.000	996.750	10435.97	0.0042	P	1.7
8	☐			5.55	0.0000	P	69.1

$$y = 4.2340\text{E-}006 * x + 4.4177\text{E-}007$$

$$R = 0.9999$$

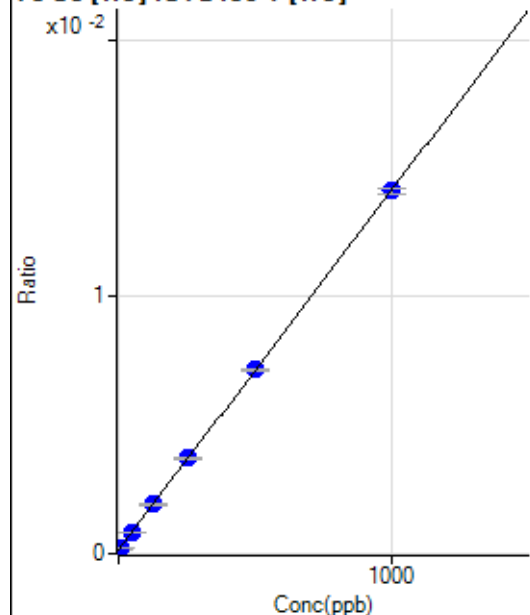
$$DL = 0.5422$$

$$BEC = 0.1043$$

Weight: <None>

Min Conc: 0

78 Se [He] ISTD:89 Y [He]



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	364.45	0.0001	P	7.6
2	☐	5.000	4.745	531.13	0.0002	P	2.8
3	☐	50.000	49.025	2074.61	0.0008	P	6.6
4	☐	125.000	126.139	4821.94	0.0019	P	2.7
5	☐	250.000	255.129	9376.36	0.0037	P	2.9
6	☐	500.000	500.647	18056.66	0.0072	P	0.5
7	☐	1000.000	998.302	34905.55	0.0141	P	1.3
8	☐			354.45	0.0001	P	14.2

$$y = 1.3995\text{E-}005 * x + 1.4516\text{E-}004$$

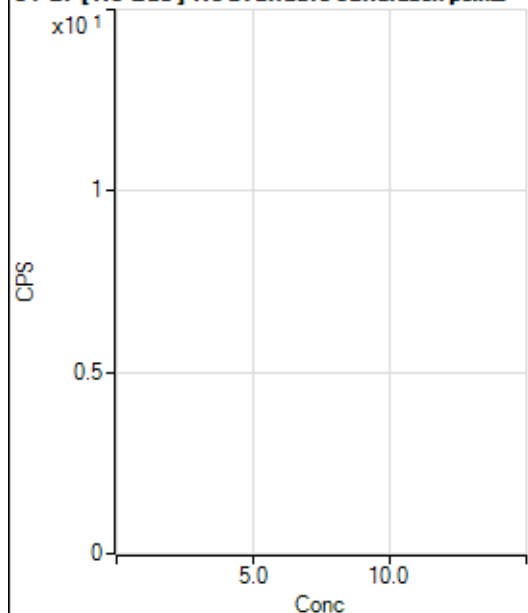
$$R = 1.0000$$

$$DL = 2.362$$

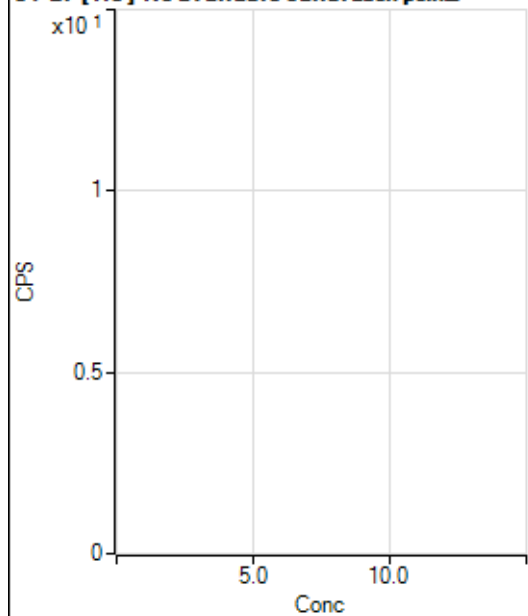
$$BEC = 10.37$$

Weight: <None>

Min Conc: 0

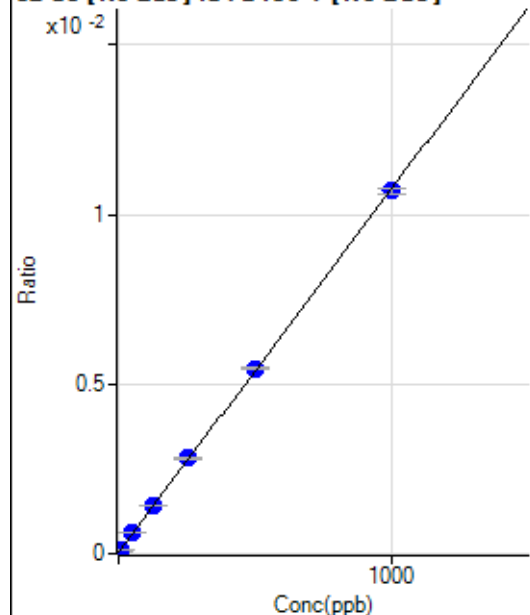
81 Br [No Gas] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			5732.29		P	1.6
2	☐			5728.94		P	1.8
3	☐			5292.12		P	2.6
4	☐			5504.40		P	3.7
5	☐			5493.29		P	2.2
6	☐			5572.22		P	0.9
7	☐			5546.65		P	5.0
8	☐			6053.52		P	1.0

81 Br [He] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			91.11		P	14.8
2	☐			88.89		P	9.4
3	☐			75.56		P	2.6
4	☐			62.22		P	16.4
5	☐			62.22		P	8.2
6	☐			71.11		P	28.3
7	☐			47.78		P	10.7
8	☐			85.56		P	8.1

82 Se [No Gas] ISTD:89 Y [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	363.01	0.0000	P	14.2
2	☐	5.000	4.738	822.92	0.0001	P	3.5
3	☐	50.000	53.916	5569.88	0.0006	P	1.5
4	☐	125.000	128.393	13162.32	0.0014	P	1.9
5	☐	250.000	259.228	26510.96	0.0028	P	2.2
6	☐	500.000	504.613	52213.15	0.0054	P	1.0
7	☐	1000.000	994.768	101915.56	0.0107	P	1.3
8	☐			412.40	0.0000	P	2.9

$$y = 1.0713E-005 * x + 3.9063E-005$$

$$R = 0.9999$$

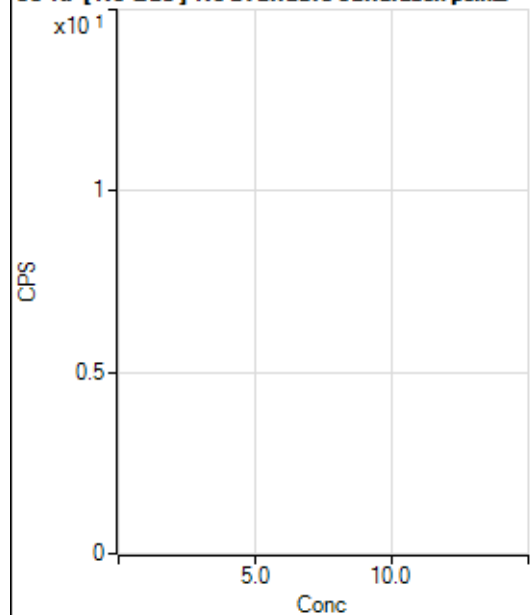
$$DL = 1.551$$

$$BEC = 3.646$$

Weight: <None>

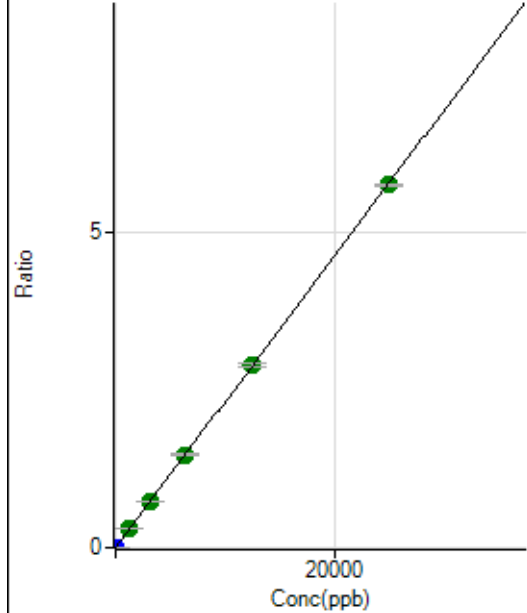
Min Conc: 0

83 Kr [No Gas] No available calibration points



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐			241.12		P	25.9
2	☐			246.67		P	13.3
3	☐			244.45		P	6.4
4	☐			232.23		P	3.3
5	☐			281.12		P	10.8
6	☐			256.67		P	17.2
7	☐			252.23		P	4.6
8	☐			263.34		P	4.6

86 Sr [No Gas] ISTD:89 Y [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	400.01	0.0000	P	11.1
2	☐	1.000	1.009	2526.91	0.0003	P	1.7
3	☐	1250.000	1292.566	2694305.36	0.2982	A	0.9
4	☐	3125.000	3166.141	6797677.19	0.7305	A	1.3
5	☐	6250.000	6385.503	13870285.49	1.4732	A	1.1
6	☐	12500.000	12555.848	27777968.47	2.8967	A	1.1
7	☐	25000.000	24930.929	54806183.63	5.7517	A	0.8
8	☐			10825.19	0.0012	P	6.9

$$y = 2.3070\text{E-}004 * x + 4.3089\text{E-}005$$

$$R = 1.0000$$

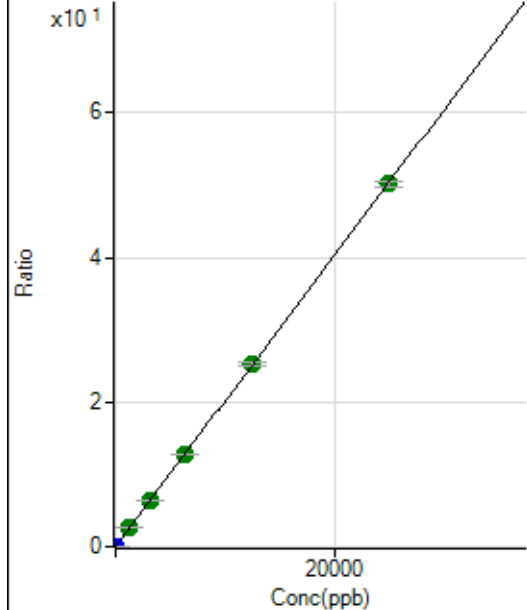
$$DL = 0.06238$$

$$BEC = 0.1868$$

Weight: <None>

Min Conc: 0

88 Sr [No Gas] ISTD:89 Y [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	240.00	0.0000	P	14.1
2	☐	1.000	0.935	17461.59	0.0019	P	0.2
3	☐	1250.000	1273.284	23135811.32	2.5610	A	1.0
4	☐	3125.000	3161.586	59177248.01	6.3589	A	1.1
5	☐	6250.000	6340.676	120064830.4	12.7531	A	1.3
6	☐	12500.000	12549.415	242051991.9	25.2408	A	1.7
7	☐	25000.000	24946.886	478156601.7	50.1759	A	1.8
8	☐			88807.43	0.0097	P	7.2

$$y = 0.0020 * x + 2.5794\text{E-}005$$

$$R = 1.0000$$

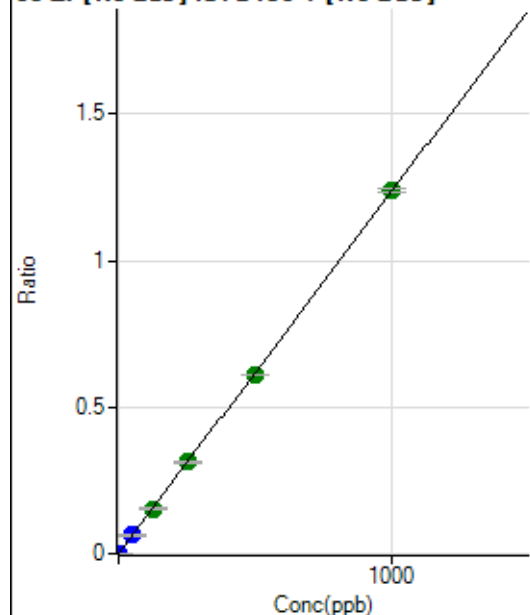
$$DL = 0.005443$$

$$BEC = 0.01282$$

Weight: <None>

Min Conc: 0

90 Zr [No Gas] ISTD : 89 Y [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	360.01	0.0000	P	4.5
2	☐	1.000	0.936	10950.85	0.0012	P	3.0
3	☐	50.000	50.506	564187.38	0.0625	P	1.8
4	☐	125.000	124.670	1434401.35	0.1541	A	1.0
5	☐	250.000	252.728	2941255.44	0.3124	A	1.8
6	☐	500.000	495.040	5867763.04	0.6119	A	0.4
7	☐	1000.000	1001.814	11799344.13	1.2383	A	1.2
8	☐			7216.28	0.0008	P	4.3

$$y = 0.0012 * x + 3.8726E-005$$

$$R = 1.0000$$

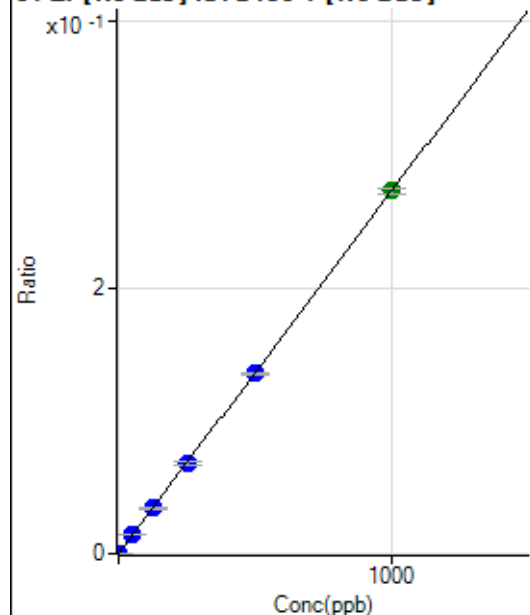
$$DL = 0.004201$$

$$BEC = 0.03133$$

Weight: <None>

Min Conc: 0

91 Zr [No Gas] ISTD : 89 Y [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	76.67	0.0000	P	10.2
2	☐	1.000	0.943	2428.00	0.0003	P	1.0
3	☐	50.000	51.326	126332.44	0.0140	P	1.9
4	☐	125.000	125.237	317455.94	0.0341	P	1.5
5	☐	250.000	249.490	639696.97	0.0680	P	2.4
6	☐	500.000	497.635	1299617.55	0.1355	P	0.8
7	☐	1000.000	1001.214	2598252.12	0.2727	A	1.4
8	☐			1647.89	0.0002	P	5.8

$$y = 2.7232E-004 * x + 8.2429E-006$$

$$R = 1.0000$$

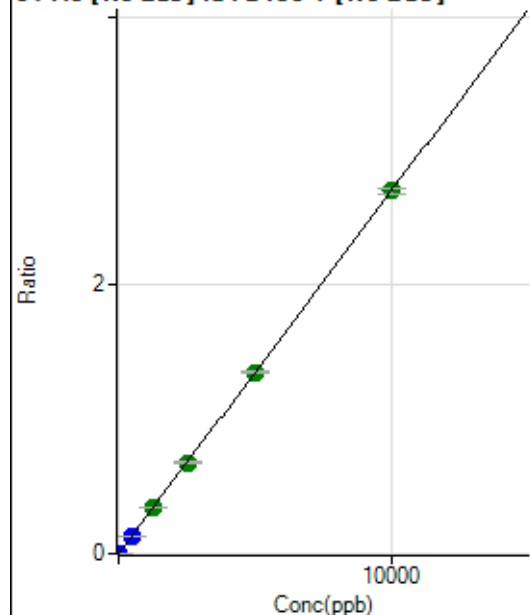
$$DL = 0.0093$$

$$BEC = 0.03027$$

Weight: <None>

Min Conc: 0

94 Mo [No Gas] ISTD:89 Y [No Gas]



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	168.89	0.0000	P	8.7
2	☐	5.000	5.059	12693.38	0.0014	P	0.8
3	☐	500.000	500.648	1222580.48	0.1353	P	0.9
4	☐	1250.000	1276.372	3210642.38	0.3450	A	2.1
5	☐	2500.000	2503.127	6370021.92	0.6766	A	1.5
6	☐	5000.000	4998.772	12956309.67	1.3511	A	0.6
7	☐	10000.000	9996.504	25747714.06	2.7020	A	1.6
8	☐			6618.23	0.0007	P	8.0

$$y = 2.7029\text{E-}004 * x + 1.8163\text{E-}005$$

$$R = 1.0000$$

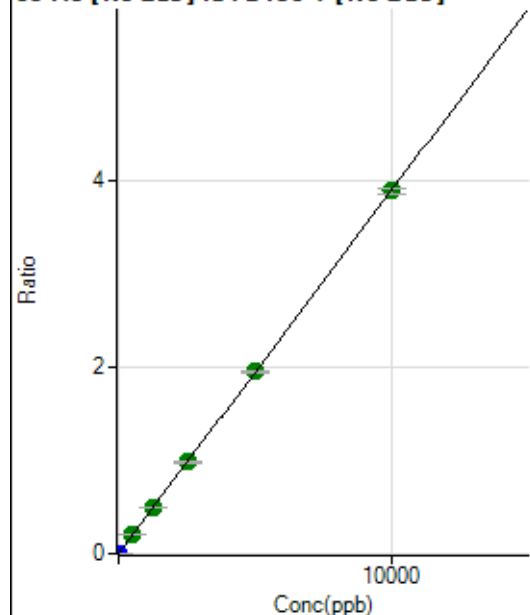
$$DL = 0.0175$$

$$BEC = 0.0672$$

Weight: <None>

Min Conc: 0

95 Mo [No Gas] ISTD:89 Y [No Gas]



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	87.78	0.0000	P	19.1
2	☐	5.000	4.257	15256.92	0.0017	P	1.4
3	☐	500.000	507.655	1784242.35	0.1975	A	1.1
4	☐	1250.000	1261.142	4566150.14	0.4907	A	1.9
5	☐	2500.000	2514.238	9209808.47	0.9783	A	1.6
6	☐	5000.000	5016.601	18716844.44	1.9519	A	0.6
7	☐	10000.000	9986.365	37024288.06	3.8855	A	1.7
8	☐			6445.94	0.0007	P	6.5

$$y = 3.8908\text{E-}004 * x + 9.4412\text{E-}006$$

$$R = 1.0000$$

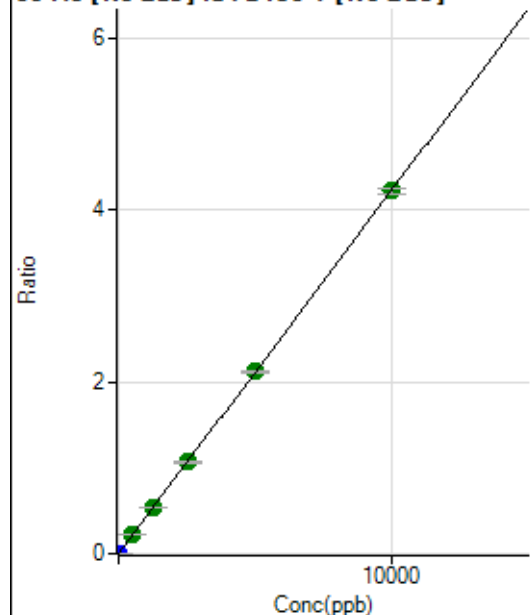
$$DL = 0.01393$$

$$BEC = 0.02427$$

Weight: <None>

Min Conc: 0

96 Mo [No Gas] ISTD:89 Y [No Gas]



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	126.67	0.0000	P	15.3
2	☐	5.000	4.348	16974.39	0.0019	P	2.1
3	☐	500.000	511.038	1953193.75	0.2162	A	0.7
4	☐	1250.000	1260.463	4962523.74	0.5333	A	1.5
5	☐	2500.000	2518.929	10033536.24	1.0657	A	0.7
6	☐	5000.000	5007.659	20316370.81	2.1186	A	0.8
7	☐	10000.000	9989.579	40276555.23	4.2263	A	1.9
8	☐			11891.63	0.0013	P	5.4

$$y = 4.2307\text{E-}004 * x + 1.3650\text{E-}005$$

$$R = 1.0000$$

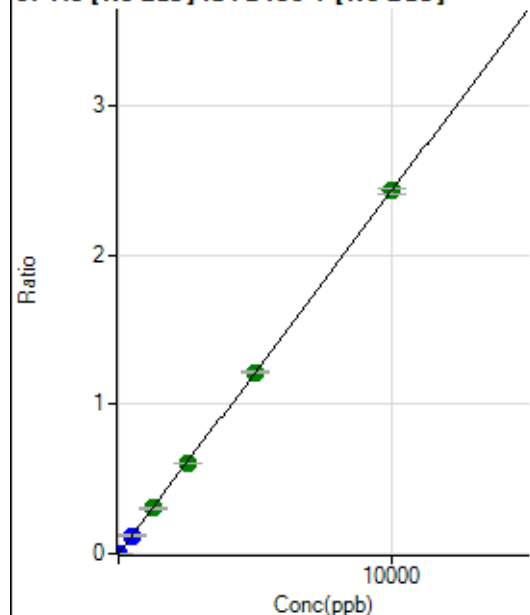
$$DL = 0.01483$$

$$BEC = 0.03226$$

Weight: <None>

Min Conc: 0

97 Mo [No Gas] ISTD:89 Y [No Gas]



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	44.44	0.0000	P	25.9
2	☐	5.000	4.161	9309.70	0.0010	P	0.3
3	☐	500.000	502.581	1103622.99	0.1222	P	2.3
4	☐	1250.000	1254.690	2838553.85	0.3050	A	1.6
5	☐	2500.000	2499.539	5721299.78	0.6077	A	1.2
6	☐	5000.000	4992.204	11638542.19	1.2137	A	1.1
7	☐	10000.000	10003.298	23175138.82	2.4319	A	1.4
8	☐			4037.27	0.0004	P	7.2

$$y = 2.4311\text{E-}004 * x + 4.7777\text{E-}006$$

$$R = 1.0000$$

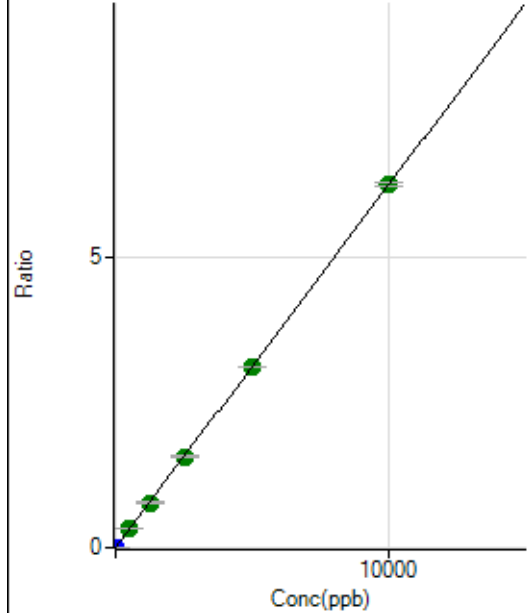
$$DL = 0.01527$$

$$BEC = 0.01965$$

Weight: <None>

Min Conc: 0

98 Mo [No Gas] ISTD:89 Y [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	72.22	0.0000	P	18.9
2	☐	5.000	4.244	24349.25	0.0027	P	1.9
3	☐	500.000	512.323	2890203.71	0.3200	A	3.3
4	☐	1250.000	1242.201	7220469.47	0.7758	A	1.4
5	☐	2500.000	2512.195	14772615.47	1.5690	A	0.5
6	☐	5000.000	4985.696	29859953.72	3.1138	A	0.8
7	☐	10000.000	10004.462	59540094.67	6.2483	A	1.1
8	☐			9990.19	0.0011	P	7.8

$$y = 6.2455E-004 * x + 7.7705E-006$$

$$R = 1.0000$$

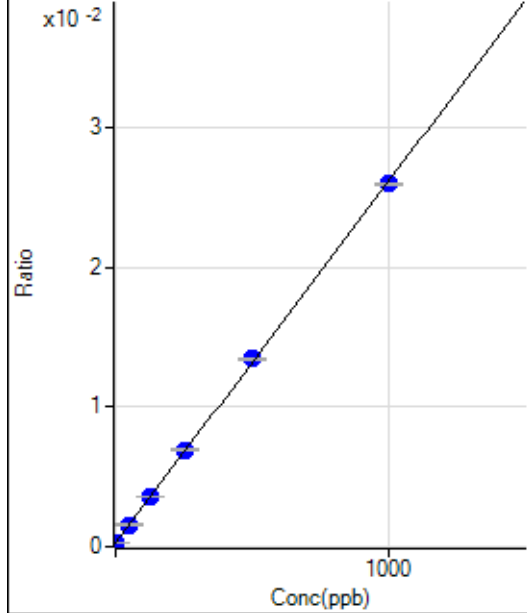
$$DL = 0.007068$$

$$BEC = 0.01244$$

Weight: <None>

Min Conc: 0

106 Cd [No Gas] ISTD:159 Tb [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	1488.98	0.0003	P	1.6
2	☐	1.000	0.876	1605.66	0.0003	P	5.6
3	☐	50.000	51.081	8997.32	0.0016	P	1.5
4	☐	125.000	128.597	20924.07	0.0036	P	2.0
5	☐	250.000	257.819	41287.45	0.0069	P	0.8
6	☐	500.000	509.178	81213.28	0.0134	P	1.2
7	☐	1000.000	992.952	157770.11	0.0260	P	0.8
8	☐			1605.66	0.0003	P	5.6

$$y = 2.5907E-005 * x + 2.5701E-004$$

$$R = 0.9999$$

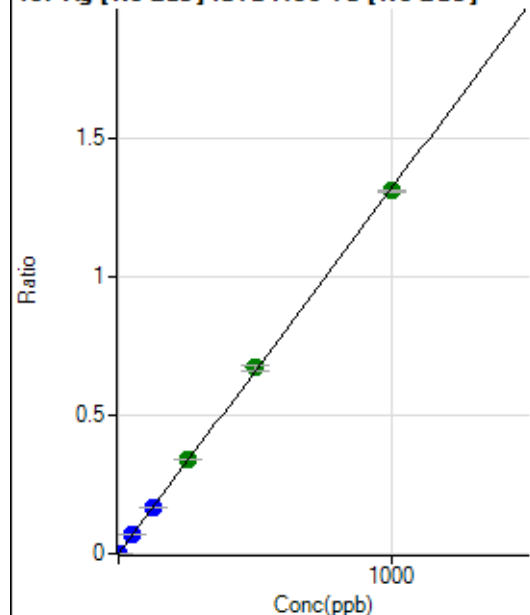
$$DL = 0.4688$$

$$BEC = 9.92$$

Weight: <None>

Min Conc: 0

107 Ag [No Gas] ISTD :159 Tb [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	58.89	0.0000	P	37.0
2	☐	1.000	0.895	6850.57	0.0012	P	1.3
3	☐	50.000	51.067	384133.07	0.0675	P	1.5
4	☐	125.000	125.820	969495.26	0.1663	P	1.3
5	☐	250.000	257.564	2026005.91	0.3404	A	1.7
6	☐	500.000	509.564	4066200.91	0.6734	A	2.9
7	☐	1000.000	993.171	7969666.13	1.3125	A	0.8
8	☐			1265.63	0.0002	P	16.3

$$y = 0.0013 * x + 1.0181E-005$$

$$R = 0.9999$$

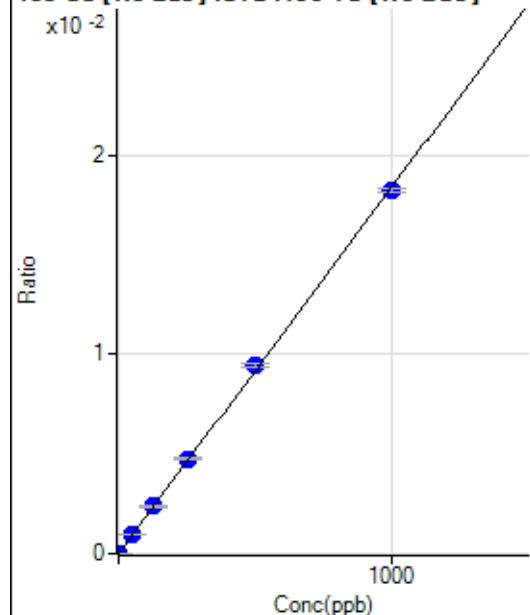
$$DL = 0.008556$$

$$BEC = 0.007704$$

Weight: <None>

Min Conc: 0

108 Cd [No Gas] ISTD :159 Tb [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	8.89	0.0000	P	57.5
2	☐	1.000	1.044	118.89	0.0000	P	3.6
3	☐	50.000	52.155	5459.97	0.0010	P	3.7
4	☐	125.000	128.809	13805.57	0.0024	P	2.3
5	☐	250.000	259.127	28342.20	0.0048	P	2.1
6	☐	500.000	512.721	56880.97	0.0094	P	2.1
7	☐	1000.000	990.774	110530.42	0.0182	P	1.2
8	☐			58.89	0.0000	P	17.5

$$y = 1.8370E-005 * x + 1.5329E-006$$

$$R = 0.9998$$

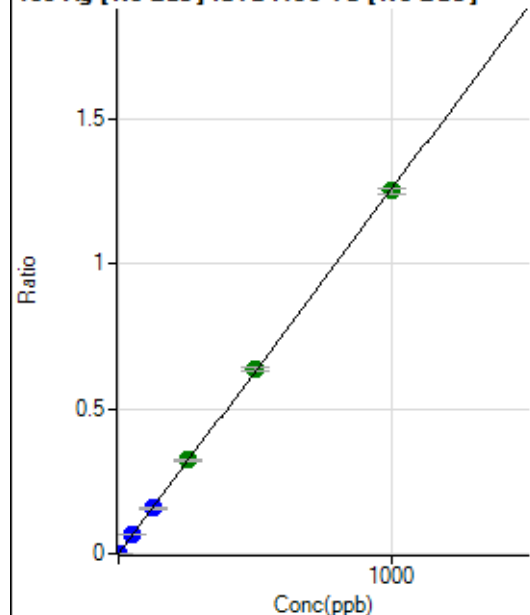
$$DL = 0.1439$$

$$BEC = 0.08345$$

Weight: <None>

Min Conc: 0

109 Ag [No Gas] ISTD :159 Tb [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	26.66	0.0000	P	56.3
2	☐	1.000	0.901	6529.31	0.0011	P	3.5
3	☐	50.000	50.449	361247.60	0.0635	P	0.7
4	☐	125.000	124.832	915531.34	0.1570	P	1.6
5	☐	250.000	256.458	1920091.00	0.3226	A	2.3
6	☐	500.000	506.739	3849020.50	0.6374	A	1.5
7	☐	1000.000	995.015	7600343.36	1.2516	A	1.5
8	☐			1187.84	0.0002	P	11.6

$$y = 0.0013 * x + 4.5859E-006$$

$$R = 0.9999$$

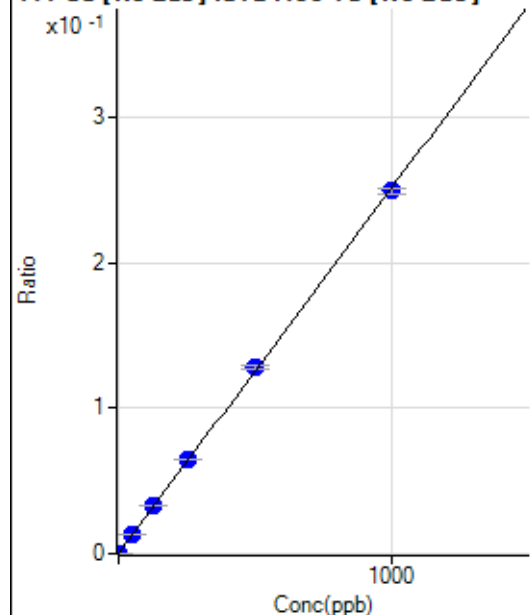
$$DL = 0.006155$$

$$BEC = 0.003646$$

Weight: <None>

Min Conc: 0

111 Cd [No Gas] ISTD :159 Tb [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	1046.06	0.0002	P	1.2
2	☐	1.000	0.955	2415.26	0.0004	P	3.3
3	☐	50.000	52.743	76458.30	0.0134	P	2.7
4	☐	125.000	129.786	191230.96	0.0328	P	0.3
5	☐	250.000	258.752	388156.68	0.0652	P	0.5
6	☐	500.000	508.609	772932.43	0.1280	P	2.1
7	☐	1000.000	992.772	1516220.99	0.2497	P	1.6
8	☐			1384.97	0.0002	P	9.8

$$y = 2.5132E-004 * x + 1.8055E-004$$

$$R = 0.9999$$

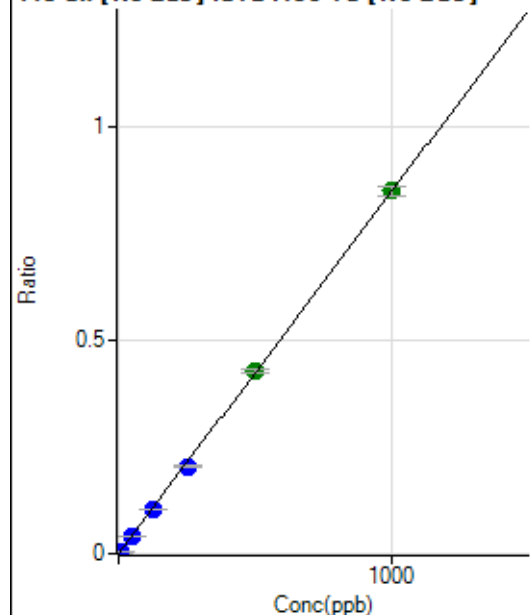
$$DL = 0.02525$$

$$BEC = 0.7184$$

Weight: <None>

Min Conc: 0

118 Sn [No Gas] ISTD : 159 Tb [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	1274.52	0.0002	P	1.6
2	☐	5.000	4.502	23225.48	0.0040	P	1.3
3	☐	50.000	49.168	239065.97	0.0420	P	1.4
4	☐	125.000	121.408	602746.28	0.1034	P	1.3
5	☐	250.000	239.740	1213791.57	0.2039	P	1.5
6	☐	500.000	502.301	2578468.54	0.4270	A	2.1
7	☐	1000.000	1001.908	5171085.82	0.8515	A	2.6
8	☐			3950.58	0.0007	P	2.5

$$y = 8.4968\text{E-}004 * x + 2.2001\text{E-}004$$

$$R = 0.9999$$

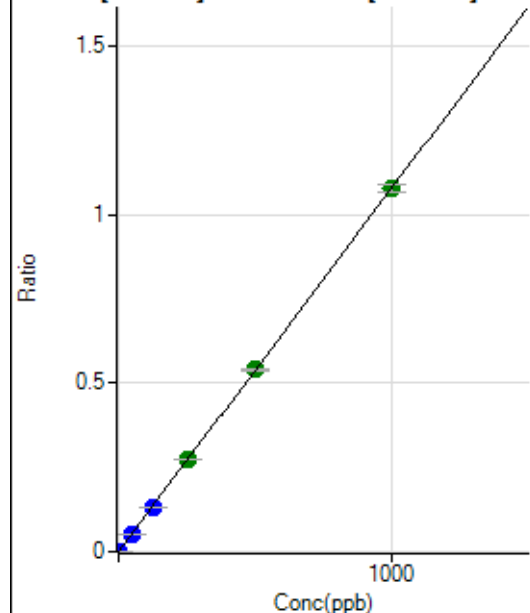
$$DL = 0.01252$$

$$BEC = 0.2589$$

Weight: <None>

Min Conc: 0

121 Sb [No Gas] ISTD : 159 Tb [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det	RSD
1	☐	0.000	0.000	63.33	0.0000	P	5.4
2	☐	2.000	1.852	11516.92	0.0020	P	5.3
3	☐	50.000	48.853	299691.95	0.0527	P	0.8
4	☐	125.000	121.613	764090.93	0.1311	P	0.9
5	☐	250.000	253.243	1624276.35	0.2729	A	1.3
6	☐	500.000	501.843	3265460.85	0.5408	A	1.4
7	☐	1000.000	998.749	6535378.51	1.0762	A	2.1
8	☐			5965.73	0.0010	P	3.4

$$y = 0.0011 * x + 1.0933\text{E-}005$$

$$R = 1.0000$$

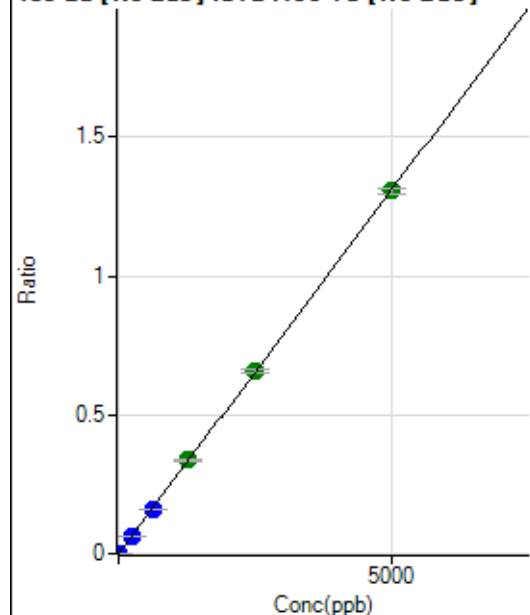
$$DL = 0.001641$$

$$BEC = 0.01015$$

Weight: <None>

Min Conc: 0

135 Ba [No Gas] ISTD :159 Tb [No Gas]



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	58.89	0.0000	P	16.3
2	☐	10.000	8.784	13266.25	0.0023	P	1.6
3	☐	250.000	243.227	362582.56	0.0637	P	2.7
4	☐	625.000	600.051	916373.67	0.1572	P	0.9
5	☐	1250.000	1282.881	2000021.43	0.3360	A	0.9
6	☐	2500.000	2511.825	3972823.03	0.6579	A	1.3
7	☐	5000.000	4989.327	7935186.69	1.3068	A	1.3
8	☐			3300.41	0.0006	P	0.2

$$y = 2.6191\text{E-}004 * x + 1.0155\text{E-}005$$

$$R = 0.9999$$

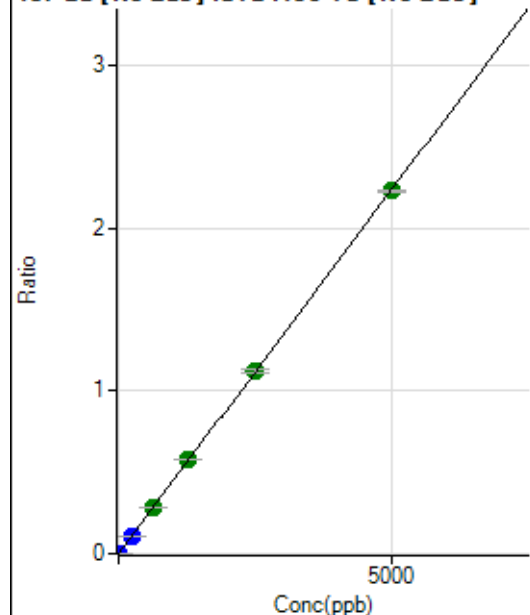
$$DL = 0.01893$$

$$BEC = 0.03877$$

Weight: <None>

Min Conc: 0

137 Ba [No Gas] ISTD :159 Tb [No Gas]



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	108.89	0.0000	P	20.0
2	☐	10.000	8.839	22776.06	0.0040	P	0.4
3	☐	250.000	243.661	619628.43	0.1089	P	0.8
4	☐	625.000	638.103	1661925.30	0.2850	A	1.6
5	☐	1250.000	1285.342	3417364.57	0.5741	A	0.5
6	☐	2500.000	2506.792	6761151.85	1.1197	A	2.1
7	☐	5000.000	4986.450	13524600.91	2.2272	A	0.5
8	☐			5825.69	0.0010	P	5.7

$$y = 4.4666\text{E-}004 * x + 1.8796\text{E-}005$$

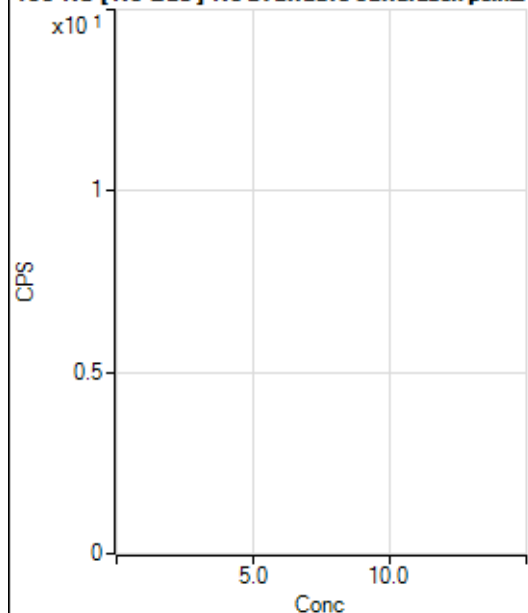
$$R = 1.0000$$

$$DL = 0.02526$$

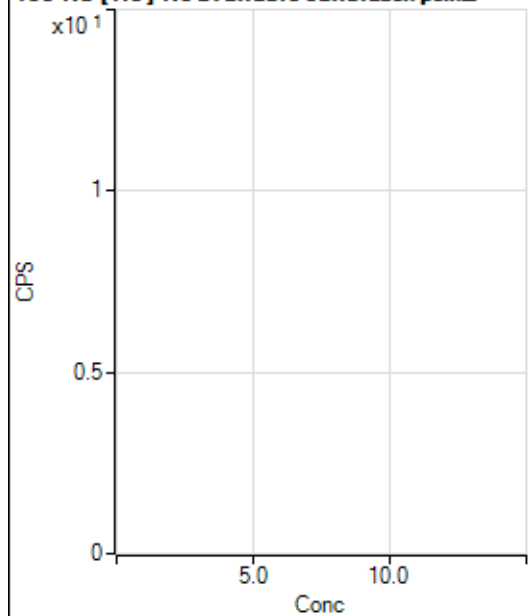
$$BEC = 0.04208$$

Weight: <None>

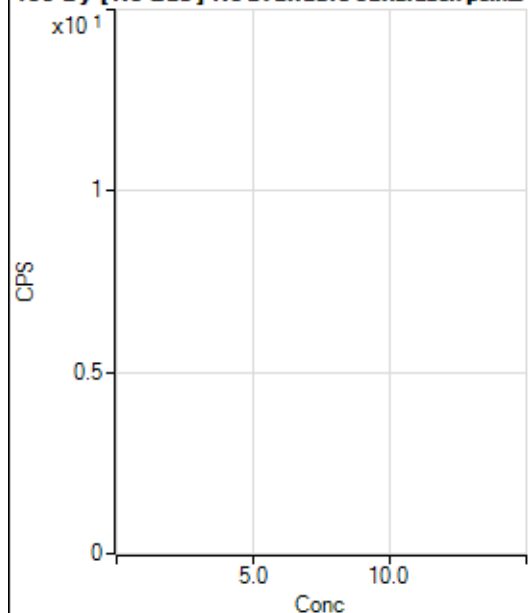
Min Conc: 0

150 Nd [No Gas] No available calibration points

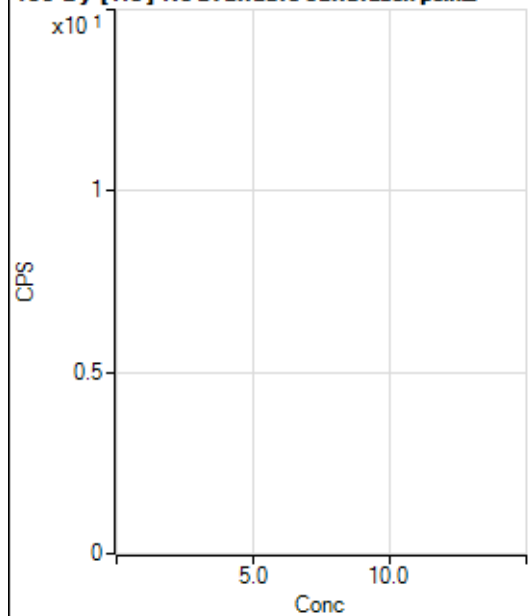
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			8.89		P	43.3
2	☐			14.44		P	13.4
3	☐			31.11		P	6.2
4	☐			41.11		P	28.5
5	☐			71.11		P	10.8
6	☐			142.22		P	23.5
7	☐			256.67		P	4.7
8	☐			111.11		P	22.1

150 Nd [He] No available calibration points

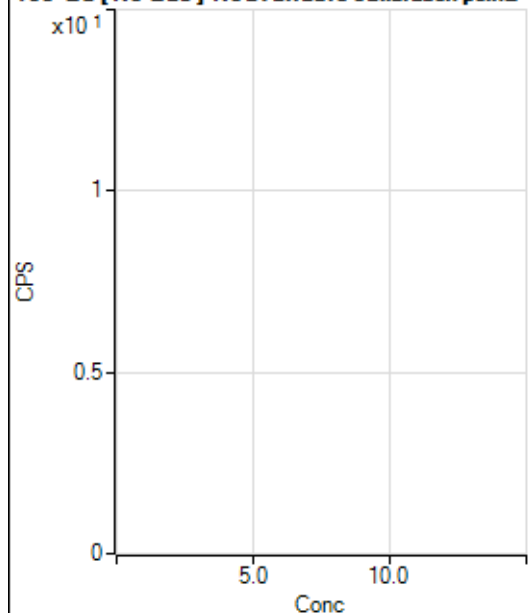
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			2.22		P	86.6
2	☐			2.22		P	86.6
3	☐			8.89		P	43.3
4	☐			13.33		P	50.0
5	☐			23.33		P	62.3
6	☐			42.22		P	31.9
7	☐			56.67		P	23.5
8	☐			64.44		P	7.9

156 Dy [No Gas] No available calibration points

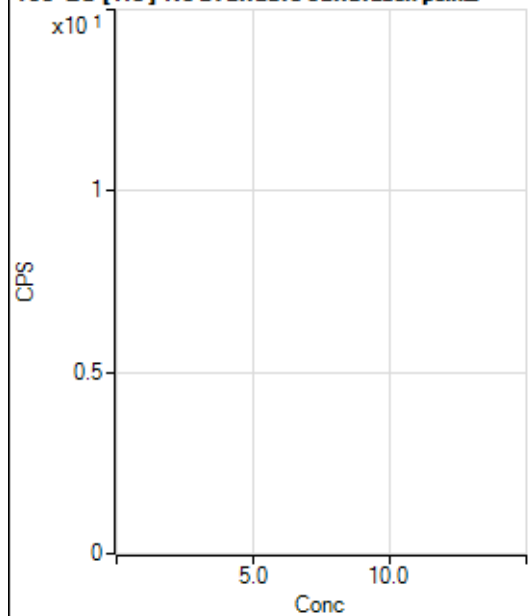
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			73.34		P	31.5
2	☐			64.44		P	28.5
3	☐			78.89		P	21.7
4	☐			153.34		P	10.0
5	☐			78.89		P	14.8
6	☐			123.34		P	7.1
7	☐			181.11		P	24.7
8	☐			236.67		P	7.5

156 Dy [He] No available calibration points

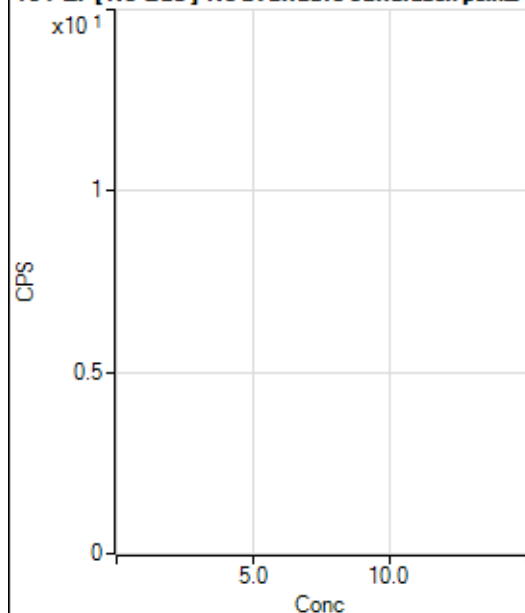
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			14.44		P	58.1
2	☐			22.22		P	17.3
3	☐			34.44		P	22.3
4	☐			145.56		P	12.6
5	☐			94.44		P	25.0
6	☐			185.56		P	7.5
7	☐			392.23		P	5.8
8	☐			197.78		P	8.5

160 Gd [No Gas] Noavailable calibration poin...

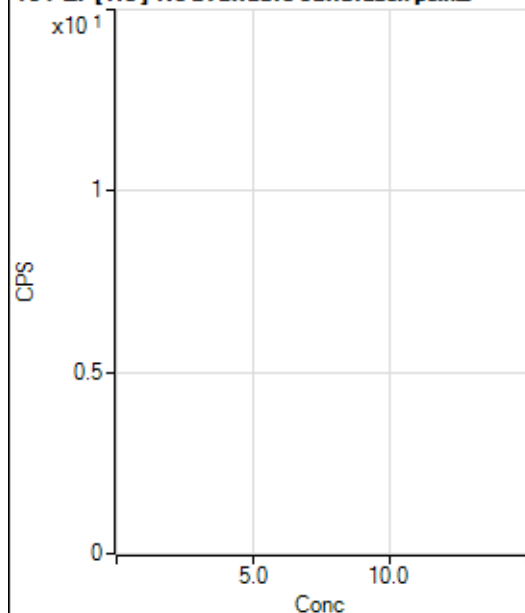
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			26.66		P	21.7
2	☐			27.78		P	60.4
3	☐			45.56		P	63.1
4	☐			31.11		P	37.6
5	☐			47.78		P	8.1
6	☐			42.22		P	4.6
7	☐			98.89		P	13.6
8	☐			184.45		P	8.1

160 Gd [He] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			161.11		P	6.3
2	☐			167.78		P	4.6
3	☐			187.78		P	13.3
4	☐			167.78		P	12.0
5	☐			152.23		P	5.5
6	☐			211.12		P	14.6
7	☐			227.78		P	10.6
8	☐			272.23		P	22.1

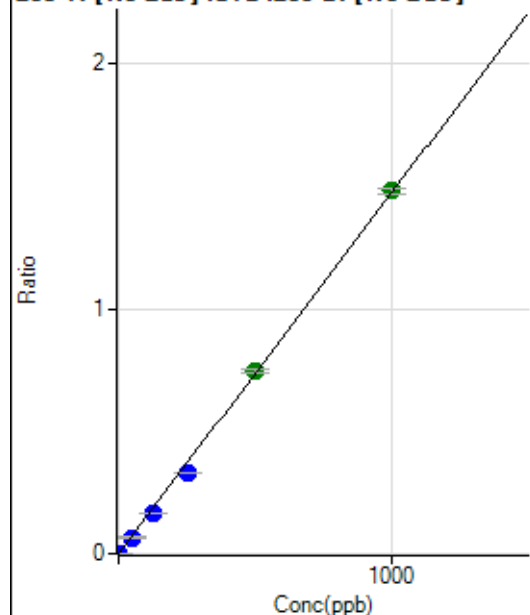
164 Er [No Gas] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			53.33		P	43.7
2	☐			48.89		P	19.7
3	☐			35.55		P	10.8
4	☐			65.55		P	46.1
5	☐			58.89		P	25.5
6	☐			68.89		P	2.8
7	☐			110.00		P	21.2
8	☐			230.00		P	15.3

164 Er [He] No available calibration points

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐			32.22		P	47.8
2	☐			32.22		P	39.2
3	☐			34.45		P	31.1
4	☐			40.00		P	36.3
5	☐			34.44		P	40.3
6	☐			47.78		P	24.5
7	☐			86.67		P	10.2
8	☐			153.34		P	2.2

203 Tl [No Gas] ISTD :209 Bi [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	101.11	0.0000	P	27.7
2	☐	1.000	0.852	4057.32	0.0013	P	3.6
3	☐	50.000	45.267	209448.79	0.0666	P	1.8
4	☐	125.000	111.612	534617.50	0.1643	P	1.7
5	☐	250.000	223.939	1096456.15	0.3296	P	0.6
6	☐	500.000	504.595	2533350.10	0.7425	A	2.1
7	☐	1000.000	1006.128	5072128.71	1.4806	A	1.8
8	☐			908.93	0.0003	P	15.4

$$y = 0.0015 * x + 3.1836E-005$$

$$R = 0.9996$$

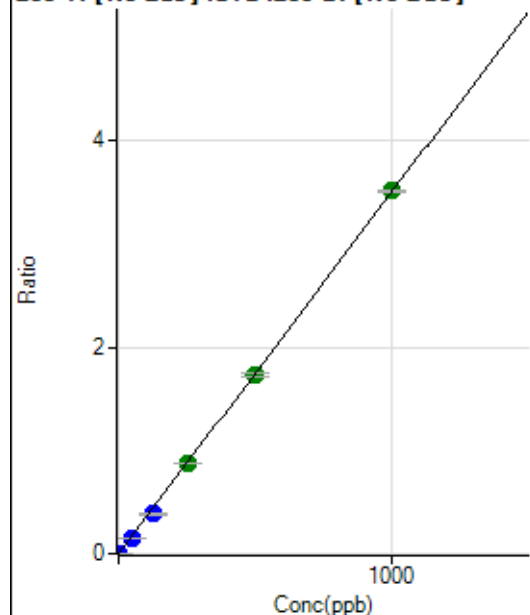
$$DL = 0.01797$$

$$BEC = 0.02163$$

Weight: <None>

Min Conc: 0

205 Tl [No Gas] ISTD :209 Bi [No Gas]



	R _j ct	Conc.	Calc Conc.	CPS	Ratio	Det.	RSD
1	☐	0.000	0.000	234.45	0.0001	P	11.3
2	☐	1.000	0.828	9373.31	0.0030	P	2.4
3	☐	50.000	44.376	487559.98	0.1551	P	2.2
4	☐	125.000	109.798	1248977.74	0.3838	P	1.3
5	☐	250.000	250.135	2908199.40	0.8742	A	1.5
6	☐	500.000	494.804	5899705.54	1.7292	A	1.6
7	☐	1000.000	1004.746	12028826.49	3.5112	A	0.6
8	☐			1949.05	0.0006	P	10.8

$$y = 0.0035 * x + 7.3616E-005$$

$$R = 0.9999$$

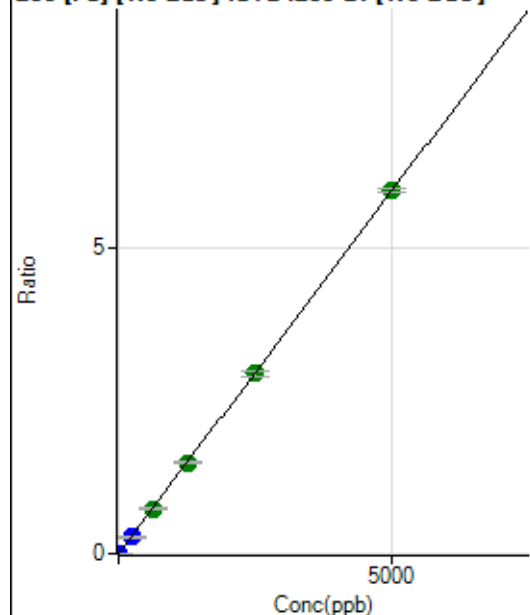
$$DL = 0.007147$$

$$BEC = 0.02107$$

Weight: <None>

Min Conc: 0

206 [Pb] [No Gas] ISTD :209 Bi [No Gas]



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	208.89	0.0001	P	8.2
2	☐	1.000	0.838	3337.11	0.0011	P	4.9
3	☐	250.000	225.714	839726.22	0.2673	P	3.7
4	☐	625.000	617.318	2378562.25	0.7309	A	3.0
5	☐	1250.000	1257.498	4952649.51	1.4887	A	1.2
6	☐	2500.000	2487.643	10047246.72	2.9450	A	2.8
7	☐	5000.000	5006.478	20303111.78	5.9270	A	1.0
8	☐			4600.83	0.0015	P	8.2

$$y = 0.0012 * x + 6.5412E-005$$

$$R = 1.0000$$

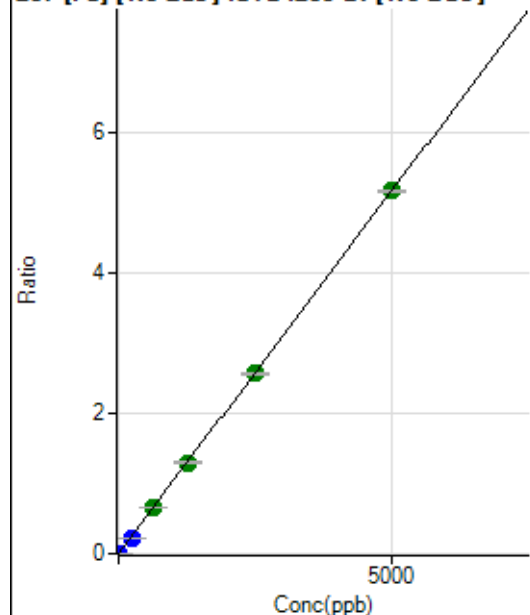
$$DL = 0.01361$$

$$BEC = 0.05525$$

Weight: <None>

Min Conc: 0

207 [Pb] [No Gas] ISTD :209 Bi [No Gas]



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	207.78	0.0001	P	7.2
2	☐	1.000	0.815	2868.11	0.0009	P	3.2
3	☐	250.000	222.192	722716.14	0.2299	P	2.1
4	☐	625.000	627.749	2113818.89	0.6495	A	1.4
5	☐	1250.000	1258.060	4330020.25	1.3016	A	1.6
6	☐	2500.000	2490.535	8791145.43	2.5767	A	1.2
7	☐	5000.000	5003.764	17734362.93	5.1768	A	0.6
8	☐			3979.52	0.0013	P	7.3

$$y = 0.0010 * x + 6.5049E-005$$

$$R = 1.0000$$

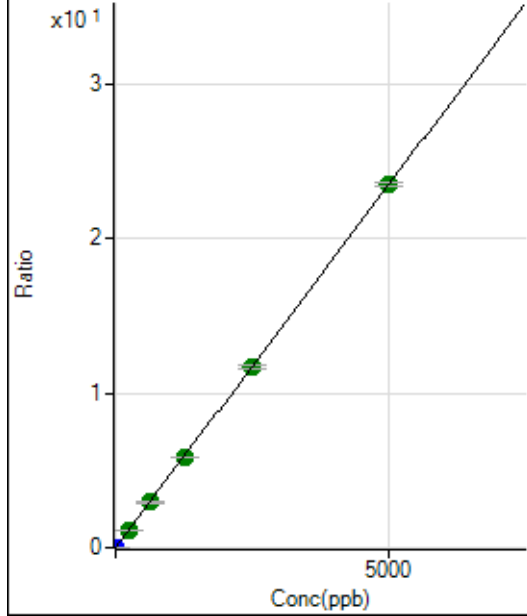
$$DL = 0.01351$$

$$BEC = 0.06288$$

Weight: <None>

Min Conc: 0

208 Pb [No Gas] ISTD :209 Bi [No Gas]



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	856.68	0.0003	P	7.5
2	☐	1.000	0.824	13064.80	0.0041	P	3.8
3	☐	250.000	238.299	3521120.76	1.1203	A	2.2
4	☐	625.000	624.344	9551299.96	2.9349	A	2.0
5	☐	1250.000	1253.906	19608645.43	5.8940	A	0.7
6	☐	2500.000	2497.366	40049082.67	11.7386	A	1.9
7	☐	5000.000	5001.008	80528760.47	23.5065	A	1.1
8	☐			17892.51	0.0057	P	6.6

$$y = 0.0047 * x + 2.6826E-004$$

$$R = 1.0000$$

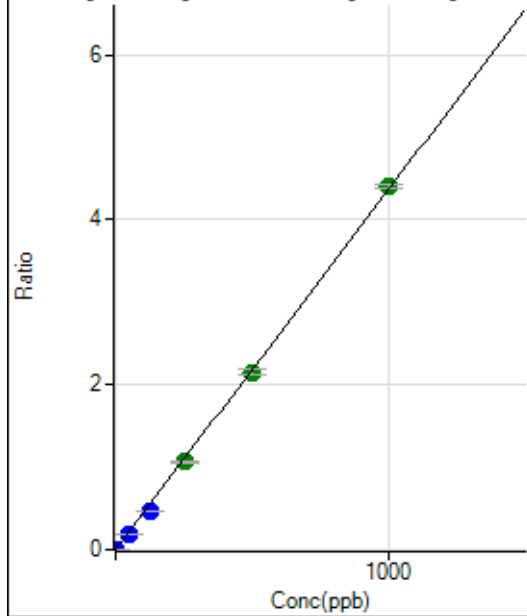
$$DL = 0.01292$$

$$BEC = 0.05707$$

Weight: <None>

Min Conc: 0

238 U [No Gas] ISTD :209 Bi [No Gas]



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	0.000	0.000	15.56	0.0000	P	52.2
2	☐	1.000	0.785	10821.14	0.0034	P	3.1
3	☐	50.000	42.211	578753.40	0.1842	P	3.6
4	☐	125.000	105.292	1495298.12	0.4595	P	1.5
5	☐	250.000	244.758	3553458.63	1.0680	A	2.0
6	☐	500.000	493.156	7341447.46	2.1519	A	2.6
7	☐	1000.000	1007.585	15062345.47	4.3967	A	0.9
8	☐			1071.17	0.0003	P	20.2

$$y = 0.0044 * x + 4.8328E-006$$

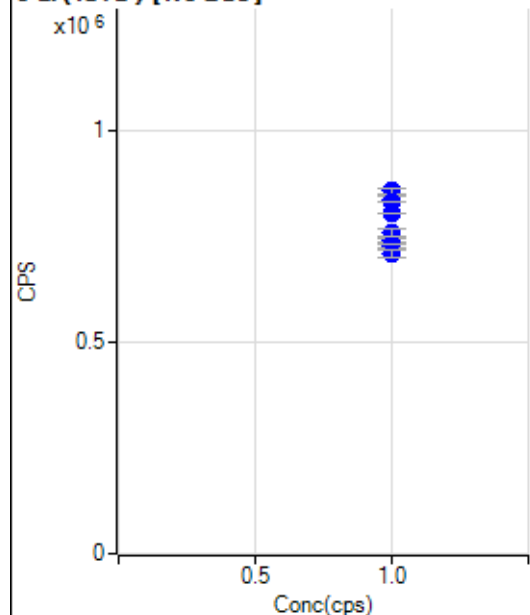
$$R = 0.9998$$

$$DL = 0.001734$$

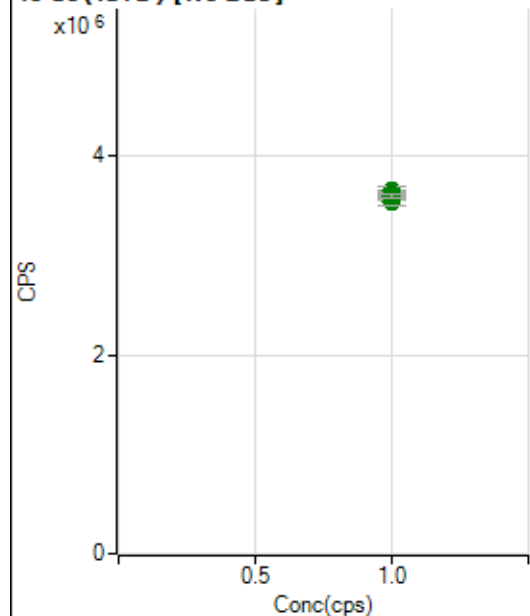
$$BEC = 0.001108$$

Weight: <None>

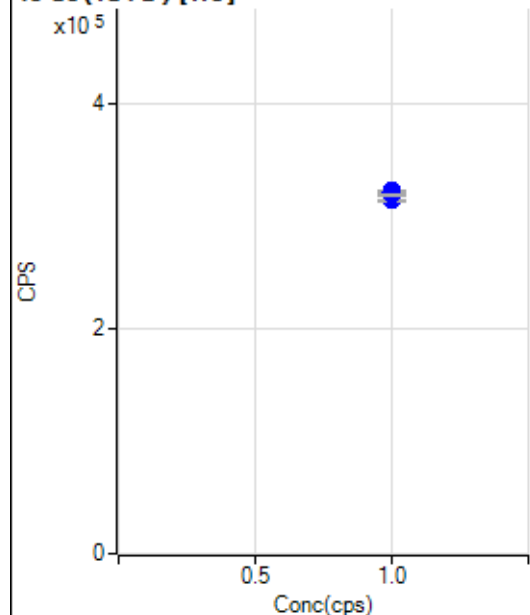
Min Conc: 0

6 Li (ISTD) [No Gas]

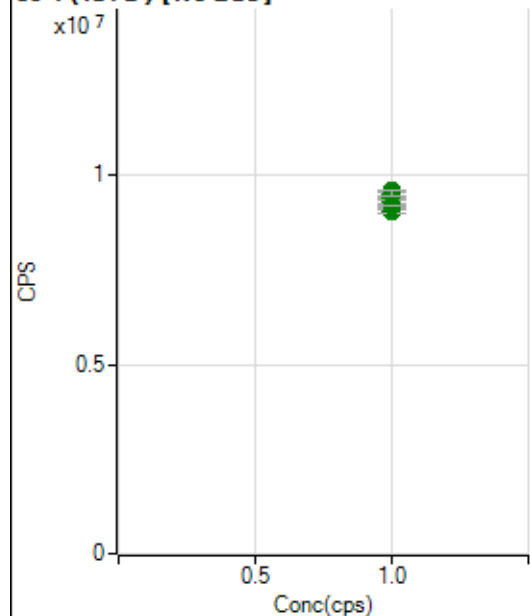
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		741030.72		P	1.7
2	☐	1.000		725825.75		P	1.2
3	☐	1.000		710659.51		P	2.5
4	☐	1.000		758616.68		P	2.1
5	☐	1.000		805663.32		P	0.1
6	☐	1.000		838205.50		P	2.0
7	☐	1.000		857711.93		P	1.5
8	☐	1.000		833334.85		P	0.0

45 Sc (ISTD) [No Gas]

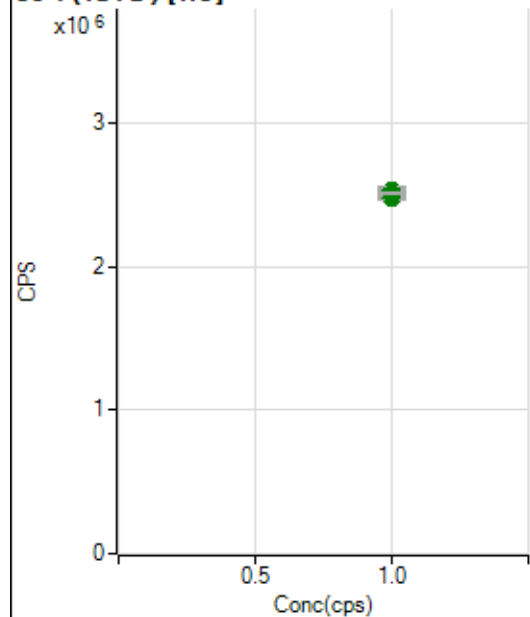
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		3635960.29		A	1.4
2	☐	1.000		3584612.97		A	0.9
3	☐	1.000		3536895.30		A	2.0
4	☐	1.000		3594721.78		A	0.7
5	☐	1.000		3620638.38		A	0.8
6	☐	1.000		3651950.26		A	1.9
7	☐	1.000		3616845.15		A	0.9
8	☐	1.000		3605008.07		A	1.2

45 Sc (ISTD) [He]

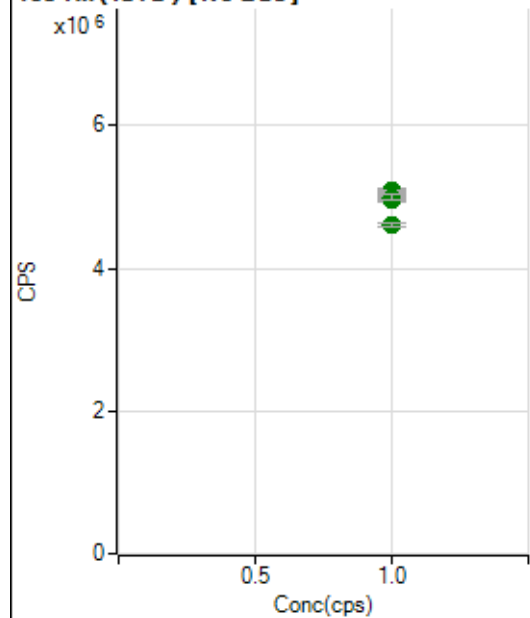
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		321495.70		P	0.7
2	☐	1.000		321823.94		P	0.6
3	☐	1.000		318590.42		P	0.7
4	☐	1.000		320990.81		P	0.1
5	☐	1.000		318801.61		P	0.1
6	☐	1.000		320596.35		P	1.5
7	☐	1.000		313392.26		P	0.7
8	☐	1.000		318214.52		P	0.5

89 Y (ISTD) [No Gas]

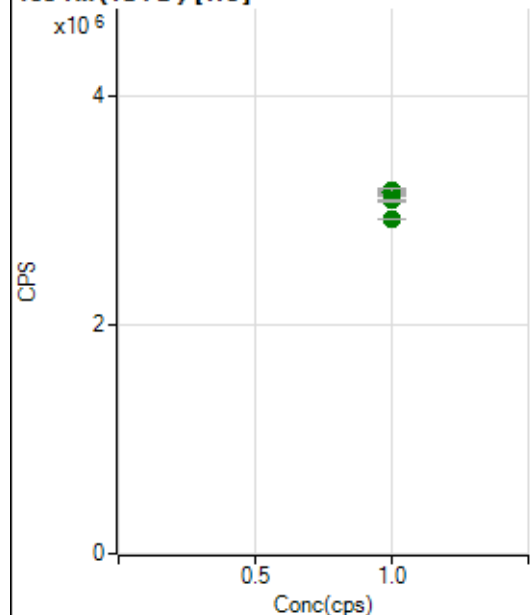
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		9292601.80		A	1.4
2	☐	1.000		9160772.92		A	0.8
3	☐	1.000		9033399.93		A	1.0
4	☐	1.000		9306855.14		A	1.5
5	☐	1.000		9415415.55		A	1.0
6	☐	1.000		9589281.80		A	0.4
7	☐	1.000		9529100.27		A	1.4
8	☐	1.000		9201625.77		A	0.3

89 Y(ISTD) [He]

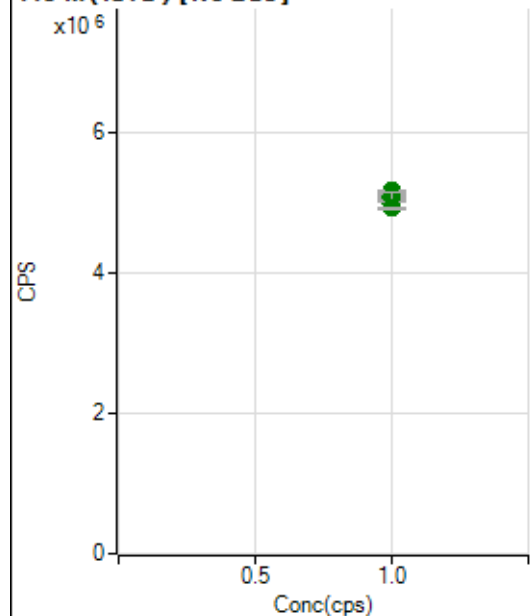
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		2512355.52		A	1.6
2	☐	1.000		2510024.32		A	0.8
3	☐	1.000		2497113.14		A	1.7
4	☐	1.000		2523631.06		A	1.2
5	☐	1.000		2523669.09		A	0.7
6	☐	1.000		2524788.50		A	2.3
7	☐	1.000		2472872.08		A	1.0
8	☐	1.000		2506519.41		A	0.7

103 Rh(ISTD) [No Gas]

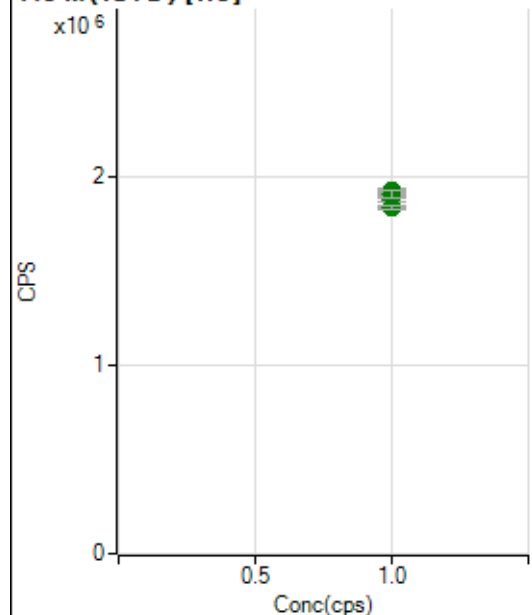
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		5067177.28		A	2.4
2	☐	1.000		5006132.29		A	0.6
3	☐	1.000		4958263.71		A	1.4
4	☐	1.000		5006875.03		A	1.2
5	☐	1.000		5040801.21		A	1.1
6	☐	1.000		5082704.51		A	0.3
7	☐	1.000		4992704.61		A	1.3
8	☐	1.000		4609217.64		A	0.9

103 Rh (ISTD) [He]

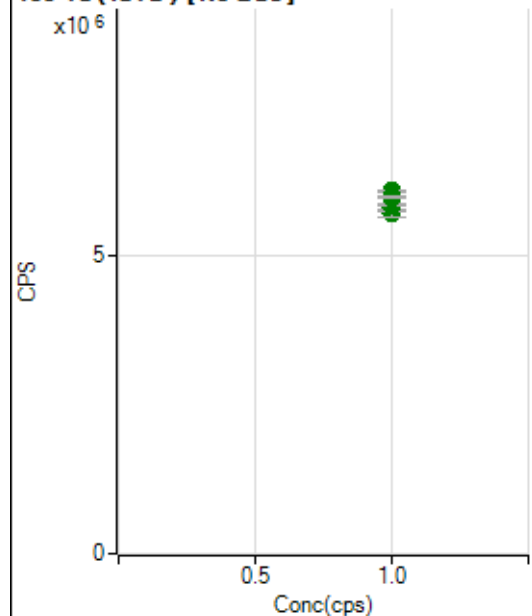
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		3173235.40		A	1.5
2	☐	1.000		3142432.24		A	0.4
3	☐	1.000		3138086.93		A	0.9
4	☐	1.000		3156415.65		A	0.5
5	☐	1.000		3164989.26		A	0.6
6	☐	1.000		3161486.17		A	1.9
7	☐	1.000		3086843.88		A	0.4
8	☐	1.000		2926576.10		A	0.2

115 In (ISTD) [No Gas]

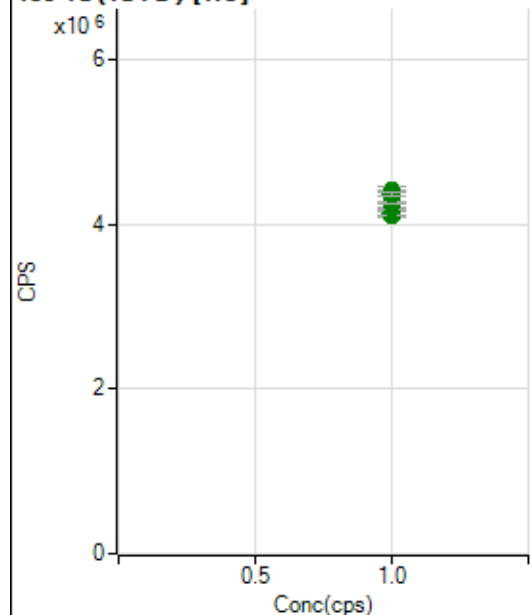
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		5084080.33		A	1.2
2	☐	1.000		5052083.01		A	0.2
3	☐	1.000		4980479.17		A	2.0
4	☐	1.000		5071248.46		A	0.8
5	☐	1.000		5124016.11		A	0.4
6	☐	1.000		5171351.79		A	0.8
7	☐	1.000		5087817.52		A	2.4
8	☐	1.000		4923910.10		A	0.9

115 In (ISTD) [He]

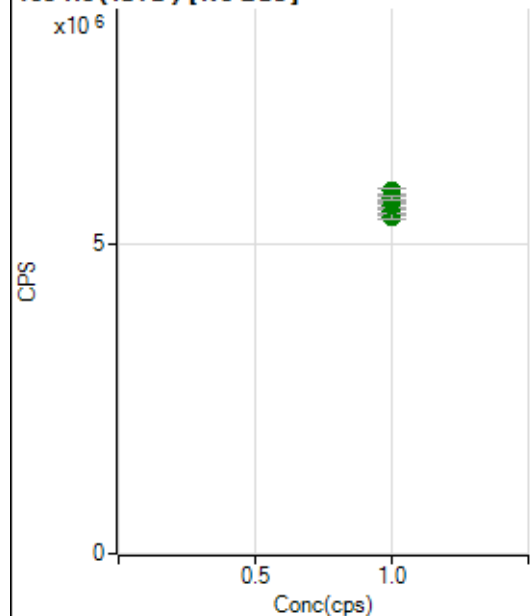
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		1889627.05		A	0.3
2	☐	1.000		1909404.20		A	1.5
3	☐	1.000		1873673.11		A	1.1
4	☐	1.000		1921914.95		A	1.2
5	☐	1.000		1911564.49		A	0.3
6	☐	1.000		1906276.77		A	1.8
7	☐	1.000		1835720.04		A	0.7
8	☐	1.000		1834287.00		A	0.9

159 Tb (ISTD) [No Gas]

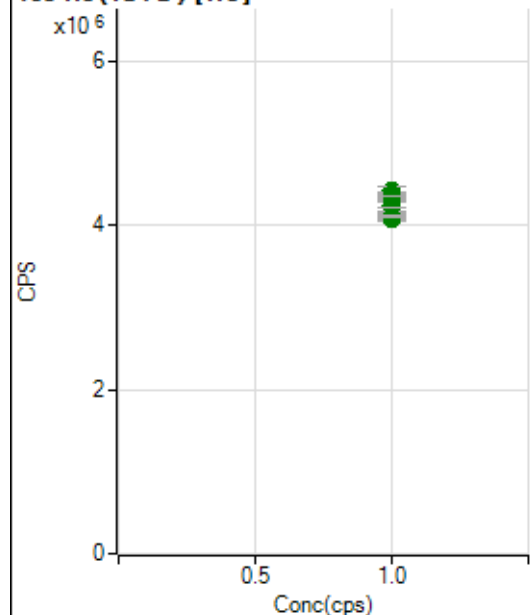
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		5793299.01		A	1.0
2	☐	1.000		5741487.00		A	0.4
3	☐	1.000		5692291.23		A	1.8
4	☐	1.000		5830377.34		A	0.5
5	☐	1.000		5952333.94		A	0.2
6	☐	1.000		6039259.01		A	1.4
7	☐	1.000		6072243.80		A	0.8
8	☐	1.000		5974572.27		A	0.9

159 Tb (ISTD) [He]

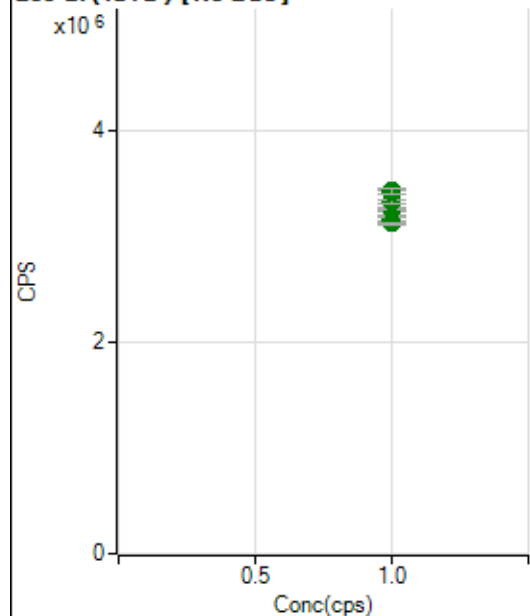
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		4100690.25		A	0.3
2	☐	1.000		4128123.41		A	0.8
3	☐	1.000		4122183.62		A	1.1
4	☐	1.000		4197197.68		A	0.5
5	☐	1.000		4254135.77		A	0.6
6	☐	1.000		4403525.59		A	2.5
7	☐	1.000		4386914.28		A	1.6
8	☐	1.000		4363136.32		A	1.5

165 Ho (ISTD) [No Gas]

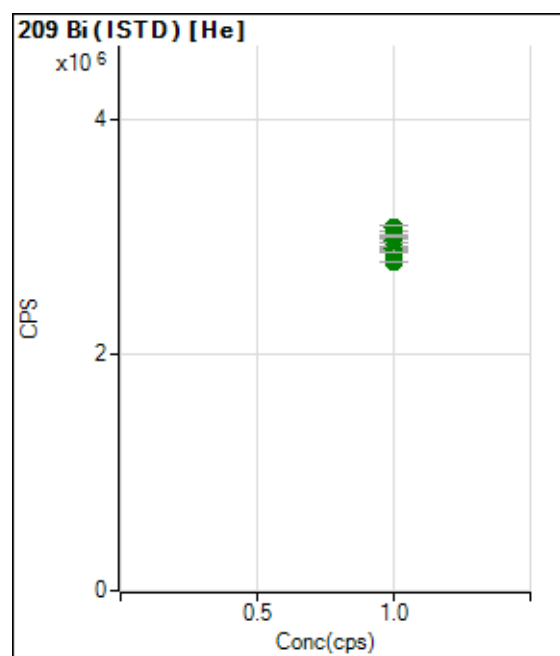
	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		5542935.68		A	0.8
2	☐	1.000		5494693.67		A	0.9
3	☐	1.000		5456110.13		A	1.9
4	☐	1.000		5620770.06		A	1.1
5	☐	1.000		5698762.97		A	0.2
6	☐	1.000		5817862.27		A	0.6
7	☐	1.000		5872846.37		A	1.3
8	☐	1.000		5756212.62		A	1.2

165 Ho (ISTD) [He]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		4068914.66		A	0.8
2	☐	1.000		4154323.27		A	0.6
3	☐	1.000		4114252.85		A	0.9
4	☐	1.000		4254747.12		A	1.2
5	☐	1.000		4335917.44		A	0.6
6	☐	1.000		4424128.27		A	2.4
7	☐	1.000		4395228.72		A	0.5
8	☐	1.000		4363279.21		A	0.3

209 Bi (ISTD) [No Gas]

	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		3190320.06		A	2.6
2	☐	1.000		3157437.07		A	1.9
3	☐	1.000		3143409.78		A	2.2
4	☐	1.000		3254573.56		A	0.4
5	☐	1.000		3327013.25		A	1.1
6	☐	1.000		3411988.59		A	0.8
7	☐	1.000		3425689.81		A	1.5
8	☐	1.000		3117262.90		A	0.7



	Rj ct	Conc.	Calc Conc.	CPS	Ratio	Det .	RSD
1	☐	1.000		2913298.39		A	0.5
2	☐	1.000		2875850.65		A	0.6
3	☐	1.000		2896607.21		A	1.3
4	☐	1.000		2975755.23		A	1.4
5	☐	1.000		3000875.30		A	1.0
6	☐	1.000		3077664.64		A	1.9
7	☐	1.000		3015346.59		A	0.5
8	☐	1.000		2789790.96		A	0.4